HONDA Service Bulletin



Applies To: **2012 Ridgeline** – Check the iN VIN status for eligibility

August 31, 2012

Safety Recall: Hazard Switch Assembly With Incorrect "Passenger Airbag Off" Indicator

BACKGROUND

A dashboard hazard switch assembly incorporating an incorrect "passenger airbag off" indicator may have been installed on seventeen 2012 Ridgelines. The passenger airbag off indicator on the switch does not comply with FMVSS 208.

CUSTOMER NOTIFICATION

All owners of affected vehicles will be notified of this safety recall.

Do an **iN VIN status inquiry** to make sure the vehicle is shown as eligible.

Some vehicles affected by this recall may be in your new or used vehicle inventory. As a matter of federal law, these vehicles **must** be repaired before they are sold.

Should a dealership sell an unrepaired vehicle that subsequently causes injury or damage because of the recalled item, the dealership will be solely responsible to the damaged party, and will be required to defend and indemnify American Honda for any resulting claims. To see if a vehicle in inventory is affected by this recall, do a VIN status inquiry before selling it.

CORRECTIVE ACTION

Inspect the passenger airbag indicator, then replace the hazard switch assembly, if needed.

NOTE: Since there are only 17 affected vehicles and not all of them are anticipated to have the incorrect passenger airbag indicator, to minimize unnecessary parts demand, only order a replacement switch after you have confirmed that an incorrect switch was installed. You may be able to determine whether a new assembly is needed when the customer makes a repair appointment.

PARTS INFORMATION


Hazard Switch Assembly: P/N 35510-SJC-A11ZB

WARRANTY CLAIM INFORMATION

Operation Number:	7271B3
Flat Rate Time:	0.2 hour
Failed Part:	35510-SJC-A11ZB
Defect Code:	5WJ00
Symptom Code:	S5200
Skill Level:	Repair Technician

INSPECTION PROCEDURE

Inspect the passenger airbag off indicator; it is on the dashboard hazard switch assembly.

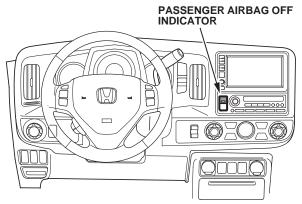

Use the illustrations to determine if the indicator is correct or not correct.





CORRECT

NOT CORRECT Replace the switch.

Correct – If the indicator is correct, no repair is necessary.

Not Correct – If the indicator is **not** correct, go to REPAIR PROCEDURE.

REPAIR PROCEDURE

Replace the hazard switch assembly:

- · Refer to the appropriate service manual, or
- Online, enter keyword INSTRUMENT, and select Instrument Panel Removal/Installation from the list.

© 2012 American Honda Motor Co., Inc. – All Rights Reserved

ATB 47685 (1208)

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

