

# Federal Recall Information

---

**13KWD**

## Supplier

IMMI

---

## Description

Recall 13KWD T680/T880 Seat Belt Buckle Cable

---

## Release Date

5/7/2013

---

## Introduction

Kenworth Truck Company has decided that a defect which relates to motor vehicle safety exists in certain Kenworth model T680 and T880 vehicles manufactured between January 18, 2012 and February 25, 2013. A total of 1,326 US chassis and 186 Canadian chassis are involved in this recall. The chassis list and a copy of the customer letter are attached. The DWC and SIR online systems indicate chassis involved in this recall with the designator of **"13KWD"**.

---

## Situation

On T680 and T880 models built during the time period indicated above, the seat belt buckle anchoring cables on air suspension seats may fray after being repeatedly bent during use. In-truck use can cause bending of up to 90° from vertical in either direction. A frayed seatbelt cable could cause the belt system to fail in its function of restraining an occupant during a rapid deceleration or crash and, in turn, cause personal injury.

---

## Resolution

**Note:** Part kits for this recall will become available through PACCAR Parts in limited quantities beginning on 4/19/13, with additional quantities following. Please schedule customer repair appointments accordingly.

On air ride seats only (fixed seats are not affected), replace both the driver seat and passenger seat seat belt buckle assemblies by ordering kit part number S74-1006-100 (for passenger seat buckle assemblies **without** an electronic switch), S74-1006-300 (for driver seat buckle assemblies **without** an electronic switch), or S74-1006-400 (for driver seat buckle assemblies **with** an electronic switch). See attached chassis list for type and quantity of buckles on affected chassis. The kit includes instructions, fasteners, and a replacement passenger seat adjustment handle.

**It is a violation of Federal law for a dealer to sell or lease new vehicles covered by this recall until the defect or noncompliance has been corrected.**

## Warranty

SIR will indicate chassis involved in this recall with the designator of "**13KWD**" in the campaign field.

Referring to the attached chassis list, submit the appropriate Quick Claim from the table below.

Quick Claim	Driver Seat	Passenger Seat
13KWD1	Air WITHOUT Switch	Static Seat
13KWD2	Air WITHOUT Switch	Air WITHOUT Switch
13KWD3	Air WITH Switch	Static Seat
13KWD4	Air WITH Switch	Air WITHOUT Switch

Coding for this recall is:

For Field...	Enter...
Failure Location	002-011-005
Failure Type	470 – Wrong Part
Claim Type	C
Campaign Number	13KWD
Labor	SRT 002-259 @ 0.4 hours per buckle

---

CCC Notes	Replace seat belt anchor cables per Recall 13KWD.
-----------	---

---

## Parts

**Note:** Part supplies for this Safety Recall are limited. Please ensure you have parts on hand before you schedule a repair appointment.

This recall will cover parts purchased through PACCAR Parts (dealer net+ 30% parts mark up) according to the following table.

**Refer to the attached chassis list for information about which buckle assemblies are required for each chassis.**

Quantity	Part Number	Description
See chassis list	S74-1006-100	Kit for Passenger Seat buckle assemblies <b>without</b> an electronic switch
See chassis list	S74-1006-300	Kit for Driver Seat buckle assemblies <b>without</b> an electronic switch
See chassis list	S74-1006-400	Kit for Driver Seat buckle assemblies <b>with</b> an electronic switch

---

## Labor

This recall will reimburse for 0.40 hours labor for per buckle change. See appropriate Quick Claim on attached chassis list.

---

## Procedure

Refer to the attached procedure for detailed instructions on how to replace both driver seat and passenger seat seat buckle assemblies.

---

## Attachments

 [13KWD Chassis List for ePortal](#)

 [Driver Buckle Replacement 3-14](#)

 [Passenger Buckle Replacement 3-14](#)

 [13KWD U.S. Customer Letter](#)