

Federal Recall Information

313-D

Supplier

IMMI

Description

Recall 313-D - Models 567/579/587 Seat Belt Buckle Cable

Release Date

5/10/2013

Introduction

Peterbilt Motors Company has decided that a defect that relates to motor vehicle safety exists in certain Peterbilt Model 567/579/587 vehicles manufactured between January 18, 2012 and February 25, 2013. A total of 1,183 US chassis and 136 Canadian chassis are involved in this recall. The chassis list and a copy of the customer letter are attached. The DWC and SIR online systems indicate chassis involved in this recall with the designator of "313-D".

Situation

On vehicles built during the period indicated above, the seat belt buckle anchoring cables on certain air suspension seats may fray after being repeatedly bent during use and can cause bending of up to 90° from vertical in either direction. A frayed seatbelt cable could cause the belt system to fail in its function of restraining an occupant during a rapid deceleration or crash and, in turn, cause personal injury.

Resolution

On air ride seats only (fixed seats are not affected), replace air driver seat belt buckle with S74-1006-300 and air passenger seat belt buckle with S74-1006-100. See attached chassis list for type and quantity of buckles on affected chassis.

It is a violation of Federal law for a dealer to sell or lease new vehicles covered by this recall until the defect or noncompliance has been corrected.

Warranty

SIR will indicate chassis involved in this recall with the designator of "313-D" in the campaign field.

Please Note: You must refer to the attached chassis list and submit the appropriate Quick Claim.

Coding for this recall is:

For Field...	Enter...
Failure Location	002-011-005
Failure Type	705
Claim Type	C
Campaign Number	313-D
Labor SRT	002-253 @ 0.4 hours per buckle
CCC Notes	Replace seat belt anchor cables per Recall 313-D.

Parts

Please Note: Part supplies for this Safety Recall are limited. Please ensure you have parts on hand before you schedule a repair appointment.

This recall will cover parts purchased through PACCAR Parts (dealer net+ 30% parts markup) according to the following table.

Refer to the attached chassis list for information about which buckle assemblies are required for each chassis.

Quantity	Part Number	Description
See chassis list	S74-1006-300	Kit for driver air seat buckle assemblies without switch
See chassis list	S74-1006-100	Kit for passenger air seat buckle assemblies without switch

Labor

This recall will reimburse for 0.40 hours labor for per buckle change. See appropriate Quick Claim on attached chassis list.

Attachments

[313-D Chassis List](#)

[313-D Driver Buckle Replacement](#)

[313-D Pass Buckle Replacement](#)

[313-D US Customer Letter](#)