



Navistar, Inc.
2701 Navistar Drive
Lisle, IL 60532 USA

navistar.com

MAILED

FEB 06 2014

Compliance Dept.



A NAVISTAR COMPANY

INTERIM NOTICE SAFETY RECALL 13517

JANUARY 2014

Dear INTERNATIONAL® Customer,

This notice applies to your vehicle identified on the enclosed card and is being sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

Navistar has decided that a defect which relates to motor vehicle safety exists in certain ProStar® model trucks built 12 December 2012 thru 8 August 2013 with feature code 16XSA, 16XSB, 16XSC, or 16XSD chassis skirts.

REASON FOR THIS RECALL

During vehicle operation, the rear chassis skirt upper horizontal support S-bracket may contact the fuel tanks during frame twist and it is possible for the bracket to wear a hole in the top of the fuel tank which may result in a fuel leak.

RISK TO MOTOR VEHICLE SAFETY

A hole near the top of the fuel tank may allow fuel to spill onto the roadway which may cause a slippery road condition increasing the risk of a motor vehicle crash which may result in property damage, personal injury, or death.

ACTIONS YOU SHOULD TAKE

A final remedy is under development and repair parts will not be available until late March 2014. When parts become available, you will be notified of additional actions you should take.

To prevent the occurrence of this defect in the interim period, inspect for signs of contact or punctures of right and left side fuel tanks by the chassis skirt upper horizontal support S-bracket per the instructions on the backside of this letter. If any signs of contact or punctures in the fuel tanks are found and the truck can be safely transported, bring your truck to the nearest International® dealer.

You can find your nearest dealer by calling 1-800-448-7825 or by using the dealer locator at <http://www.internationaltrucks.com>.

If you are the lessor of this vehicle, please forward a copy of this notice to the lessee within ten days to comply with federal regulations.

IF YOU NEED FURTHER ASSISTANCE

Refer to the Owner Assistance Guide section in your Owner's Manual or call toll free 1-800-448-7825.

Navistar requests your prompt attention and patience regarding the correction of this defect and apologizes for any inconvenience this may cause you.

Navistar, Inc.

WARNING! PARK VEHICLE ON HARD FLAT SURFACE, TURN THE ENGINE OFF, SET THE PARKING BRAKE AND BLOCK THE WHEELS TO PREVENT THE VEHICLE FROM MOVING IN BOTH DIRECTIONS. FAILURE TO DO SO MAY RESULT IN PROPERTY DAMAGE, PERSONAL INJURY AND/OR DEATH.

1. Standing at the left side of the vehicle rear of the cab and looking toward the front, inspect for contact between the chassis skirt upper horizontal support S-bracket and the fuel tank or punctures in the fuel tank (Figure 1).

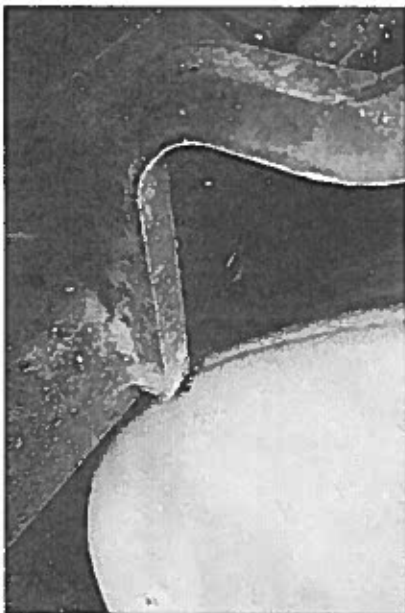


Figure 1.

2. Standing at the right side of the vehicle rear of the cab and looking toward the front, inspect for contact between the chassis skirt upper horizontal support S-bracket and the fuel tank or punctures in the fuel tank (Figure 1).