



SAFETY RECALL BULLETIN

NHTSA RECALL 13V-183

AUTOCAR, LLC SAFETY RECALL A-1303

July, 2013

Attention:

Service Managers / Parts Managers

Subject:

Windshield wiper pivot inspection and replacement on certain Xpeditor trucks

Safety Recall Information:

Autocar has identified on certain vehicles a quality concern with the weld that holds the wiper arm to the wiper motor assembly. The weld may fail without warning and may cause decreased functionality of the windshield wipers.

Vehicles Affected:

There are 797 affected vehicles with serial numbers in the range 214358 through 215533. Refer to the VIN list beginning on Page 6.

Service Responsibility:

Service sites must perform this recall on affected vehicles at no charge to the owner regardless of vehicle mileage, age or ownership. If a vehicle affected by this recall is taken into or is currently in your vehicle inventory, or at your center for service, you must perform this recall before the vehicle is sold or released to the owner.

Required Parts:

- (1) S6282000K002 Wiper pivot kit
- (1) S6281003-001 Wiper pivot LH
- (1) S6281003-002 Wiper pivot RH
 - *(1) 13-001700 Acorn nut
 - *(1) 13-001800 Lock washer
 - *(1) 13-001900 Knurled driver
 - *(1) 13-002000 Rain cap short
 - *(1) 13-002100 Hex nut
 - *(1) 13-002200 Steel washer
 - *(1) 13-002300 Rubber washer
 - *(1) Pivot shaft

* Items are included in both the LH and RH wiper pivot assembly.

To Obtain Parts:

Ensure that you have authorization from the customer to perform this work, and send an e-mail to warranty@autocartruck.com and include the following:

- VIN(s) (or last 6 digits of VIN(s))
- 'Attention To' name
- 'Ship To' address

Claims for Reimbursement:

Submit a claim for reimbursement in accordance with Autocar's Warranty Administration Manual.

Claim Coding Information:

Labor Operation Code Number	Time Allowance SRT	Description
36307.0.03	1.0 HR	Wiper Pivot



SAFETY RECALL BULLETIN

NHTSA RECALL 130V-183

AUTOCAR, LLC SAFETY RECALL A-1303

July, 2013

Tools Required:

#2 Phillips screwdriver
9/16" combination wrench
Small pry bar
Grease pencil
Torque wrench
9/16" Socket
1" wrench
1" socket

Safety Notices



WARNING

To prevent eye injury, always wear eye protection when performing vehicle maintenance, service or inspection.



WARNING

Before working on a vehicle, set the parking brake, place the transmission in neutral and block the wheels. Failure to do so can result in unexpected vehicle movement and can cause serious personal injury or death.



CAUTION

LOCKOUT/TAGOUT PROCEDURES

Before entering the vehicle or vehicle body, read and follow OSHA regulations concerning entry and working in "CONFINED SPACE" OSHA 1910.146 and "LOCKOUT/TAGOUT" OSHA 1910.147. Follow OSHA regulations while performing any work on the vehicle. The vehicle must be disabled by the following steps before performing any work on the vehicle:

1. Place the transmission in NEUTRAL.
2. Set the parking brake.
3. Shut the engine OFF.
4. Lock cab doors, keep the key in your pocket. Block the wheels before entering the body or performing any work on the vehicle.
5. Turn the battery disconnect switch OFF, if equipped.
6. Completely drain the air from the primary/A system and secondary/B system by opening the drain valves on the air tanks themselves or by using the drain manifold if supplied. When draining the air tanks, do not look into the area where air is draining. Dirt or sludge particles may be expelled in the air stream and can cause eye injury.
7. Place magnetic "DANGER" signs on both cab doors before entering the body or performing any work on the vehicle.
8. Take proper precautions before working under the vehicle. Use ramps approved for the weight of your vehicle, or use floor jacks and stands. Never work under a vehicle supported by jacks alone. Always use jack stands to support the vehicle.

SAFETY RECALL BULLETIN

NHTSA RECALL 13V-183

AUTOCAR, LLC SAFETY RECALL A-1303

July, 2013

Windshield Wiper Replacement

1. Locate the windshield wipers at the front of the vehicle (see *figure 1*).

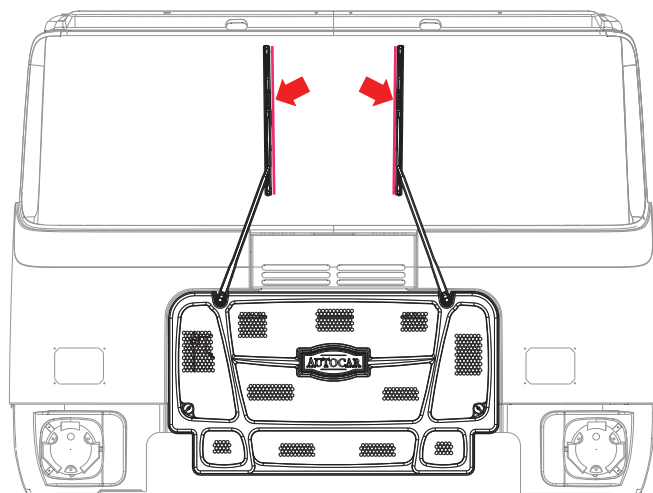


Figure 1

2. Mark the wiper position on the windshield with a grease pencil.
3. Remove the wiper arms from the wiper pivot shaft and place aside for reinstallation (see *figure 2*).

4. Remove the grille and place the fasteners and grille aside for reinstallation (see *figure 2*).

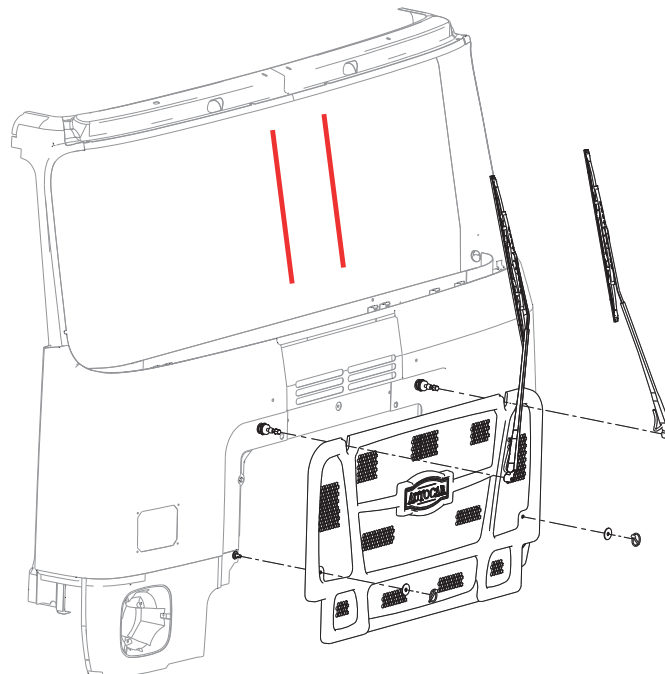


Figure 2

SAFETY RECALL BULLETIN

NHTSA RECALL 130V-183

AUTOCAR, LLC SAFETY RECALL A-1303

July, 2013

5. Disconnect the wiper linkage cross shaft by prying the ball sockets loose, and place the cross shaft aside for reinstallation (see figure 3).

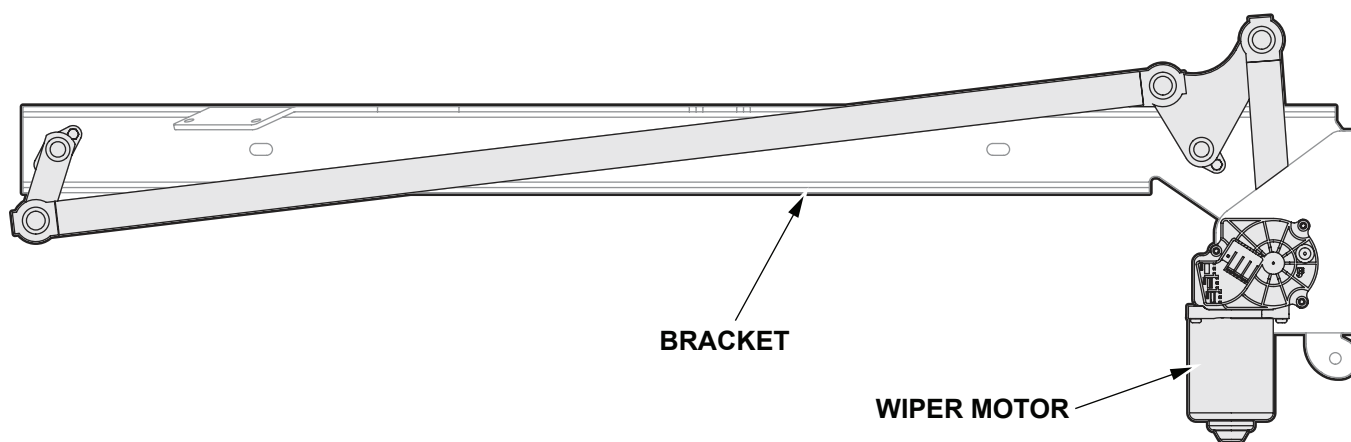


Figure 3
View From Backside Looking Forward

6. Disconnect the wiper motor to wiper pivot cross shaft by prying the ball sockets loose, and place aside for reinstallation.
7. Remove the two screws from the wiper pivot mechanism and the related hardware. Discard the screws and pivot mechanisms and related hardware.
8. Install the new (S6281003-001 and S6281003-002) wiper pivot mechanisms (see figure 4).
9. Reinstall the wiper motor to wiper pivot cross shaft which was placed aside in step 6 by pressing the ball sockets firmly into place (see figure 4).
10. Install the aluminum spacer, the spring washer and the hex nut. Tighten the hex nut to 50-60 in-lb (5.7-6.8 N·m) of torque (see figure 4).
11. Install the rain cap and then the knurled driver (see figure 4).
12. Reinstall the wiper linkage cross shaft which was set aside in step 5 by pressing the ball sockets firmly into place.
13. Reinstall the wiper arms which were placed aside in step 3. Be sure to align the arms with the grease pencil marks placed on the windshield in step 2.

SAFETY RECALL BULLETIN

NHTSA RECALL 13V-183

AUTOCAR, LLC SAFETY RECALL A-1303

July, 2013

14. Install the wiper arm, lock washer and acorn nut which were placed aside in step 3. Tighten the acorn nut to 88.5 -123.9 in-lb (10-14 N·m) of torque.
15. Reinstall the grill that was placed aside in step 4.
16. Operate the windshield wipers to confirm proper operation and adjustment.
15. If adjustment is required, please contact Autocar technical support at 888-218-3611. If no adjustment is required the repair is complete.

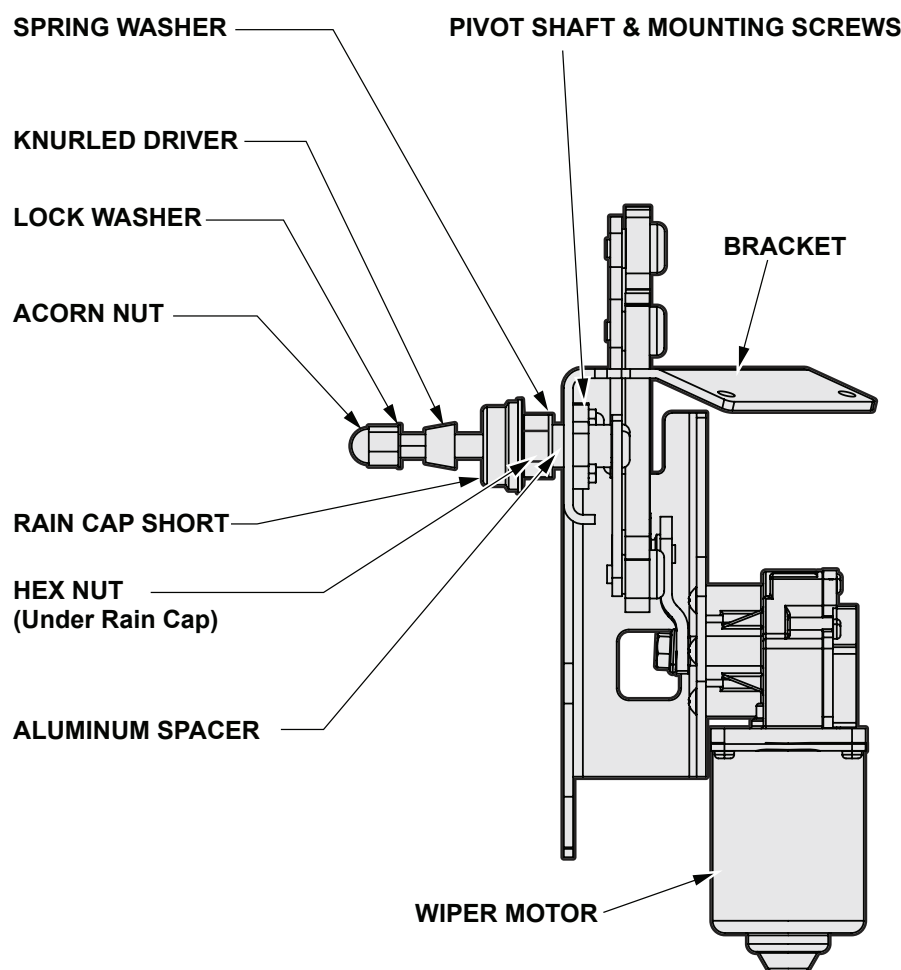


Figure 4
View From LH Side



SAFETY RECALL BULLETIN

NHTSA RECALL 130V-183

AUTOCAR, LLC SAFETY RECALL A-1303

July, 2013

5VCACDLE0CH214358	5VCACS8F6CH214449	5VCACSLE1CH214499	5VCACSLE3CH214570
5VCACDLE2CH214359	5VCACS8F2CH214450	5VCACSLE4CH214500	5VCACSLE5CH214571
5VCACDLE9CH214360	5VCACLLE7CH214464	5VCACSLE6CH214501	5VCACLLEXCH214572
5VCACDLE0CH214361	5VCACLLE9CH214465	5VCACSLE8CH214502	5VCACLLE1CH214573
5VCACDLE2CH214362	5VCACLLE0CH214466	5VCACSLEXCH214503	5VCACLLE3CH214574
5VCACLLE1CH214363	5VCACLLE2CH214467	5VCACSLE1CH214504	5VCACLLE5CH214575
5VCACLLE3CH214364	5VCACLLE4CH214468	5VCACSLE3CH214505	5VCACLLE7CH214576
5VCACLLE5CH214365	5VCACLLE6CH214469	5VCACSLE5CH214506	5VCACLLE9CH214577
5VCACLLE7CH214366	5VCACLLE2CH214470	5VCACSLE7CH214507	5VCACLLE0CH214578
5VCACLLE9CH214367	5VCACLLE4CH214471	5VCACSLE9CH214508	5VCACLLE2CH214579
5VCACLLE0CH214368	5VCACLLE6CH214472	5VCACSLE0CH214509	5VCACLLE9CH214580
5VCACLLE2CH214369	5VCACLLE8CH214473	5VCACSLE7CH214510	5VCACLLE0CH214581
5VCACLLE9CH214370	5VCACLLEXCH214474	5VCACSLE9CH214511	5VCACLLE2CH214582
5VCACLLE0CH214371	5VCACSLE9CH214475	5VCACSLE0CH214512	5VCACR8G8CH214583
5VCACLLE2CH214372	5VCACSLE0CH214476	5VCACSLE2CH214513	5VCACRLE2CH214584
5VCACLLE4CH214373	5VCACSLE2CH214477	5VCACSLE4CH214514	5VCACD8G8CH214585
5VCACLLE6CH214374	5VCACSLE4CH214478	5VCACSLE6CH214515	5VCACL8F8CH214586
5VCACLLE8CH214375	5VCACSLE6CH214479	5VCACSLE8CH214516	5VCACL8FXCH214587
5VCACS8F5CH214376	5VCACSLE2CH214480	5VCACSLE8CH214533	5VCACR8F8CH214588
5VCACS8F7CH214377	5VCACSLE4CH214481	5VCACSLEXCH214534	5VCACR8FXCH214589
5VCACR8G6CH214405	5VCACSLE6CH214482	5VCACSLE1CH214535	5VCACR6F2CH214590
5VCACR8G8CH214406	5VCACSLE8CH214483	5VCACSLE3CH214536	5VCACD8F4CH214591
5VCA3RLE2CH214407	5VCACSLEXCH214484	5VCACSLE5CH214537	5VCACSLE2CH214592
5VCA3RLE4CH214408	5VCACSLE1CH214485	5VCACSLE7CH214538	5VCACSLE4CH214593
5VCACDLE1CH214420	5VCACSLE3CH214486	5VCACSLE9CH214542	5VCACSLE6CH214594
5VCACDLE3CH214421	5VCACSLE5CH214487	5VCACSLE0CH214543	5VCACLLE0CH214595
5VCACDLE5CH214422	5VCACSLE7CH214488	5VCACSLEXCH214551	5VCACLLE2CH214596
5VCACDLE7CH214423	5VCACSLE9CH214489	5VCACSLE1CH214552	5VCACLLE4CH214597
5VCACDLE9CH214424	5VCACSLE5CH214490	5VCACSLE3CH214553	5VCACLLE6CH214598
5VCA3RLE0CH214440	5VCACSLE7CH214491	5VCACDLEXCH214562	5VCACLLE8CH214599
5VCA3RLE2CH214441	5VCACSLE9CH214492	5VCACDLE1CH214563	5VCACLLE0CH214600
5VCA3RLE4CH214442	5VCACSLE0CH214493	5VCACDLE3CH214564	5VCACLLE2CH214601
5VCA3RLE6CH214443	5VCACSLE2CH214494	5VCACDLE5CH214565	5VCACLLE4CH214602
5VCA3RLE8CH214444	5VCACSLE4CH214495	5VCACDLE7CH214566	5VCACLLE6CH214603
5VCACL8F3CH214446	5VCACSLE6CH214496	5VCACR8F0CH214567	5VCACLLE8CH214604
5VCACS8F2CH214447	5VCACSLE8CH214497	5VCACSLE5CH214568	5VCACLLEXCH214605
5VCACS8F4CH214448	5VCACSLEXCH214498	5VCACSLE7CH214569	5VCACLLE1CH214606



SAFETY RECALL BULLETIN

NHTSA RECALL 13V-183

AUTOCAR, LLC SAFETY RECALL A-1303

July, 2013

5VCACLE3CH214607	5VCACSLE9CH214671	5VCACA8F3DH214713	5VCACLE8DH214751
5VCACLE5CH214608	5VCACSLE0CH214672	5VCACA8F5DH214714	5VCACLEXDH214752
5VCACLE7CH214609	5VCACSLE2CH214673	5VCACA8F7DH214715	5VCACLE1DH214753
5VCACLE3CH214610	5VCACSLE4CH214674	5VCACA8F9DH214716	5VCACLE3DH214754
5VCACLE5CH214611	5VCACSLE6CH214675	5VCACA8F0DH214717	5VCACLE5DH214755
5VCACLE7CH214612	5VCACSLE8CH214676	5VCACA8F2DH214718	5VCACLE7DH214756
5VCACDLE4CH214640	5VCACSLEXCH214677	5VCACA8F4DH214719	5VCACLE9DH214757
5VCACDLE6CH214641	5VCACSLE1CH214678	5VCACRLE6CH214720	5VCACLE0DH214758
5VCACDLE8CH214642	5VCACSLE3CH214679	5VCACSLE9DH214722	5VCACLE2DH214759
5VCACDLEXCH214643	5VCACSLEXCH214680	5VCACSLE0DH214723	5VCACLE9DH214760
5VCACDLE1CH214644	5VCACSLE1CH214681	5VCACSLE2DH214724	5VCACLE0DH214761
5VCACDLE3CH214645	5VCACSLE3CH214682	5VCACLE7DH214725	5VCACRLE9DH214762
5VCACDLE5CH214646	5VCACSLE5CH214683	5VCACLE9DH214726	5VCACRLE0DH214763
5VCACDLE7CH214647	5VCACLE5CH214687	5VCACLE0DH214727	5VCACSLE3DH214764
5VCACDLE9CH214648	5VCACLE7CH214688	5VCACLE2DH214728	5VCACSLE5DH214765
5VCACDLE0CH214649	5VCACRLE5CH214689	5VCACLE4DH214729	5VCACSLE7DH214766
5VCACDLE7CH214650	5VCACRLE1CH214690	5VCACLE0DH214730	5VCACL8F1DH214771
5VCACDLE9CH214651	5VCACRLE3CH214691	5VCACLE2DH214731	5VCACL8F3DH214772
5VCACDLE0CH214652	5VCACRLE5CH214692	5VCACLE4DH214732	5VCACL8F5DH214773
5VCACDLE2CH214653	5VCACRLE7CH214693	5VCACR8G1CH214733	5VCACL8F7DH214774
5VCACDLE4CH214654	5VCACRLE9CH214694	5VCACR8F4CH214734	5VCACL8F9DH214775
5VCACDLE6CH214655	5VCACR6F5CH214695	5VCACR8F6CH214735	5VCACL8F0DH214776
5VCACDLE8CH214656	5VCACL8F4CH214696	5VCACR8F8CH214736	5VCACL8F2DH214777
5VCACDLEXCH214657	5VCACS6F3CH214699	5VCACR8FXCH214737	5VCACL8F4DH214778
5VCACDLE1CH214658	5VCACRTFXCH214700	5VCACR8F1CH214738	5VCACL8F6DH214779
5VCACDLE3CH214659	5VCACR8F0CH214701	5VCACR8F3CH214739	5VCACL8F2DH214780
5VCACDLEXCH214660	5VCACL8F6CH214702	5VCACR8FXCH214740	5VCACL8F4DH214781
5VCACDLE1CH214661	5VCACL8F8CH214703	5VCACR8F1CH214741	5VCACL8F6DH214782
5VCACDLE3CH214662	5VCACL8FXCH214704	5VCACR8F3CH214742	5VCACL8F8DH214783
5VCACDLE5CH214663	5VCACL8F1CH214705	5VCACR8F5CH214743	5VCACL8FXDH214784
5VCACDLE7CH214664	5VCACL8F3CH214706	5VCACR8F7CH214744	5VCACL8F1DH214785
5VCACDLE9CH214665	5VCACL8F5CH214707	5VCACR8F9CH214745	5VCACL8F3DH214786
5VCACDLE0CH214666	5VCACRLE5CH214708	5VCACR8F0CH214746	5VCACL8F5DH214787
5VCACSLE7CH214667	5V4A4D8F0CH214709	5VCACR8F2CH214747	5VCACL8F7DH214788
5VCACSLE9CH214668	5V4A4D8F7CH214710	5VCACR8F4CH214748	5VCACSLE0DH214799
5VCACSLE0CH214669	5V4A4D8F9CH214711	5VCACLEXDH214749	5VCACSLE3DH214800
5VCACSLE7CH214670	5VCACR8G4CH214712	5VCACLE6DH214750	5VCACSLE5DH214801



SAFETY RECALL BULLETIN

NHTSA RECALL 130V-183

AUTOCAR, LLC SAFETY RECALL A-1303

July, 2013

5VCACSLE7DH214802	5VCACSLE5DH214846	5VCACLLE4DH214889	5VCACRLE2DH214926
5VCACSLE9DH214803	5VCACSLE7DH214847	5VCACLLE0DH214890	5VCACRLE4DH214927
5VCACSLE0DH214804	5VCACSLE9DH214848	5VCACSLEXDH214891	5VCACRLE6DH214928
5VCACSLE2DH214805	5VCACSLE0DH214849	5VCACSLE1DH214892	5VCACRLE8DH214929
5VCACSLE4DH214806	5VCACSLE7DH214850	5VCACSLE3DH214893	5VCACRLE4DH214930
5VCACSLE6DH214807	5VCACSLE9DH214851	5VCACDLE0DH214894	5VCACRLE6DH214931
5VCACSLE8DH214808	5VCACSLE0DH214852	5VCACDLE2DH214895	5VCACRLE8DH214932
5VCACSLEXDH214809	5VCACSLE2DH214853	5VCACDLE4DH214896	5VCACLLE3DH214933
5VCACRLE5DH214810	5VCACSLE4DH214854	5VCACDLE6DH214897	5VCACLLE5DH214934
5VCACRLE7DH214811	5VCACSLE6DH214855	5VCACDLE8DH214898	5VCACLLE7DH214935
5VCACRLE9DH214812	5VCACSLE8DH214856	5VCACDLEXDH214899	5VCACLLE9DH214936
5VCACRLE0DH214813	5VCACSLEXDH214857	5VCACLLEXDH214900	5VCACLLE0DH214937
5VCACRLE2DH214814	5VCACSLE1DH214858	5VCACLLE1DH214901	5VCACD8F3DH214938
5VCACRLE4DH214815	5VCACD8F7DH214859	5VCACLLE3DH214902	5VCACSLE1DH214939
5VCACLLE7DH214823	5VCACD8F3DH214860	5VCACL8F3DH214903	5VCACL3E0DH214940
5VCACLLE9DH214824	5VCACD8F5DH214861	5VCACD8G7DH214904	5VCACS6F4DH214941
5VCACLLE0DH214825	5VCACD8F7DH214862	5VCACD8G9DH214905	5VCACS6F6DH214942
5VCACSLEXDH214826	5VCACD8F9DH214863	5VCACD8F3CH214906	5VCACS6F8DH214943
5VCACSLE1DH214827	5VCACD8F0DH214864	5VCACD8F5CH214907	5VCACL8F6DH214944
5VCACSLE3DH214828	5VCACD8F2DH214865	5VCACLLE4DH214908	5VCACL8F8DH214945
5VCACSLE5DH214829	5VCACD8F4DH214866	5VCACLLE6DH214909	5VCACSLE9DH214946
5VCACSLE1DH214830	5VCACSLE8DH214873	5VCACLLE2DH214910	5VCACSLE0DH214947
5VCACSLE3DH214831	5VCACSLEXDH214874	5VCACLLE4DH214911	5VCACL6FXDH214948
5VCACSLE5DH214832	5VCACLLE4DH214875	5VCACLLE6DH214912	5VCACSLE4DH214949
5VCACSLE7DH214833	5VCACRLE2DH214876	5VCACSLE5DH214913	5VCACSLE0DH214950
5VCACSLE9DH214834	5VCACD8F9DH214877	5VCACD8F0DH214914	5VCACRLE1DH214951
5VCACLLE3DH214835	5VCACRLE6DH214878	5VCACD8F2DH214915	5VCACL8F5DH214952
5VCACLLE5DH214836	5VCACRLE8DH214879	5VCA3SLE0DH214916	5VCACL8F7DH214953
5VCACLLE7DH214837	5VCACRLE4DH214880	5VCA3SLE2DH214917	5VCACRLE9CH214954
5VCACLLE9DH214838	5VCACRLE6DH214881	5VCACRLE3DH214918	5VCACRLE0CH214955
5VCACLLE0DH214839	5VCACLLE1DH214882	5VCACRLE5DH214919	5VCACRLE2CH214956
5VCACLLE7DH214840	5VCACLLE3DH214883	5VCACRLE1DH214920	5VCACRLE4CH214957
5VCACLLE9DH214841	5VCACLLE5DH214884	5VCACRLE3DH214921	5VCACRLE6CH214958
5VCACLLE0DH214842	5VCACLLE7DH214885	5VCACRLE5DH214922	5VCACRLE8CH214959
5VCACLLE2DH214843	5VCACLLE9DH214886	5VCACRLE7DH214923	5VCACL8F3DH214965
5VCACLLE4DH214844	5VCACLLE0DH214887	5VCACRLE9DH214924	5VCACSLE4DH214966
5VCACD8F7DH214845	5VCACLLE2DH214888	5VCACRLE0DH214925	5VCACSLE6DH214967



SAFETY RECALL BULLETIN

NHTSA RECALL 13V-183

AUTOCAR, LLC SAFETY RECALL A-1303

July, 2013

5VCACSLE8DH214968	5VCACS8F8DH215040	5VCACLLE3DH215080	5VCACR8F5DH215134
5VCACSLEXDH214969	5VCACRLE0DH215041	5VCACLLE5DH215081	5VCACL6F7DH215135
5VCACSLE6DH214970	5VCACR8F0DH215042	5VCACLLE7DH215082	5VCA3R6F5DH215136
5VCACSLE8DH214971	5VCACR8G1DH215043	5VCACSLE6DH215083	5VCACL6F0DH215137
5VCACL6F3DH215004	5VCACD6F7DH215044	5VCACSLE8DH215084	5VCACLLE8DH215138
5VCACL6F5DH215005	5VCACL8F3DH215047	5VCACSLEXDH215085	5VCACLLEXDH215139
5VCACD6FXDH215006	5VCACL8F5DH215048	5VCACSLE1DH215086	5VCACLLE6DH215140
5VCACD6F1DH215007	5VCACDLE1DH215049	5VCACSLE3DH215087	5VCACS6FXDH215141
5VCACD6F3DH215008	5VCACDLE8DH215050	5VCA3SLE5DH215088	5VCACS6F1DH215142
5VCACL6F2DH215009	5VCACDLEXDH215051	5VCA3SLE7DH215089	5VCACLLE1DH215143
5VCACL6F9DH215010	5VCACDLE1DH215052	5VCA3SLE3DH215090	5VCACLLE3DH215144
5VCACD6F3DH215011	5VCACDLE3DH215053	5VCA3SLE5DH215091	5VCACLLE5DH215145
5VCACD6F5DH215012	5VCACDLE5DH215054	5VCA3SLE7DH215092	5VCACLLE7DH215146
5VCACD6F7DH215013	5VCACDLE7DH215055	5VCA3SLE9DH215093	5VCACLLE9DH215147
5VCACD6F9DH215014	5VCACDLE9DH215056	5VCA3SLE0DH215094	5VCACSLE8DH215148
5VCACD6F0DH215015	5VCACDLE0DH215057	5VCA3SLE2DH215095	5VCACSLEXDH215149
5VCACD6F2DH215016	5VCACLLEXDH215058	5VCACLLE9DH215097	5VCACSLE6DH215150
5VCACD6F4DH215017	5VCACLLE1DH215059	5VCACLLE0DH215098	5VCACSLE8DH215151
5VCACD6F6DH215018	5VCACLLE8DH215060	5VCACLLE2DH215099	5VCACSLEXDH215152
5VCACRLE7DH215022	5VCACLLEXDH215061	5VCACLLE5DH215100	5VCACD8G1DH215157
5VCACRLE9DH215023	5VCACLLE1DH215062	5VCACLLE7DH215101	5VCACLLE3DH215158
5VCACRLE0DH215024	5VCACLLE3DH215063	5VCACLLE9DH215102	5VCACS8F0DH215159
5VCACRLE2DH215025	5VCACLLE5DH215064	5VCACLLE0DH215103	5VCACR8F6DH215160
5VCACRLE4DH215026	5VCACLLE7DH215065	5VCACLLE2DH215104	5VCACR8F8DH215161
5VCACRLE6DH215027	5VCACLLE9DH215066	5VCACLLE4DH215105	5VCACD8F6DH215162
5VCACRLE8DH215028	5VCA3RLE7DH215067	5VCACLLE6DH215106	5VCACD8F8DH215163
5VCACR8G7DH215029	5VCACLLE4DH215069	5VCACLLE8DH215107	5VCACRLE5DH215164
5VCACSLE7DH215030	5VCACLLE0DH215070	5VCACLLEXDH215108	5VCACRLE7DH215165
5VCACSLE9DH215031	5VCACLLE2DH215071	5VCACLLE1DH215109	5VCACRLE9DH215166
5VCACSLE0DH215032	5VCACLLE4DH215072	5VCACSLE5DH215110	5VCACRLE0DH215167
5VCACSLE2DH215033	5VCACLLE6DH215073	5VCACSLE7DH215111	5VCACRLE2DH215168
5VCACS6F9DH215034	5VCACLLE8DH215074	5VCACS6F3DH215112	5VCACS8F3DH215169
5VCACLLE9DH215035	5VCACLLEXDH215075	5VCACS6F5DH215113	5VCACS8FXDH215170
5VCACLLE0DH215036	5VCACLLE1DH215076	5VCACS6F7DH215114	5VCACLLE6DH215171
5VCACLLE2DH215037	5VCACLLE3DH215077	5VCACS6F9DH215115	5VCACSLE5DH215172
5VCACS8FXDH215038	5VCACLLE5DH215078	5VCACLLE7DH215132	5VCACSLE7DH215173
5VCACS8F1DH215039	5VCACLLE7DH215079	5VCACLLE9DH215133	5VCACSLE9DH215174



SAFETY RECALL BULLETIN

NHTSA RECALL 130V-183

AUTOCAR, LLC SAFETY RECALL A-1303

July, 2013

5VCACSLE0DH215175	5VCACL6FXDH215212	5VCACD8F3DH215250	5VCACL8F0DH215295
5VCACSLE2DH215176	5VCACL6F1DH215213	5VCACS8F0DH215257	5VCACL8F2DH215296
5VCACSLE4DH215177	5VCACRLE7DH215215	5VCACDLEXDH215258	5VCACL8F4DH215297
5VCACSLE6DH215178	5VCACRLE9DH215216	5VCACDLE1DH215259	5VCACL8F6DH215298
5VCACSLE8DH215179	5VCACRLE0DH215217	5VCACDLE8DH215260	5VCACL8F8DH215299
5VCACLLE7DH215180	5VCACLLE6DH215218	5VCA3LLE7DH215261	5VCACL8F0DH215300
5VCACLLE9DH215181	5VCACSLE5DH215219	5VCACLLE9DH215262	5VCACL8F2DH215301
5VCACR8F5DH215182	5VCACL8F2DH215220	5VCACLLE0DH215263	5VCACL8F4DH215302
5VCACR8F7DH215183	5VCACLLE6DH215221	5VCACL8F0DH215264	5VCACL8F6DH215303
5VCACR8F9DH215184	5VCACLLE8DH215222	5VCACLLE4DH215265	5VCACDLEXDH215304
5VCA3R8F0DH215185	5VCACDLEXDH215223	5VCACLLE6DH215266	5VCACLLE1DH215305
5VCACLLE8DH215186	5VCACLLE1DH215224	5VCACL6F6DH215269	5VCACLLE3DH215306
5VCACRLE6DH215187	5VCACLLE3DH215225	5VCACSLE5DH215270	5VCACRLE1DH215307
5VCACRLE8DH215188	5VCACLLE5DH215226	5VCACSLE7DH215271	5VCACRLE3DH215308
5VCACRLEXDH215189	5VCACDLEXDH215227	5VCACSLE9DH215272	5VCACD8FXDH215309
5VCACRLE6DH215190	5VCACDLE1DH215228	5VCACSLE0DH215273	5VCACD8F6DH215310
5VCACRLE8DH215191	5VCACDLE3DH215229	5VCACLLE5DH215274	5VCACRLE3DH215311
5VCACRLEXDH215192	5VCACDLEXDH215230	5VCACLLE7DH215275	5VCACRLE5DH215312
5VCACRLE1DH215193	5VCACDLE1DH215231	5VCACD6F6DH215276	5VCACRLE7DH215313
5VCACRLE3DH215194	5VCACDLE3DH215232	5VCACD6F8DH215277	5VCACRLE9DH215314
5VCACRLE5DH215195	5VCACD8F3DH215233	5VCACD6FXDH215278	5VCACRLE0DH215315
5VCACRLE7DH215196	5VCACD8F5DH215234	5VCACD6F1DH215279	5VCACRLE2DH215316
5VCACRLE9DH215197	5VCACLLE6DH215235	5VCACD6F8DH215280	5VCACL8F6DH215317
5VCACRLE0DH215198	5VCACLLE8DH215236	5VCACS8F8DH215281	5VCA3D7E3DH215337
5VCACRLE2DH215199	5VCACDLEXDH215237	5VCACS8FXDH215282	5VCACR8F4DH215349
5VCACRLE5DH215200	5VCACLLE1DH215238	5VCACL8F4DH215283	5VCACD8F7DH215350
5VCACRLE7DH215201	5VCACLLE3DH215239	5VCACR6F9DH215284	5VCACD8F9DH215351
5VCACRLE9DH215202	5VCACS6F1DH215240	5VCACR6F0DH215285	5VCACR8F4DH215352
5VCACR8G8DH215203	5VCACL8FXDH215241	5VCACR6F2DH215286	5VCACLLE1DH215353
5VCACL8F4DH215204	5VCACL8F1DH215242	5VCACL8F1DH215287	5VCACLLE3DH215354
5VCACL8F6DH215205	5VCACL8F3DH215243	5VCACL8F3DH215288	5VCACLLE5DH215355
5VCACD8F0DH215206	5VCACL8F5DH215244	5VCACL8F5DH215289	5VCACLLE7DH215356
5VCACD8F2DH215207	5VCACL8F7DH215245	5VCACL8F1DH215290	5VCACLLE9DH215357
5VCACD8F4DH215208	5VCACD8F1DH215246	5VCACL8F3DH215291	5VCACLLE0DH215358
5VCACD8F6DH215209	5VCACD8F3DH215247	5VCACL8F5DH215292	5VCACRLE9DH215359
5VCACR8F6DH215210	5VCACD8F5DH215248	5VCACL8F7DH215293	5VCACRLE5DH215360
5VCACD8F4DH215211	5VCACD8F7DH215249	5VCACL8F9DH215294	5VCACRLE7DH215361



SAFETY RECALL BULLETIN

NHTSA RECALL 13V-183

AUTOCAR, LLC SAFETY RECALL A-1303

July, 2013

5VCACRLE9DH215362

5VCACRLE0DH215363

5VCACRLE2DH215364

5VCACRLE4DH215365

5VCACRLE6DH215366

5VCACRLE8DH215367

5VCACRLEXDH215368

5VCACRLE1DH215369

5VCACR8G5DH215370

5VCACSLE2DH215372

5VCACSLE4DH215373

5VCACSLE8DH215375

5VCACLLE2DH215376

5VCACD6F3DH215378

5VCACLLE5DH215405

5VCACRLE3DH215406

5VCACR8F7DH215409

5VCACR8F3DH215410

5VCACR8F5DH215411

5VCACR8F7DH215412

5VCACR8F9DH215413

5VCACR8F0DH215414

5VCACR8F2DH215415

5VCACR8F4DH215416

5VCACR8F6DH215417

5VCACR8F8DH215418

5VCACR8FXDH215419

5VCACR8F6DH215420

5VCACR8F8DH215421

5VCACSLE5DH215463

5VCACSLE7DH215464

5VCACL8FXDH215465

5VCACD8F8DH215468

5VCACS6F0DH215469

5VCACDLE8DH215470

5VCACDLEXDH215471

5VCACS6F0DH215472

5VCACS6F2DH215473

5VCACSLE4DH215499

5VCACSLE7DH215500

5VCACSLE9DH215501

5VCACSLE0DH215502

5VCACSLE2DH215503

5VCACSLE4DH215504

5VCACSLE6DH215505

5VCACSLE8DH215506

5VCACSLEXDH215507

5VCACSLE1DH215508

5VCACSLE3DH215509

5VCACSLEXDH215510

5VCACSLE1DH215511

5VCACLLE2DH215524

5VCACLLE4DH215525

5VCACLLE6DH215526

5VCACLLE8DH215527

5VCACLLEXDH215528

5VCACR8F8DH215533