



**RECEIVED**

*By Recall Management Division at 3:40 pm, May 14, 2014*

May 14, 2014

Ms. Nancy Lewis  
Associate Administrator for Enforcement  
National Highway Traffic Safety Administration  
Recall Management Division (NVS-215)  
1200 New Jersey Avenue, SE – Room W45-306  
Washington, DC 20590

Dear Ms. Lewis:

The following information is submitted pursuant to the requirements of 49 CFR 573.6 as it applies to a determination by General Motors to conduct a safety related recall involving model year (MY) 2004-2012 Chevrolet Malibu, MY 2004-2007 Malibu Maxx, MY 2005-2010 Pontiac G6 and MY 2007-2010 Saturn Aura vehicles

573.6(c)(1): Chevrolet, Pontiac and Saturn Brands of General Motors Company.

573.6(c)(2)(3)(4): This information is shown on the attached sheet.

573.6(c)(5): General Motors has decided that a defect which relates to motor vehicle safety exists in 2004-2012 Malibu, 2004-07 Malibu Maxx, 2005-10 Pontiac G6, 2007-10 Saturn Aura vehicles. On these vehicles, over time an increased resistance can develop in the Body Control Module (BCM) connection system and result in voltage fluctuations or intermittency in the Brake Apply Sensor (BAS) circuit that can cause service brake lamp malfunction. As a result, the service brake lamps may illuminate when the service brakes are not being applied, or may not illuminate when the service brakes are being applied. Additionally, cruise control may not engage. If cruise control is engaged, additional service brake pedal travel may be required to disengage it. Service brake pedal application may not be required to move the shift lever out of PARK, or additional service brake pedal travel may be required to move the shift lever out of PARK. Traction control, electronic stability control, and panic braking assist features, if equipped, may be disabled. Service ESC and/or Traction Control tell-tales may illuminate with this condition. These conditions may increase the risk of a crash.

573.6(c)(6): The issue was presented to the Field Performance Evaluation Review Committee on May 5, 2014, and on May 7, 2014, the Executive Field Action Decision Committee decided to conduct a safety recall. General Motors will be submitting a supplemental chronology within two weeks.

573.6(c)(8): Dealers are to attach the wiring harness to the BCM with a spacer, apply dielectric lubricant to both the BCM and harness connector and on the BAS and harness connector, and relearn the brake pedal home position.



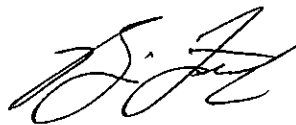
General Motors will provide the dealer bulletin and owner letter mail dates when available.

Pursuant to 577.11, General Motors will provide reimbursement to owners for repairs completed on or before ten days after the owner mailing is completed, according to the plan submitted on May 23, 2013.

573.6(c)(10): General Motors will provide the dealer bulletin and owner letter under separate cover.

573.6(c)(11): General Motors' assigned recall number is 13036.

Sincerely,

A handwritten signature in black ink, appearing to read "B. Latouf", written in a cursive style.

Brian Latouf, Director  
Field Product Investigations & Evaluations

Attachment

VEHICLES POTENTIALLY AFFECTED BY MAKE, MODEL, AND MODEL YEAR  
PLUS INCLUSIVE DATES OF MANUFACTURE

<u>MAKE</u>	<u>MODEL SERIES</u>	<u>MODEL YEAR</u>	<u>NUMBER INVOLVED</u>	<u>INCLUSIVE MANUFACTURING DATES</u>		<u>DESCRIPTIVE INFO. TO PROPERLY IDENT. VEH.</u>	<u>EST. NO. W/CONDITION</u>
				<u>(FROM)</u>	<u>(TO)</u>		
Chevrolet	Z	2004	96,607	05/16/2003	06/11/2004	Malibu	*
Chevrolet	Z	2004	35,761	06/25/2003	06/11/2004	Malibu Maxx	"
Chevrolet	Z	2005	163,824	03/30/2004	07/29/2005	Malibu	"
Chevrolet	Z	2005	48,581	03/30/2003	07/29/2005	Malibu Maxx	"
Chevrolet	Z	2006	141,688	05/26/2005	06/09/2006	Malibu	"
Chevrolet	Z	2006	35,585	01/26/2005	06/09/2006	Malibu Maxx	"
Chevrolet	Z	2007	113,983	04/03/2006	06/27/2007	Malibu	"
Chevrolet	Z	2007	13,774	04/04/2006	04/05/2007	Malibu Maxx	"
Chevrolet	Z	2008	155,564	05/15/2007	06/27/2008	Malibu	"
Chevrolet	Z	2009	176,837	04/22/2008	06/23/2009	Malibu	"
Chevrolet	Z	2010	183,814	04/07/2009	06/15/2010	Malibu	"
Chevrolet	Z	2011	211,185	04/08/2010	06/09/2011	Malibu	"
Chevrolet	Z	2012	225,863	04/19/2011	10/11/2012	Malibu	"
Pontiac	Z	2005	62,481	05/26/2004	04/01/2005	G6	"
Pontiac	Z	2006	170,412	01/11/2005	06/06/2006	G6	"
Pontiac	Z	2007	164,340	03/27/2006	06/22/2007	G6	"
Pontiac	Z	2008	154,349	04/11/2007	06/13/2008	G6	"
Pontiac	Z	2009	99,228	04/16/2008	06/12/2009	G6	"
Pontiac	Z	2010	25,586	04/23/2009	01/04/2010	G6	"
Saturn	Z	2007	64,852	04/24/2006	06/27/2007	Aura	"
Saturn	Z	2008	60,717	04/24/2007	06/27/2008	Aura	"
Saturn	Z	2009	35,473	04/22/2008	05/18/2009	Aura	"
Saturn	Z	2010	20	04/07/2009	05/26/2009	Aura	"
GM Total:			2,440,524				

\* All involved vehicles will be corrected as necessary.

573.6(c)(2)(iv): Delphi  
5725 Delphi Drive  
Troy, MI 48098-2815  
Gary R. Greib  
Manager, Product Investigations / Patent Agent  
Delphi Legal Staff  
Office Phone: 248-813-3362  
Cell Phone: 248-953-8579  
gary.r.greib@delphi.com

The BCM, BCM connector and BAS connector are manufactured in Mexico.

Dalian Alps Electric Co. Ltd.  
No. 6 Han Zheng Rd.  
Jinzhou District  
Dalian, 116100  
Phone #: 86 411 767 5102

The BAS is manufactured in China.