

**Part 573 Safety Recall Report****14V-294****Manufacturer Name :** Chrysler (FCA US LLC)**Submission Date :** FEB 24, 2016**NHTSA Recall No. :** 14V-294**Manufacturer Recall No. :** P32**Manufacturer Information :**

Manufacturer Name : Chrysler (FCA US LLC)  
 Address : 800 Chrysler Drive  
 CIMS 482-00-91 Auburn Hills MI 48326-2757  
 Company phone : 1-800-853-1403

**Population :**

Number of potentially involved : 17,727  
 Estimated percentage with defect : 100

**Vehicle Information :**

Vehicle : 2014-2014 RAM PROMASTER  
 Vehicle Type : LIGHT VEHICLES  
 Body Style :  
 Power Train : NR  
 Descriptive Information : Some 2014 Ram ProMaster vehicles  
 Production Dates : APR 23, 2013 - APR 22, 2014

**VIN (Vehicle Identification Number) Range**

Begin : NR

End : NR

 Not sequential VINs**Description of Defect :**

Description of the Defect : Chrysler Group LLC (Chrysler) is recalling certain model year 2014 Ram ProMaster vehicles manufactured April 23, 2013 to May 22, 2014. The affected vehicles may experience circuit corrosion from water intrusion around the in-floor battery cover and door footwell trim.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : This water intrusion may affect the vehicle's running and disable the air bags, stop lamps, turn signals, backup lights and/or door locks, increasing the risk of a crash, as well as injury to the occupants if the air bags do not deploy.

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

**Supplier Identification :**

**Component Manufacturer**

Name : NR

Address : NR

NR

Country : NR

**Chronology :**

NR

**Description of Remedy :**

Description of Remedy Program : Chrysler will notify owners, and dealers will inspect all the connectors in the footwell areas, the ignition fuse and the occupant restraint control (ORC) module for corrosion, if corrosion is found, dealers will repair the connectors in the footwell area and the ignition fuse, and replace the ORC module. They will also install a water barrier sealer on the floor, add di-electric grease to all footwell connectors and replace the body plug. The in-floor battery ignition fuse will be relocated, and add di-electric grease to the ORC module connector. These repairs will be performed, free of charge. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is P32.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

**Recall Schedule :**

Description of Recall Schedule : NR

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : NR - NR

\* NR - Not Reported