The information contained in this report was submitted pursuant to 49 CFR §573

# Part 573 Safety Recall Report

Manufacturer Name : Nissan North America, Inc. Submission Date : OCT 02,2014 NHTSA Recall No. : 14V-565 Manufacturer Recall No. : NR

#### Manufacturer Information :

Manufacturer Name : Nissan North America, Inc. Address : P. O. BOX 685001 Franklin TN 37068-5009 Company phone : (999) 999-9999

### Vehicle Information :

Vehicle : 2013-2013 Nissan Altima Vehicle Type : LIGHT VEHICLES Body Style : 4-DOOR Power Train : GAS

Certain 2013 Model Year Nissan Altima vehicles manufactured in the Smyrna, TN and Canton, MS plants from March 6, 2012 to February 28, 2013.

**Population**:

The subject vehicle range was determined based on the production range of Descriptive Information : vehicles that might have been manufactured with the subject hood latch assembly.

\*Note: We have identified an additional 236 vehicles outside of the manufacturing range that received the subject hood latch assembly as a service part. These vehicles will be included in this recall.

Production Dates : MAR 06, 2012 - JAN 28, 2013

### VIN (Vehicle Identification Number) Range

Begin : NR

End : NR

□ Not sequential VINs



#### OMB Control No.: 2127-0004



Number of potentially involved : 220,423

Estimated percentage with defect : 0

14V-565

## Part 573 Safety Recall Report

14V-565

Page 2

#### **Description of Defect :**

Description of the Defect : In rare instances, interference between the hood inner panel and the secondary latch lever, in combination with debris and corrosion, may create mechanical binding that could cause the secondary hood latch to remain in the open position when the hood is closed. If the primary hood latch is released and the vehicle is driven with only the secondary latch engaged (for example, because of inadvertent actuation of the hood release lever), the secondary hood latch may not hold the hood closed as designed while the vehicle is in motion. Description of the Safety Risk : If the primary hood latch is released and the vehicle is driven with only the secondary latch engaged, the secondary hood latch may not hold the hood closed as designed while the vehicle is in motion. If this condition occurs, the hood may open while driving and obscure the driver's vision, increasing the

risk of a crash Description of the Cause : NR Identification of Any Warning that can Occur : NR

### Supplier Identification :

#### **Component Manufacturer**

Name : Intier Automotive, Inc. Address : 141 Staffern Drive Concord, Ontario L4K 2R2 Country : NR

#### Chronology :

Nissan will provide a chronology when it is available.

#### **Description of Remedy :**

Description of Remedy Program : Nissan dealers will be instructed to modify the bend angle of the hood actuation lever to eliminate potential interference with the hood inner panel. In addition, dealers will condition the latch joint with application of cleaner and lubricant as needed. If significant corrosion is identified, the latch assembly will be replaced. This repair will be offered at no charge to the customer.

How Remedy Component Differs from Recalled Component : NR Identify How/When Recall Condition was Corrected in Production : NR

The information contained in this report was submitted pursuant to 49 CFR §573

# Part 573 Safety Recall Report

## 14V-565

### **Recall Schedule :**

Description of Recall Schedule : Owners of the potentially affected vehicles will be notified within 60 days of September 10, 2014.

Planned Dealer Notification Date : OCT 08, 2014 - OCT 08, 2014

Planned Owner Notification Date : NR - NR

\* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR \$573