

**Part 573 Safety Recall Report****14V-706****Manufacturer Name :** Cummings Mobility Conversion & Supply**Submission Date :** OCT 27,2014**NHTSA Recall No. :** 14V-706**Manufacturer Recall No. :** 14E-041**Manufacturer Information :**

Manufacturer Name : Cummings Mobility Conversion &amp; Supp

Address : 6540 Jansen Avenue, NE

Albertville MN 55301

Company phone : 800-639-5438

**Population :**

Number of potentially involved : 34

Estimated percentage with defect : 100

**Vehicle Information :**

Vehicle : 2006-2014 FORD, DODGE, CHEVROLET E150, E250, E350, TRANSIT CONNECT,SPRINTER, EXPRESS

Vehicle Type : BUSES, MEDIUM &amp; HEAVY VEHICLES

Body Style : VAN

Power Train : GAS

Descriptive Information : Ricon DOT Public Use "S" 2000 and 5500 Series lifts with platforms 32"x51" and 34"x54". The affected population is comprised of six (6) primary numbers S2005-XXXXXXX, S2010-XXXXXXX, S5005-XXXXXXX, S5010-XXXXXXX, S5505-XXXXXXX AND S5510-XXXXXX. These lift were install by our company after 11/01/2006 into various vehicles.

Production Dates : JAN 01, 2006 - OCT 08, 2014

**VIN (Vehicle Identification Number) Range**

Begin : NR

End : NR

 Not sequential VINs**Description of Defect :**

Description of the Defect : Under certain conditions present in some applications, the platform included on the subject S-Series model wheelchair lift can exhibit cracking of the platform pivot plate while in the stowed position.

Description of the Safety Risk : If left unchecked, can propagate to the point where separation of the rear portion of the pivot plate occurs rendering the lift [potentially inoperable and possibly unsafe for the operator.

In the even the aforementioned crack occurs on both sides of the platform and is allowed to propagate to the point of material separation on both sides it is possible for the lift platform to lean against the vehicle lift door(s) and fall out of the vehicle lift door(s) and fall out of the vehicle when the door(s) is(are) opened putting the lift operator at risk.

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

**Supplier Identification :****Component Manufacturer**

Name : Ricon Corporation

Address : A Wabtec Subsidiary

1135 Aviation Place San Fernando CALIFORNIA 91340

Country : United States

**Chronology :**

Please see Ricon Corporation Safety Recall paperwork for Recall 14E-041.

**Description of Remedy :**

Description of Remedy Program : Ricon will provide a field modification instruction and all material required to mitigate this recall at no charge. For units within warranty, a platform assembly will be provided by Ricon. For all units that fall outside of warranty period, a platform weldment will be provided. If no cracking is found a supplement elastomeric bumper kit provided by Ricon must be installed for each unit that is identified on the affected list.

How Remedy Component Differs from Recalled Component : Please see Ricon Corporation Recall 14E-041.

Identify How/When Recall Condition was Corrected in Production : Please see Ricon Corporation Recall 14E-041.

**Recall Schedule :**

Description of Recall Schedule : Notification of recall will be done by Certified Mail the first week of November 2014

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : NOV 03, 2014 - NOV 07, 2014

\* NR - Not Reported