

**Part 573 Safety Recall Report****14V-724****Manufacturer Name :** Innovative Trailer Design Industries**Submission Date :** NOV 07,2014**NHTSA Recall No. :** 14V-724**Manufacturer Recall No. :** ITD-2014-W01**Manufacturer Information :**

Manufacturer Name : Innovative Trailer Design Industries

Address : 1770 Britannia Road East

Mississauga, Ontario 00 L4W 1J3

Company phone : 905-670-7755

**Population :**

Number of potentially involved : 1

Estimated percentage with defect : 100

**Vehicle Information :**

Vehicle : 2014-2014 Innovative Trailer Design V40TAN49

Vehicle Type : TRAILERS

Body Style : VAN

Power Train : NR

Descriptive Information : 40FT Post and Panel Van with SAF-Holland CBX40 Suspension. The pivot bolts of the suspension are under Recall notice 14E-024 from SAF-Holland

Production Dates : OCT 15, 2013 - DEC 30, 2013

**VIN (Vehicle Identification Number) Range**

Begin : 2TX1F2422ED410001

End : 2TX1F2422ED410001

 Not sequential VINs**Description of Defect :**

Description of the Defect : The defect is in the pivot bolts of the SAF-Holland CBX40 suspension. The defect is an intergranular quench crack at the point where the bolt head meets the body of the bolt.

Description of the Safety Risk : Separation of the axle/suspension assembly from the trailer is possible if both sides of the pivot connection fail.

Description of the Cause : The current prevailing theory is that improper/ineffective heat-treat process resulted in the defect.

Identification of Any Warning that can Occur : The failure of a pivot bolt on one side of the axle/suspension assembly could result in the trailer becoming misaligned behind the tractor which will be immediately apparent to the driver

**Supplier Identification :****Component Manufacturer**

Name : Brunner Manufacturing

Address : 1025 Parker Drive

Mauston WISCONSIN 53948

Country : United States

**Chronology :**

JULY 14, 2014 - Received notice from SAF-Holland

JULY 23, 2014 - Forwarded notice from SAF-Holland to customer

OCT 20, 2014 - Received request from NHTSA to file report

**Description of Remedy :**

Description of Remedy Program : Replacement of all affected pivot bolts will be required on the identified suspension of the identified units.

How Remedy Component Differs from Recalled Component : According to SAF-Holland the new bolts will bear a white paint dot on the head of the bolt.

Identify How/When Recall Condition was Corrected in Production : There were no other CBX40 from SAF-Holland in stock or in our production identified by SAF-Holland at time of notice to ITD, only the 1 unit in the field. The SAF-Holland recall notice would be provided to the Agent/Customer as well as the supporting documentation provided by SAF-Holland.

**Recall Schedule :**

Description of Recall Schedule : JULY 23, 2014 1ST Notice sent to customer  
NOV 2014, 2nd notice sent to customer

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : NOV 10, 2014 - NOV 21, 2014

\* NR - Not Reported