

Part 573 Safety Recall Report**14V-788****Manufacturer Name :** Honda (American Honda Motor Co.)**Submission Date :** DEC 11,2014**NHTSA Recall No. :** 14V-788**Manufacturer Recall No. :** JN0, JN1, JN3**Manufacturer Information :**

Manufacturer Name : Honda (American Honda Motor Co.)

Address : 1919 Torrance Blvd.

Torrance CA 90501

Company phone : 310-783-2000

Population :

Number of potentially involved : 1,252

Estimated percentage with defect : 0

Vehicle Information :

Vehicle : 2015-2015 Honda Crosstour 4 cylinder

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : The recall population was determined based on manufacturing records. The VIN range reflects all possible vehicles that could potentially experience the problem.

Production Dates : OCT 01, 2014 - NOV 04, 2014

VIN (Vehicle Identification Number) Range

Begin : 5J6TF3H38FL000552

End : 5J6TF3H38FL000552

 Not sequential VINs

Vehicle : 2015-2015 Honda Crosstour V6 2WD

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : The recall population was determined based on manufacturing records. The VIN range reflects all possible vehicles that could potentially experience the problem.

Production Dates : SEP 30, 2014 - NOV 13, 2014

VIN (Vehicle Identification Number) Range

Begin :

End :

 Not sequential VINs

Vehicle : 2015-2015 Honda Crosstour V6 4WD

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : The recall population was determined based on manufacturing records. The VIN range reflects all possible vehicles that could potentially experience the problem.

Production Dates : SEP 30, 2014 - NOV 18, 2014

VIN (Vehicle Identification Number) Range

Begin :

End :

Not sequential VINs

Description of Defect :

Description of the Defect : During manufacturing of the side curtain airbag inflator, improper tooling set-up may have created a thin wall condition on the inflator tube.

Description of the Safety Risk : In the event of a crash necessitating deployment of the side curtain airbags, a thin wall condition on the inflator tube may adversely affect performance of the side curtain airbags in a crash, increasing the risk of occupant injury.

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

Supplier Identification :

Component Manufacturer

Name : TK Holdings, Inc.

Address : 888 16th Street NW

Suite 800 Washington DISTRICT OF COLUMBIA 20006

Country : United States

Chronology :

November 14, 2014

The Tier 2 supplier that manufactures the inflator tube notifies the Tier 1 supplier of a production anomaly regarding the tube wall thickness.

November 18, 2014

Deployment testing of inflators with suspect tubes and comparative lots begins.

November 19, 2014

The Tier 1 supplier notifies Honda that side curtain airbag inflators possibly may have a thin-wall condition.

December 4, 2014

Honda determines that a safety defect exists and decides to conduct a safety recall.

As of December 4, 2014 Honda has received 16 field reports and no warranty claims or injuries related to this issue.

Description of Remedy :

Description of Remedy Program : The owners of all affected vehicles will be contacted by mail and asked to take their vehicle to a Honda automobile dealer. The dealer will replace the

left and/or right side curtain airbags free of charge. Because the new vehicle warranty on all affected vehicles would have provided a free repair for the problem addressed by this recall, without any payment by the owner, reimbursement for pre-notification repairs will not be offered.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : NR

Planned Dealer Notification Date : DEC 11, 2014 - DEC 12, 2014

Planned Owner Notification Date : JAN 09, 2015 - JAN 16, 2015

* NR - Not Reported