

# Federal Recall Information

---

**314-D**

## Description

Bendix 16.5 x 7 Brake Shoe Linings

---

## Release Date

5/5/2014

---

## Introduction

Peterbilt Motors Company has decided that a noncompliance which relates to motor vehicle safety exists in certain Peterbilt vehicles manufactured between October 6, 2007 and September 23, 2013. Your vehicle has been identified as having been manufactured within this time period and may contain a noncompliance. The ES-420 brake linings used are not rated for GAWR between 20,001 and 22,000 lbs when used with larger SLR (20.5" to 21.5") tires. The use of this brake lining in this application rendered the vehicles noncompliant with FMVSS 121.

## **THIS RECALL WILL NOT EXPIRE**

---

## Resolution

Replace Bendix ES-420 brake linings with Bendix ES-600 brake linings on trucks listed in the chassis list below.

---

**It is a violation of Federal law for a dealer to sell or lease new vehicles covered by this recall until the defect or noncompliance has been corrected.**

---

## Warranty

The SIR system will indicate chassis involved in this field repair with the designator for 314-D. If the vehicle is affected and is shown to have an open campaign, please complete the work and file a quick claim "**314-D**".

For Field...	Enter...
Failure Location	013-001-013 Brake Shoe and Lining Assembly

Failure Type	705
Claim Type	C
Campaign Number	314-D
SRT 013-007	1.4 Hour labor x 2 = 2.8 Hours Labor

---

## Parts

Peterbilt will reimburse for part cost at dealer net + 30%

Quantity	Part #	Description
2	KT4709E11600	Brake Shoe

---

## Labor

Peterbilt will reimburse for 2.8 hours of labor (1.4 hours per side) to install brake shoes on each end of the front axle.

---

## Procedure

1. Remove front tires and wheels
  2. Remove hub/drum assembly
  3. Remove current brake shoes
  4. Install replacement brake shoes
-