

Federal Recall Information

514-F

Supplier

Peterbilt

Description

Rolltek Seat Fault Telltale Lamp

Release Date

06/30/2014

Introduction

Peterbilt has decided that vehicles built between October 30, 2009 and May 21, 2014, and manufactured with IMMI RollTek seats may contain a defect related to the supplemental restraint system. The vehicle gauge cluster contains a telltale lamp for indicating a fault in the IMMI RollTek supplemental restraint system. Due to a wiring defect in the electrical harness in these vehicles, the RollTek telltale-warning indicator will not illuminate when there is no power supplied to the seat electrical control unit while the ignition key is in the "on" position. In the event that power is cut off to the seat ECU (i.e., a missing or blown fuse or failure to connect the seat to cab harness), the vehicle's operator will not be warned of a problem with the side air bag.

When there is no power to the RollTek Control Unit, the driver is not warned of a problem with the side air bag system and he or she will not take steps to remedy the problem, thereby increasing the risk of injury or severity of injury to vehicle occupants in the event of a rollover.

THIS RECALL WILL NOT EXPIRE

Resolution

Peterbilt will replace the RollTek electrical harness with a new harness that includes wiring that will enable the RollTek fault telltale lamp to illuminate in the event the RollTek ECU is not powered when the ignition key is in the "on" position.

It is a violation of Federal law for a dealer to sell or lease new vehicles covered by this recall until the defect or noncompliance has been corrected.

Warranty

The SIR system will indicate chassis involved in this field repair with the designator for 514-F. If the vehicle is affected and is shown to have an open campaign, please complete the work and file a quick claim. See chassis list for appropriate quick claim per part.

Parts

Parts are available through PACCAR Parts (via normal parts ordering) and reimbursed by this recall at DealerNet + 30% markup.

Quantity	Replace with	Description	Quick Clam Number
1	P92-9399	RollTek Dash Harness	514-F1
1	P92-9400	RollTek Driver Seat Harness Layer	514-F2
1	P92-9401	RollTek Dash Harness	514-F3

Labor

Peterbilt will pay for x.xx hours of labor to install the new harness.

Procedure

attach procedure here

Shipping

Attach chassis list he