



This Service Information bulletin supersedes SI 71 02 14 dated **September 2014**.

Changes to this revision are identified by a black bar.

SUBJECT

Delivery Stop: Compact Spare Wheel

MODEL

F55 and F56 (Hardtop 4-door and 2-door)

SITUATION

A Delivery Stop has been issued on certain F55 and F56 vehicles produced from December 2013 through September 18, 2014.

The securing nut of the compact spare wheel has to be replaced in these vehicles.

Affected vehicles in dealer inventory must not be retailed or delivered until this issue is corrected. Vehicles at ports of entry will be repaired prior to dealer delivery.

To alleviate the impact of the delivery stop on affected vehicles in your inventory, and provided that the part is available, you can perform the correction and submit a claim as outlined below.

For the remaining affected vehicles, this bulletin will be updated shortly.

Vehicles which still require this Campaign will show the following Campaign Code:

0071120200, Delivery Stop, Compact Spare Wheel; see SI M71 02 14.

The Campaign Code is located in the "Open Campaign Information" section in the DCSnet Warranty Vehicle Inquiry and in the Key Reader.

CORRECTION

Remove the nut from the bracket holding the compact spare wheel. Fit the new self-locking flange nut (P/N 22 11 6 779 973) and torque to 19 Nm.

PARTS INFORMATION

Part Number	Description	Quantity
22 11 6 779 973	Flange Nut	1

WARRANTY INFORMATION

Defect Code: 36 11 10 65 00

Labor Operation: 36 99 000	Labor Allowance: 3 FRU	Description: Fit the new self-locking flange nut
--------------------------------------	----------------------------------	--

Work time labor code 36 99 000 is considered a Plus labor operation.