


REVISIONS				
ZONE	REV	DESCRIPTION	DATE	APPROVED

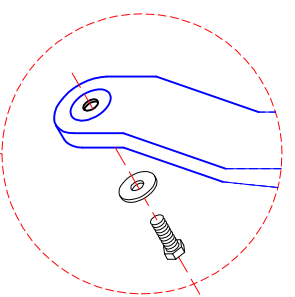

BELT BUCKLE
INSIDE SHEATH

7/16-20 x 1.5" grade 5 BOLT


WASHER 7/16 USS

BELT SHEATH
BUSHING 16220

WASHER 7/16 USS
BUSHING 16220

J BRACKET LH

FRONT VIEW

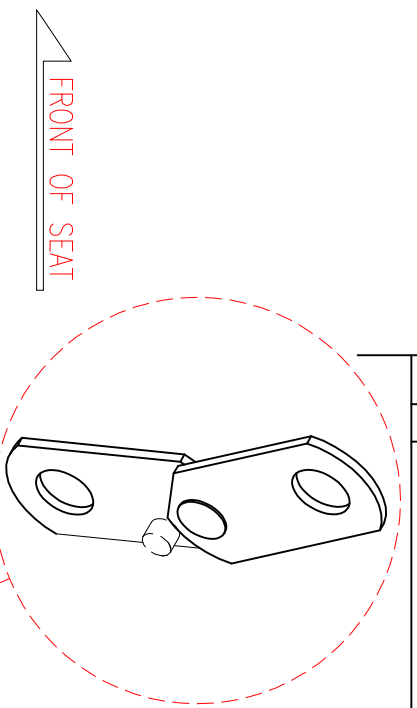

FRONT OF SEAT

BELT SHEATH

J BRACKET LH

LH SIDE VIEW

ABTS HINGE LINK
SHOWN INSTALLED
INCORRECTLY
WHEN THE LOWER
LINK IS INBOARD
TOWARD THE SEAT
FRAME.

NOTE:

THIS REPAIR IS INTENDED ONLY FOR THOSE ABTS HINGES INSTALLED INCORRECTLY AS SHOWN IN THE LH SIDE VIEW.

REMOVE TWIST IN SEAT BELT BEFORE INSTALLING SHEATH AND FASTENING END.

LEFT SIDE OF DRIVERS SEAT SHOWN
RIGHT SIDE PASSENGER SEAT THE SAME.

This drawing is the property
of Villa International all
rights reserved.

VILLA INTERNATIONAL				
ABTS HINGE LINK, RECALL REPAIR				
JGM 4.21.14	SIZE	FORM NO.	DWG NO.	REV
	SCALE		02	

REFERENCE NHSTA RECALL # 14E009