

# VOLUNTARY NON-COMPLIANCE RECALL CAMPAIGN

# SUBJECT: 2014MY SPORTAGE INCORRECT CERTIFICATION LABEL -FMVSS 110 (SC103)

This bulletin provides information related to the application of corrective labels over two (2) specific pages of the Owner's Manual and over the existing tire inflation information on the Vehicle Certification Label located on the driver's side B-pillar of some 2014MY Sportage (SL) vehicles, produced from September 30, 2013 through January 11, 2014. The listed tire pressure information in the Owner's Manual and on the Vehicle Certification Label of the affected vehicles is either 1 or 2 psi below the correct information found on the "Tire and Loading Information Label" depending on the tire rim size. Improperly inflated tires can lead to premature tire wear and can increase the risk of tire failure and crash. To ensure that only the correct tire inflation information is shown, follow the procedure in this bulletin to apply "blank" labels over the tire pressures on the Vehicle Certification Label, and to check for and, if necessary, apply labels with the corrected information to pages 5-70 or 5-71 and 8-3 of the Owner's Manual.



## **\*** NOTICE

To assure complete customer satisfaction, always remember to refer to WebDCS Warranty Coverage (validation) Inquiry Screen (Service > Warranty Coverage >Warranty Coverage Inquiry) for a list of any additional campaigns that may need to be performed on the vehicle before returning it to the customer.

## **\*** NOTICE

There is no charge to the vehicle owner for this repair. Under applicable law, you may not sell or otherwise deliver any affected Sportage (SL) until it has been repaired pursuant to the procedures set forth in this bulletin.

### File Under: <Voluntary Non-Compliance Recall Campaign>

Circulate To:	🗵 Ge	neral Manager	🔀 Service Manager	🗵 Parts Manager
🗵 Service Adviso	r(s)	⊠ Technician(s)	⊠ Body Shop Manager	⊠ Fleet Repair

#### Page 2 of 4

# 2014MY SPORTAGE INCORRECT CERTIFICATION LABEL – FMVSS 110 (SC103)

### **Owner's Manual Correction:**

1. Open the glove box and locate the Owner's Manual.

## **\*** NOTICE

On some retailed vehicles, customers may already have applied correction labels to the affected pages in the Owner's Manual (OM). If so, no further action on OM is required; proceed to Vehicle Certification Label correction on Page 3.

- 2. Open the page shown in the table below and carefully place the corrective label over the affected text, as shown.

Page	Content to be Corrected				
5-70 or 5-71	Vehicle load limit				



3. Open the page shown in the table below and carefully place the corrective label over the affected text, as shown.

Page	<b>Content to be Corrected</b>			
8-3	Tires & wheels			



## 2014MY SPORTAGE INCORRECT CERTIFICATION LABEL – FMVSS 110 (SC103)

### Vehicle Certification Label Correction:

1. Locate the Vehicle Certification Label on the driver's side B-pillar and use a shop towel to wipe it clean.



2. Peel off one of the labels from the blank label sheet.

# \* NOTICE

The initial supply of blank label sheets will be automatically shipped to the dealer.

- 3. Apply the blank label onto the Vehicle Certification Label, as shown. Make sure to apply pressure to the blank label in order to ensure complete adhesion.



Make sure the blank label does not obscure any other information on the Vehicle Certification Label. The blank label should be applied <u>ONLY</u> over the tire pressure information.



TSB: SC103 Sportage (SL) March 2014

#### Page 4 of 4

## EXTERN 2014MY SPORTAGE INCORRECT CERTIFICATION LABEL -FMVSS 110 (SC103)

### **REQUIRED PARTS:**

Part Name	Part No.	Qty.	Figure	Comments	
Blank Label Sheet	UP140 PS103FM	1		Initial supply auto- shipped to dealer	
OM Correction Label #1	UP140 PS103OM1	1		Shipped to customer	
OM Correction Label #2	UP140 PS103OM2	1	The second secon	Shipped to customer	

### AFFECTED PRODUCTION RANGE:

Model	Production Date Range			
Sportage (SL)	From September 30, 2013 through January 11, 2014			

### WARRANTY CLAIM INFORMATION:

Claim Type	Causal P/N	Qty.	N Code	C Code	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
R	05203 3W550	0	N63	C61	(SC103) Vehicle Certification Label Modification	141000R0	0.2 M/H	N/A	0

### **\*** NOTICE

To assure complete customer satisfaction, always remember to refer to WebDCS Warranty Coverage (validation) Inquiry Screen (Service > Warranty Coverage >Warranty Coverage Inquiry) for a list of any additional campaigns that may need to be performed on the vehicle before returning it to the customer.