



HYUNDAI

NEW THINKING.
NEW POSSIBILITIES.

Technical Service Bulletin

GROUP

CAMPAIGN

NUMBER

14-01-020

DATE

MAY 2014

MODEL(S)

TUCSON (LM)

SUBJECT: DRIVER FRONT AIRBAG MODULE BOLT INSPECTION
(RECALL CAMPAIGN 118)

★ IMPORTANT

*** Dealer Stock and Retail Vehicles ***

As required by federal law, dealers must not deliver new vehicles for sale or for lease to customers until all open recalls have been performed. Dealers must also perform all open recalls on used vehicles, demo and rental vehicles prior to placing them into customer use and whenever an affected vehicle is in the shop for any maintenance or repair.

When a vehicle arrives at the service department, access Hyundai Motor America's "Warranty Vehicle Information" screen via WEBDCS to identify open Campaigns.

Description: This bulletin describes the service procedure to verify the torque of the two driver front airbag module assembly bolts.



Applicable Vehicles: JAN 03, 2011 through DEC. 23, 2013

Warranty Information:

Model	Op Code	Operation	Op Time
LM	41C035R0	DRIVER SIDE AIRBAG MODULE BOLT INSPECTION	0.2 M/H

NOTE: Submit Claim on Campaign Claim Entry Screen

Circulate To: General Manager, Service Manager, Parts Manager, Warranty Manager, Service Advisors, Technicians, Body Shop Manager, Fleet Repair

Service Procedure:

1. Align the steering wheel to the center and ensure the ignition key is in the OFF position. (START/STOP button in the OFF position).
2. Verify the airbag module mounting bolt torque using a T40 torx and torque wrench. If necessary, tighten the bolts to the specification below.



*** NOTE**

Tightening torque
: 7.8 ~ 10.8 Nm (0.8 ~ 1.1 kgf.m,
5.8 ~ 8.0 lb-ft)