

Part 573 Safety Recall Report**15V-007****Manufacturer Name :** Piaggio Group Americas. Inc.**Submission Date :** JAN 12,2015**NHTSA Recall No. :** 15V-007**Manufacturer Recall No. :** NR**Manufacturer Information :**

Manufacturer Name : Piaggio Group Americas. Inc.

Address : 257 Park Avenue South

4th Floor New York NY 10010

Company phone : 645-0030

Population :

Number of potentially involved : 337

Estimated percentage with defect : 1

Vehicle Information :

Vehicle : 2014-2015 Aprilia Shiver 750

Vehicle Type : MOTORCYCLES

Body Style : OTHER

Power Train : GAS

Descriptive Information : A specific group of 2014 and 2015 Aprilia Shiver 750 Motorcycles will need to be checked for a possible safety defect of the output gear shaft.

Production Dates : FEB 10, 2014 - OCT 28, 2014

VIN (Vehicle Identification Number) Range

Begin : ZD4RAC012ES000788

End : ZD4RAC014FS001412

 Not sequential VINs

Vehicle : 2015-2015 Aprilia Caponord 1200

Vehicle Type : MOTORCYCLES

Body Style : OTHER

Power Train : GAS

Descriptive Information : All 2015 Aprilia Caponord 1200cc motorcycles sold in the US will need to be checked by an authorized Aprilia dealer for a possible safety defect of the output gear shaft.

Production Dates : NOV 14, 2013 - OCT 16, 2014

VIN (Vehicle Identification Number) Range

Begin :

End :

 Not sequential VINs**Description of Defect :**

Description of the Defect : The output gear shaft face may not be machined to the proper specifications.

Description of the Safety Risk : The screw fastening the sprocket may become loose, causing the rear wheel to lock momentarily or completely.

Description of the Cause : Non-conformity of the supplier
Identification of Any Warning that can Occur : none

Supplier Identification :**Component Manufacturer**

Name : CHONGQING QIUTIAN GEAR CO.,LTD

Address : NO.7 JIANQIAO INDUSTRY ZONE DADUKOU

DISTRICT CHONGQING FOREIGN STATES 400084

Country : China

Chronology :

There have not been any reported cases worldwide that have resulted in accidents injuries or fatalities. There have been no reports of failures in the US and no warranty claims have been entered for the affected part as of the date of this report.

Description of Remedy :

Description of Remedy Program : The owners of all affected vehicles will be contacted by mail and asked to take their vehicle to an Aprilia authorized dealer, qualified to work on this model, who will check the component and replace it if found to be defective free of charge.

How Remedy Component Differs from Recalled Component : All defective output shafts found will be replaced with a properly manufactured component that has been quality inspected by Aprilia.

Identify How/When Recall Condition was Corrected in Production : All new production of this model will have this component that has been properly manufactured and quality inspected by Aprilia.

Recall Schedule :

Description of Recall Schedule : We have the draft copies of the dealer notification and customer letter ready to submit for approval. We will begin customer notification as soon as we are assigned a recall number.

Planned Dealer Notification Date : JAN 12, 2015 - JAN 13, 2015

Planned Owner Notification Date : JAN 12, 2015 - JAN 26, 2015

* NR - Not Reported