

Part 573 Safety Recall Report**15V-010****Manufacturer Name :** Winnebago Towable**Submission Date :** JAN 30,2015**NHTSA Recall No. :** 15V-010**Manufacturer Recall No. :** NR**Manufacturer Information :**

Manufacturer Name : Winnebago Towable

Address : 201 14th Street

Middlebury IN 46540

Company phone : 825-5250

Population :

Number of potentially involved : 746

Estimated percentage with defect : 1

Vehicle Information :

Vehicle : 2013-2015 Winnebago Minnie 2201DS & 2450BHS

Vehicle Type : TRAILERS

Body Style :

Power Train : NR

Descriptive Information : Winnebago Towables. has decided that a defect which relates to motor vehicle safety exists on certain

2013 to 2015 model year Winnebago Minnie and Sunny Brook Remington (Models 2201DS, 2200DS, 2450BHS and 2451BHS) travel trailers.

Production Dates : MAY 07, 2012 - NOV 13, 2014

VIN (Vehicle Identification Number) Range

Begin : 54CAM0M23D1S86981

End : 54CA11P28F1C12018

 Not sequential VINs

Begin : 54CAM0M23D1S86981

End : 54CA11P28F1C12018

 Not sequential VINs

Begin : 54CAM0M23D1S86981

End : 54CA11P28F1C12018

 Not sequential VINs

Begin : 54CAM0M23D1S86981

End : 54CA11P28F1C12018

 Not sequential VINs

Vehicle : 2012-2015 Sunnybrook Remington 2200DS & 2451BHS

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Winnebago Towables. has decided that a defect which relates to motor vehicle safety exists on certain

2013 to 2015 model year Winnebago Minnie and Sunny Brook Remington (Models 2201DS, 2200DS, 2450BHS and 2451BHS) travel trailers.

Production Dates : MAY 07, 2012 - NOV 13, 2014

VIN (Vehicle Identification Number) Range

Begin : 54CAM0M23D1S86981

End : 54CA11P28F1C12018

 Not sequential VINs**Description of Defect :**

Description of the Defect : These vehicles may encounter axle contact with the black LP pipe fitting, creating a broken or cracked fitting. This could result in LP gas being released.

Description of the Safety Risk : If the propane gas continues to flow, it has the potential to ignite resulting in the possibility of personal injury and/or vehicle and property damage.

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

Supplier Identification :**Component Manufacturer**

Name : Winnebago of Indiana

Address : 201 14th St

PO Box 2001 Middlebury FOREIGN STATES 46540

Country : NR

Chronology :

Customer notified Winnebago of Indiana in the fall of 2014 providing pictures of incident. First report of issue was this report. 2nd report of the issue came from a dealer on or about November 10th, 2014 with the same issue. A full product inspection was performed after the second incident and the recall process was started.

Description of Remedy :

Description of Remedy Program : These vehicles may encounter axle contact with the black LP pipe fitting, creating a broken or cracked fitting. This could result in LP gas being released.

How Remedy Component Differs from Recalled Component : A metal tubular steel bump stop will be added to the frame to prevent the axle from being able to contact the LP fitting.

Identify How/When Recall Condition was Corrected in Production : The units already produced had a bump stop installed as soon as they were identified. Units that were to be built had bump stops installed by the frame manufacturer before Winnebago of Indiana built on the frame.

Recall Schedule :

Description of Recall Schedule : Dealer notification 1/29/2015
Owner notification 1/30/2015

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : NR - NR

* NR - Not Reported