OMB Control No.: 2127-0004

# **Part 573 Safety Recall Report**

## 15V-046

**Manufacturer Name :** Chrysler (FCA US LLC)

Submission Date: JAN 27,2015 NHTSA Recall No.: 15V-046 Manufacturer Recall No.: R06



#### **Manufacturer Information:**

Manufacturer Name: Chrysler (FCA US LLC)

Address: 800 Chrysler Drive

CIMS 482-00-91 Auburn Hills MI 48326-2757

Company phone: 1-800-853-1403

## **Population:**

Number of potentially involved: 753,176 Estimated percentage with defect: NR

### **Vehicle Information:**

Vehicle: 2002-2003 Jeep Liberty Vehicle Type: LIGHT VEHICLES

Body Style : SUV Power Train : GAS

Descriptive Information : 2002-2003 Jeep Liberty Production Dates : JAN 09, 2001 - MAR 28, 2003

## **VIN (Vehicle Identification Number) Range**

Vehicle: 2002-2004 Jeep Grand Cherokee

Vehicle Type: LIGHT VEHICLES

Body Style : SUV Power Train : GAS

Descriptive Information: 2002-2004 Jeep Grand Cherokee

Production Dates: FEB 13, 2001 - MAY 23, 2003

### **VIN (Vehicle Identification Number) Range**

Vehicle: 2003-2004 Dodge Viper Vehicle Type: LIGHT VEHICLES

Body Style : 2-DOOR Power Train : GAS

Descriptive Information: 2003-2004 Dodge Viper Production Dates: NOV 01, 2001 - JUN 30, 2004

# **VIN (Vehicle Identification Number) Range**

Begin: NR End: NR **☐** Not sequential VINs

### **Description of Defect:**

Description of the Defect: Some vehicles may experience front airbag, side curtain airbag, and seatbelt

pretensioner inadvertent deployments.

Description of the Safety Risk: Airbags that unexpectedly deploy increase the possibility of a crash and risk of injury.

Description of the Cause: The inadvertent airbag deployments are the result of an electrical over-stress to one

of two Application Specific Integrated Circuits that control the airbag squibs. The cause of the electrical over-stress has yet to be determined and is actively under

investigation.

Identification of Any Warning that can Occur: Customer complaints have indicated, in many instances, that the airbag warning lamp and/or chime are activated shortly before an inadvertent airbag deployment.

### **Supplier Identification:**

# **Component Manufacturer**

Name: TRW Automotive

Address: 24175 Research Drive

Farmington Hills FOREIGN STATES 48335-2642

Country: NR

### **Chronology:**

Please see attached supplemental information titled "Chrysler Group LLC Chronology R06".

### **Description of Remedy:**

Description of Remedy Program: Chrysler will replace the ORC module software, free of charge. Chrysler has a

longstanding policy and practice of reimbursing owners who have incurred the cost of repairing a problem that subsequently becomes the subject of a field action. To ensure consistency, Chrysler, as part of the owner letter, will request that customers send the original receipt and/or other adequate proof of payment to the company for confirmation of the expense.

How Remedy Component Differs from Recalled Component: Replacement ORC modules are being developed

that utilize the next generation of electrical architecture for ORC modules, including a revision to the positioning of the Safing Sensor. These next generation ORC modules do not have

a history of IAD.

Identify How/When Recall Condition was Corrected in Production: N/A

## **Recall Schedule:**

Description of Recall Schedule : NR

Planned Dealer Notification Date: MAR 16, 2015 - MAR 16, 2015

Planned Owner Notification Date : MAR 17, 2015 - MAR 27, 2015

\* NR - Not Reported