

Part 573 Safety Recall Report**15V-061****Manufacturer Name :** Newmar Corporation**Submission Date :** FEB 03,2015**NHTSA Recall No. :** 15V-061**Manufacturer Recall No. :** NR**Manufacturer Information :**

Manufacturer Name : Newmar Corporation

Address : 355 North Delaware Street

PO Box 30 Nappanee IN 46550

Company phone : 574-773-7791

Population :

Number of potentially involved : 98

Estimated percentage with defect : 0

Vehicle Information :

Vehicle : 2014-2015 Newmar King Aire and Essex

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Chassis equipped with Wabco quick release valves with double check (QRDC), part number 473 505 003 0, identified with date codes between 1813 through 1614 could have a potentially defective valve seat installed. Sharp edges on valve seat ribs may damage the rubber diaphragm in the valve over time causing leakage levels through the diaphragm in excess of permissible specifications. This increase in leakage levels could exceed the capacity of the compressor and reduce pressure in the air tanks. The increased QRDC valve leakage and reduced air pressure levels could eventually progress to the point that vehicle braking performance could be degraded or parking/emergency brakes could begin to reapply. If this condition is not detected and normal warnings are not heeded, it could eventually affect the performance of the vehicle's braking system, increasing the risk of a vehicle crash.

Certain recreational vehicles manufactured by Newmar Corporation, as Identified above, were built on chassis manufactured by Spartan Motor Corporation which were equipped by Newmar Corporation.

Production Dates : DEC 09, 2013 - DEC 16, 2014

VIN (Vehicle Identification Number) Range

Begin : NR

End : NR

 Not sequential VINs**Description of Defect :**

Description of the Defect : Chassis equipped with Wabco quick release valves with double check (QRDC), part

number 473 505 003 0, identified with date codes between 1813 through 1614 could have a potentially defective valve seat installed. Sharp edges on valve seat ribs may damage the rubber diaphragm in the valve over time causing leakage levels through the diaphragm in excess of permissible specifications. This increase in leakage levels could exceed the capacity of the compressor and reduce pressure in the air tanks. The increased QRDC valve leakage and reduced air pressure levels could eventually progress to the point that vehicle braking performance could be degraded or parking/emergency brakes could begin to reapply. If this condition is not detected and normal warnings are not heeded, it could eventually affect the performance of the vehicle's braking system, increasing the risk of a vehicle crash.

Certain recreational vehicles manufactured by Newmar Corporation, as Identified above, were built on chassis manufactured by Spartan Motor Corporation which were equipped by Newmar Corporation.

Description of the Safety Risk : If this condition is not detected and normal warnings are not heeded, it could eventually affect the performance of the vehicle's braking system, increasing the risk of a vehicle crash.

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

Supplier Identification :

Component Manufacturer

Name : NR

Address : NR

FOREIGN STATES

Country : NR

Chronology :

NR

Description of Remedy :

Description of Remedy Program : Spartan Motors Inc. will provide owners of all affected motor homes a remedy for the potential defect at no charge for parts or labor. This remedy consists of inspecting/replacing the defective Wabco Double Check Quick Release Valve with a new Wabco Double Check Quick Release Valve.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : NR

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : NR - NR

* NR - Not Reported