OMB Control No.: 2127-0004

# **Part 573 Safety Recall Report**

# 15V-112

**Manufacturer Name :** Farber Specialty Vehicles

**Submission Date :** FEB 23,2015 **NHTSA Recall No. :** 15V-112

**Manufacturer Recall No.:** 14E-041



#### **Manufacturer Information:**

Manufacturer Name: Farber Specialty Vehicles

Address: 7052 Americana Parkway

Reynoldsburg OH 43068

Company phone: 800-331-3188

# **Population:**

Number of potentially involved: 117 Estimated percentage with defect: 3

#### **Vehicle Information:**

Vehicle: 1993-1993 Bluebird Bus

Vehicle Type: BUSES, MEDIUM & HEAVY VEHICLES

Body Style : OTHER Power Train : NR

Descriptive Information: Ricon Public Use, "S" 2000 and 5500 Series Wheelchair lifts equipped with

platforms measuring 32"X 51" and 34"X 54".

Production Dates: APR 01, 2009 - JUL 31, 2009

#### **VIN (Vehicle Identification Number) Range**

 $\begin: NR \\ \begin : NR \\ \begin : NR \\ \begin : NR$ 

Vehicle: 2009-2009 Cargo Mate Trailer

Vehicle Type: TRAILERS

Body Style : Power Train : NR

Descriptive Information: Ricon Public Use, "S" 2000 and 5500 Series Wheelchair lifts equipped with

platforms measuring 32"X 51" and 34"X 54".

Production Dates: JAN 15, 2009 - FEB 14, 2009

## **VIN (Vehicle Identification Number) Range**

Vehicle: 2008-2008 Utilimaster Chevrolet C5500 Vehicle Type: BUSES, MEDIUM & HEAVY VEHICLES

Body Style : OTHER Power Train : NR

Descriptive Information: Ricon Public Use, "S" 2000 and 5500 Series Wheelchair lifts equipped with

platforms measuring 32"X 51" and 34"X 54".

platforms measuring 32"X 51" and 34"X 54".

Production Dates : SEP 09, 2011 - FE	B 28, 2012			
VIN (Vehicle Identification Numbe	er) Range			
Begin:	End:	☐ Not sequential VINs		
Vehicle: 2010-2010 Freighliner XCS Vehicle Type: BUSES, MEDIUM & HE Body Style: Power Train: NR Descriptive Information: Ricon Publ platforms: Production Dates: JUN 18, 2014 - AU	EAVY VEHICLES ic Use, "S" 2000 and 5500 Serie measuring 32"X 51" and 34"X 5			
VIN (Vehicle Identification Numbe	er) Range			
Begin:	End:	☐ Not sequential VINs		
Vehicle: 2010-2014 Supreme/Freig Vehicle Type: BUSES, MEDIUM & HE Body Style: Power Train: NR Descriptive Information: Ricon Publ platforms: Production Dates: APR 16, 2011 - Ma	EAVY VEHICLES  ic Use, "S" 2000 and 5500 Serie measuring 32"X 51" and 34"X 5			
VIN (Vehicle Identification Numbe	er) Range			
Begin:	End:	☐ Not sequential VINs		
Vehicle: 2005-2013 Utilimaster MT Vehicle Type: BUSES, MEDIUM & HE Body Style: Power Train: NR Descriptive Information: Ricon Publ platforms: Production Dates: APR 15, 2005-JU	EAVY VEHICLES  ic Use, "S" 2000 and 5500 Serie measuring 32"X 51" and 34"X 5			
VIN (Vehicle Identification Number				
Begin:	End:	☐ Not sequential VINs		
Vehicle: 2011-2011 Glaval/Freightliner MBC Vehicle Type: BUSES, MEDIUM & HEAVY VEHICLES Body Style: Power Train: NR Descriptive Information: Ricon Public Use, "S" 2000 and 5500 Series Wheelchair lifts equipped with platforms measuring 32"X 51" and 34"X 54".				

Production Dates : NOV 15, 201	2 -JAN 15, 2013	
VIN (Vehicle Identification Nu	ımber) Range	
Begin:	End:	☐ Not sequential VINs
platfo	& HEAVY VEHICLES  Public Use, "S" 2000 and 5500 Series rms measuring 32"X 51" and 34"X 54	
Production Dates: JUN 01, 2008		
VIN (Vehicle Identification Nu		
Begin:	End:	☐ Not sequential VINs
	Public Use, "S" 2000 and 5500 Series rms measuring 32"X 51" and 34"X 54	
VIN (Vehicle Identification Nu	ımber) Range	
Begin:	End:	☐ Not sequential VINs
-	& HEAVY VEHICLES  Public Use, "S" 2000 and 5500 Series	1 11
platto Production Dates : JUL 25, 2013	rms measuring 32"X 51" and 34"X 54 3 - OCT 25, 2013	".
VIN (Vehicle Identification Nu	ımber) Range	
Begin:	End:	☐ Not sequential VINs
-		

VIN (Vehicle Identification Numb		
VIII (Venicie lucitimeation Numb	er) Range	
Begin:	End:	☐ Not sequential VINs
Vehicle: 2006-2006 Winnebago W	FF31S	
Vehicle Type : BUSES, MEDIUM & H	EAVY VEHICLES	
Body Style :		
Power Train : NR		
Descriptive Information : Ricon Pub		1 11
Production Dates : MAY 07, 2006 - J	measuring 32"X 51" and 34"X 5	4.
VIN (Vehicle Identification Numb		
	End:	☐ Not sequential VINs
Begin:	EIIU .	Not sequential vilvs
Vehicle: 2008-2008 Winnebago W	FF38S	
Vehicle Type : BUSES, MEDIUM & H		
Body Style :		
Power Train : NR		
Descriptive Information : Ricon Pub	olic Use, "S" 2000 and 5500 Serie	s Wheelchair lifts equipped with
platforms Production Dates : SEP 07, 2007 - No	measuring 32"X 51" and 34"X 5 OV 07, 2007	4".
VIN (Vehicle Identification Numb	er) Range	
Begin:	End:	☐ Not sequential VINs
Vehicle: 2005-2005 Winnebago W	FG38S	
Vehicle Type : BUSES, MEDIUM & H		
Body Style :		
Power Train : NR		
Descriptive Information : Ricon Pub		
platforms Production Dates : JUL 12, 2005 - JU	measuring 32"X 51" and 34"X 5	4".
,	,	
VIN (Vehicle Identification Numb	er) kange	
Begin:	End:	☐ Not sequential VINs
V 1 · 1 · 0010 0014 W: 1 · W	F133S	
venicie: 2012-2014 Winnebago W		
Vehicle: 2012-2014 Winnebago W. Vehicle Type: BUSES, MEDIUM & H.	EAVY VEHICLES	
Vehicle Type : BUSES, MEDIUM & H	EAVY VEHICLES	
e e e e e e e e e e e e e e e e e e e	EAVY VEHICLES	

Production Dates : NOV 22	2006 - IUN 01 2007	
VIN (Vehicle Identification		
Begin:	End:	☐ Not sequential VINs
Vehicle: 2010-2010 Worl	khorse 38S	
Vehicle Type : BUSES, MEI	DIUM & HEAVY VEHICLES	
Body Style :		
Power Train: NR		
<u> </u>	Ricon Public Use, "S" 2000 and 5500 Series W blatforms measuring 32"X 51" and 34"X 54". 2011 - MAR 04, 2011	heelchair lifts equipped with
VIN (Vehicle Identification	on Number) Range	
Begin:	End:	☐ Not sequential VINs

## **Description of Defect:**

Description of the Defect: In vehicles of the type referenced above, the Wheelchair lifts platforms included on the subject S-Series model wheelchair lifts can exhibit cracking of the platform side plate while in the stowed position which, if left unchecked, can propagate to the point where separation of the rear portion of the side plate occurs rendering the lift potentially inoperable and possibly unsafe for the operator.

Description of the Safety Risk: In the event the aforementioned crack occurs on both sides of the platform and

is allowed to propagate to the point of material separation on both sides it is possible for the lift platform to lean against the vehicle lift door(s) and fall out of the vehicle when the door(s) is opened putting the lift operator at risk. It is not believed that cracking of the platform side plate poses a safety hazard for lift occupants. Field observations indicate that the subject failure is precipitated by cracking that propagates from the bottom of the stowed platform. When the lift is deployed and loaded normally, the load experienced by the area adjacent to the point of crack initiation is primarily compressive. Accordingly, the crack will not propagate when the platform is loaded. Moreover, in the event the crack propagates all the way through the compressive zone and into the tensile zone, the amount of material loaded in tension required to support the rated load on the platform is less than 10% of the total height of the side plate. Further, as the construction of the joint between the side plate and the vertical arm is redundant (present on both sides of the lift). A complete separation of the side plate on one side of the lift does not result in a catastrophic failure of the platform. Given the aforementioned, it is believed that separation is considerably more likely to occur while the platform is stowed than during normal operation. Ricon believes that the aforementioned mechanism accounts for why there have been no reported failures of occupied platforms.

Description of the Cause: Though the root cause is not known, analysis of failed components indicates the aforementioned cracks are the result of high load, low cycle fatigue occurring in the stowed position. Ricon believes that the excitation frequency found in vehicles of the

type referenced above combined with a variety of other factors including but not necessarily limited to a drifting hydraulic system, a poorly adjusted or nonfunctional stow lock, bent vertical arms and/or a low hydraulic fluid level precipitate the conditions under which the lift side plates may crack.

Identification of Any Warning that can Occur: Cracks are visible and can be detected during routine checks

outlined in the maintenance manual. In the event separation occurs on one side of the platform, the platform will sag to one side increasing the likelihood that the issue will be perceived by the operator. Moreover, in the unlikely event that the operator does not notice the separation when the unit is deployed, the separated side will most likely not operate properly upon stow causing the unit to jam. In the event separation occurs on both sides and the lift platform leans inboard against the interlocked occupant restraint belt and will not deploy. In the event separation occurs on both sides and the lift platform leans outboard against the door, it will likely bounce against the door causing abnormal noise detectable by the driver.

# **Supplier Identification:**

# **Component Manufacturer**

Name: Ricon Corporation Address: 1135 Aviation Place

San Fernando CALIFORNIA 91340

**Country: United States** 

#### **Chronology:**

NR

#### **Description of Remedy:**

Description of Remedy Program: Ricon will supply a supplemental platform support bumper kit at no charge.

The bumpers are fitted to the upper parallel arms and engage the sides of the platform when it is fully stowed. By limiting the amplitude through which the platform is allowed to oscillate, the load transferred through the structure at the pivot plate is significantly reduced such that mechanism that precipitates the cracks cannot occur. Any platforms wherein a crack has

begun to propagate, Ricon will replace the platform.

How Remedy Component Differs from Recalled Component: Any unit in the field that is not cracked is acceptable to use. The aforementioned bumper kit is recommended to ensure that the platform

pivot plates do not crack in the future.

Identify How/When Recall Condition was Corrected in Production: Platforms on new construction will be made from higher strength steel and will not require the bumper kit.

## **Recall Schedule:**

Description of Recall Schedule: Farber Specialty Vehicles Inc. anticipates the recall campaign will begin on

March 2, 2015 with the notification of vehicle customers.

Planned Dealer Notification Date: NR - NR

Planned Owner Notification Date: MAR 09, 2015 - MAR 09, 2015

\* NR - Not Reported