

Part 573 Safety Recall Report**15V-113****Manufacturer Name :** General Motors LLC**Submission Date :** FEB 23,2015**NHTSA Recall No. :** 15V-113**Manufacturer Recall No. :** 15135**Manufacturer Information :**

Manufacturer Name : General Motors LLC

Address : 30001 VAN DYKE

MAIL CODE 480-210-2V WARREN MI 48090

Company phone : 999

Population :

Number of potentially involved : 1,733

Estimated percentage with defect : 2

Vehicle Information :

Vehicle : 2015-2015 Chevrolet Cruze

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Certain 2015 model year Chevrolet Cruze vehicles

Production Dates : FEB 04, 2015 - FEB 09, 2015

VIN (Vehicle Identification Number) Range

Begin : NR

End : NR

 Not sequential VINs**Description of Defect :**

Description of the Defect : General Motors has decided that certain 2015 model year Chevrolet Cruze vehicles may fail to conform to S7 of Federal Motor Vehicle Safety Standard (FMVSS) No. 135, "Light Vehicle Brake Systems. " On some of these vehicles, the left-rear or right-rear parking brake cable brackets may not have been properly fastened during the assembly process.

Description of the Safety Risk : If the fastening bolts back out completely, the parking brake bracket will separate, causing the parking brake to fail and increasing the risk of a roll-away accident.

Description of the Cause : The assembly process to fasten the parking brake brackets was moved within the plant on February 4, 2015, which resulted in the use of a different, two-step fastening process. The operator of the fastening tools may have failed to perform the second step. This error was not identified during the assembly process because the fastening tool did not incorporate error-testing for this operation.

Identification of Any Warning that can Occur : NR

Supplier Identification :**Component Manufacturer**

Name : NR

Address : NR

FOREIGN STATES

Country : NR

Chronology :

On February 9, 2015, an inspection at GM's Lordstown assembly plant found that the left rear parking brake bracket in a 2015 model year Chevrolet Cruze vehicle had not been properly fastened. Two of the three fastening bolts in the parking brake bracket were not torqued to the correct specification.

On February 11, 2015, GM determined that, if all three fastening bolts in the parking brake bracket were to back out completely, the parking brake may not conform to S7 of FMVSS No. 135.

On February 16, 2015, GM's Safety and Field Action Decision Authority (SFADA) decided to conduct a non-compliance recall.

Description of Remedy :

Description of Remedy Program : Dealers will inspect the left-rear and right-rear parking brake bracket bolts and, if necessary, tighten to the correct torque specification. Pursuant to 577.11, General Motors does not plan to provide notice about reimbursement to owners because all involved vehicles are covered under the new vehicle warranty.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : The plant implemented a post-operation inspection down line from the park brake bracket secure process.

Recall Schedule :

Description of Recall Schedule : General Motors issued notification to dealers on 02/16/2015. General Motors will provide the owner letter mail dates when available.

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : NR - NR

* NR - Not Reported