OMB Control No.: 2127-0004

Part 573 Safety Recall Report

15V-338

Manufacturer Name: Mitsubishi Motors North America, Inc.

Submission Date: AUG 02, 2016 **NHTSA Recall No.:** 15V-338 **Manufacturer Recall No.:** SR-15-005



Manufacturer Information:

Manufacturer Name: Mitsubishi Motors North America, Inc.

Address: 6400 Katella Avenue

Cypress CA 90630

Company phone: 1-888-648-7820

Population:

Number of potentially involved: 443,442

Estimated percentage with defect: NR

Vehicle Information:

Vehicle 1: 2000-2005 Mitsubishi Eclipse

Vehicle Type: LIGHT VEHICLES

Body Style : 2-DOOR Power Train : GAS

Descriptive Information: Only vehicles manufactured within the specified production dates are affected by this

recall.

Production Dates: APR 05, 1999 - DEC 17, 2004

VIN Range 1: Begin: 4A3AC54L6YE000142 End: 4A3AC84H75E039606 ✓ Not sequential

Vehicle 2: 2001-2005 Dodge Stratus

Vehicle Type: LIGHT VEHICLES

Body Style : 2-DOOR Power Train : GAS

Descriptive Information: Only vehicles manufactured within the specified production dates are affected by this

recall.

Production Dates: APR 17, 2000 - FEB 22, 2005

VIN Range 1: Begin: 4B3AG52H91E000924 End: 4B3AG42G65E051630 ✓ Not sequential

Vehicle 3: 2001-2005 Chrysler Sebring

Vehicle Type: LIGHT VEHICLES

Body Style : 2-DOOR Power Train : GAS

Descriptive Information: Only vehicles manufactured within the specified production dates are affected by this

recall.

Production Dates: APR 17, 2000 - FEB 21, 2005

VIN Range 1: Begin: 4C3AG42H21E000809 End: 4C3AG42GX5E051245 Not sequential

Vehicle 4: 2001-2005 Mitsubishi Eclipse Spyder

Vehicle Type: LIGHT VEHICLES

Body Style : 2-DOOR Power Train : GAS

Descriptive Information: Only vehicles manufactured within the specified production dates are affected by this

recall.

Production Dates: JAN 19, 2000 - MAR 18, 2005

VIN Range 1: Begin: 4A3AE35G11E000376 End: 4A3AE45G55E057093 ✓ Not sequential

Description of Defect:

Description of the Defect: During a frontal accident resulting in frontal airbag deployment, there is the

potential for interaction between the deploying passenger airbag and the passenger sun visor if the sun visor is in the down position. Depending on the position and angle of the sun visor in the down position, the deploying

passenger airbag may remove the sun visor, propelling it rearward. In a worst case scenario, the removed sun visor could strike a passenger seated in the

front passenger seat, increasing their risk of injury.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: The passenger sun visor, if removed and propelled rearward by the deploying

passenger airbag, could increase the risk of injury to a passenger seated in the

front passenger seat.

Description of the Cause: Interaction between the deploying passenger airbag and the passenger side

sun visor in the down position could result in removal of the sun visor from the

sun visor rod, and propelling of the sun visor rearward.

Identification of Any Warning None.

that can Occur:

Supplier Identification:

Component Manufacturer

Name: NR

Address: NR

NR

Country: NR

Chronology:

See attached document.

Description of Remedy:

Description of Remedy Program: Owners of all affected vehicles will be notified and encouraged to bring in

their vehicles for repair. A tether strap will be added to the passenger sun visor on each vehicle. For the Eclipse Spyder vehicles, the sun visor holder will be also replaced with a countermeasure one at no charge to the customer. Owners seeking reimbursement for any expenses associated with this recall will be directed in the notification letter to contact the Mitsubishi Customer Relations Department for instructions on how to

apply for a refund.

How Remedy Component Differs NR

from Recalled Component :

Identify How/When Recall Condition NR

was Corrected in Production:

Recall Schedule:

Description of Recall Schedule: NR

Planned Dealer Notification Date : JUL 14, 2015 - JUL 14, 2015 Planned Owner Notification Date : JUL 17, 2015 - JUL 21, 2015

* NR - Not Reported