

**Part 573 Safety Recall Report****15V-360****Manufacturer Name :** Kia Motors America**Submission Date :** JUL 01,2015**NHTSA Recall No. :** 15V-360**Manufacturer Recall No. :** SC121**Manufacturer Information :**

Manufacturer Name : Kia Motors America

Address : 111 Peters Canyon Road  
Irvine CA 92606

Company phone : (949)468-4800

**Population :**

Number of potentially involved : 7,722

Estimated percentage with defect : 100

**Vehicle Information :**

Vehicle : 2011-2011 Kia Sportage

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : GAS

Descriptive Information : 2011 MY Sportage Stop Lamp Switch

Production Dates : MAR 07, 2011 - JUN 08, 2011

**VIN (Vehicle Identification Number) Range**

Begin : NR

End : NR

 Not sequential VINs**Description of Defect :**

Description of the Defect : The stop lamp switch may experience interruption in the electrical flow in the switch contact. This condition could potentially result in intermittent operation of the cruise control feature, the intermittent illumination of the ESC indicator lamp or interfere with the brake light illumination.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Intermittent operation of the switch increases the risk of a crash.

Description of the Cause : N/A

Identification of Any Warning that can Occur : N/A

**Supplier Identification :****Component Manufacturer**

Name : INFAC CO, LTD.

Address : 613 Bon Ri, Daesowon Myun

Chungju, Si Chungbuk FOREIGN STATES 380-371

Country : Korea, Republic of

**Chronology :**

See attached document titled "2011 MY Sportage Stop Lamp Switch Chronology"

**Description of Remedy :**

Description of Remedy Program : All owners of the subject vehicles will be notified by first class mail with instructions to bring their vehicles to a Kia dealer. Kia will instruct dealers to replace the switch with an improved part. Kia will reimburse owners for repair expenses already incurred pursuant to Kia's General Reimbursement Plan filed April 14, 2014.

How Remedy Component Differs from Recalled Component : The remedy component contains an increased contact plate angle change.

Identify How/When Recall Condition was Corrected in Production : The switch was further developed from the 2011 switch in the course of normal production changes for the 2012 MY Sportage.

**Recall Schedule :**

Description of Recall Schedule : NR

Planned Dealer Notification Date : JUL 06, 2015 - JUL 06, 2015

Planned Owner Notification Date : JUL 09, 2015 - JUL 09, 2015

\* NR - Not Reported