

Part 573 Safety Recall Report**15V-362****Manufacturer Name :** Silver Eagle Manufacturing Company**Submission Date :** MAY 04, 2016**NHTSA Recall No. :** 15V-362**Manufacturer Recall No. :** Recall No.: 15E021**Manufacturer Information :**

Manufacturer Name : Silver Eagle Manufacturing Company

Address : 5825 NE Skyport Way
Portland OR 97218-1249

Company phone : 800-547-6792

Population :

Number of potentially involved : 20

Estimated percentage with defect : 100

Vehicle Information :

Vehicle : 2014-2015 Silver Eagle VAST20N VAST20W CTL40W

Vehicle Type : TRAILERS

Body Style : OTHER

Power Train : NR

Descriptive Information : Possible defect of Bendix TR-3 Inversion valve

Production Dates : FEB 06, 2014 - MAR 04, 2015

VIN (Vehicle Identification Number) RangeBegin : 1U3JV8213EBJ19479 End : 1U3JV8216EBJ19489 ☐ Not sequential VINsBegin : 1U3JX921XFBM19522 End : 1U3JX9213FBM19569 ☐ Not sequential VINsBegin : 1U3JP8725FBJ01349 End : 1U3JP8721FBJ01350 ☐ Not sequential VINs**Description of Defect :**

Description of the Defect : Bendix has determined that a component manufactured at a Bendix sub-supplier was not within specification limits and has led to the potential defect. This issue potentially affects a very select population of vehicles that do not have spring brakes and where the TR-3 valve is used to apply the service brake as a parking brake (primarily in dolly applications).

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : The out-of-specification component may cause the TR-3 valve to exhaust slowly, or not fully exhaust, leading to the potential overheating of vehicle brakes and potential fire.

Description of the Cause : NR

Identification of Any Warning that can Occur : The driver may detect partially applied service brakes while

driving by feeling an increased resistance in the vehicle drivetrain or sensing an odor caused by overheated brakes.

Supplier Identification :**Component Manufacturer**

Name : Bendix Commerical Vehicle Systems LLC

Address : 16416 NE 26th Avenue
Ridgefield WASHINGTON 98642

Country : United States

Chronology :

Silver Eagle was informed of the suspect TR-3 valve (by Bendix) on March 4, 2015. Going forward we segregated the parts, we had in inventory and determined which customers were affected.

May 13, 2015 Silver Eagle was officially notified by Bendix of recall with instructions and their official bulletin.

June 3, 2015 Silver Eagle submitted recall notice to NHTSA.

June 19, 2105 Email from NHTSA that the portal analysts are backload and we will should receive approval soon with our campaign number.

June 30 NHTSA sent acknowledge letter for the recall.

Letters sent out to customers July 8 & 9th, 2015.

Replacement parts sent to all customers July 22 & 23, 2015.

Description of Remedy :

Description of Remedy Program : Replace the existing TR-3 Valve with a Sliver Eagle Part Number 34192 recall kit (Bendix Part Number K123677)

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : NR

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : JUN 10, 2015 - JUN 15, 2015

* NR - Not Reported