

**Part 573 Safety Recall Report****15V-444****Manufacturer Name :** Chrysler (FCA US LLC)**Submission Date :** NOV 24,2015**NHTSA Recall No. :** 15V-444**Manufacturer Recall No. :** R37**Manufacturer Information :**

Manufacturer Name : Chrysler (FCA US LLC)  
 Address : 800 Chrysler Drive  
 CIMS 482-00-91 Auburn Hills MI 48326-2757  
 Company phone : 1-800-853-1403

**Population :**

Number of potentially involved : 88,346  
 Estimated percentage with defect : 1

**Vehicle Information :**

Vehicle : 2008-2010 Dodge Challenger

Vehicle Type :

Body Style : 2-DOOR

Power Train : NR

Descriptive Information : The 2008 - 2010 Dodge Challenger ("LC") vehicles being recalled are those equipped with Takata PSDI-4 front driver airbag inflators.

Production Dates : SEP 19, 2007 - OCT 29, 2010

**VIN (Vehicle Identification Number) Range**

Begin : NR

End : NR

 Not sequential VINs**Description of Defect :**

Description of the Defect : On May 18, 2015, Takata submitted a 573 Safety Defect Information Report to NHTSA, "Takata has determined that a defect related to motor vehicle safety may arise in some of the subject inflators. The batwing-shaped propellant wafers in some of the subject inflators may experience an alteration over time, which could potentially lead to over-aggressive combustion in the event of an air bag deployment. Depending on the circumstances, this potential condition could create excessive internal pressure when the air bag is deployed, which could result in the body of the inflator rupturing upon deployment."

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Per Takata's May 18, 2015 573 Safety Defect Information Report (15E-040), "in the event of an inflator rupture, metal fragments could pass through the air bag cushion material, which may result in injury or death to vehicle occupants."

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

**Supplier Identification :****Component Manufacturer**

Name : Takata Corporation

Address : 2500 Takata Drive

Auburn Hills MICHIGAN 48326

Country : United States

**Chronology :**

Please see the attached supplemental information titled "FCA US LLC Chronology - 2008-2010 LC Takata PSDI-4 - 07102015.pdf"

**Description of Remedy :**

Description of Remedy Program : FCA US LLC ("FCA US") will conduct a voluntary safety recall on all affected vehicles to replace the front driver airbag inflator.

FCA US has a longstanding policy and practice of reimbursing owners who have incurred the cost of repairing a problem that subsequently becomes the subject of a field action. To ensure consistency, FCA US, as part of the owner letter, will request that customers send the original receipt and/or other adequate proof of payment to the company for confirmation of the expense.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

**Recall Schedule :**

Description of Recall Schedule : Planned Dealer Notification Date (VINs live): 7/27/2015

Planned Interim Owner Letter Notification Begin Date: 8/14/2015

Planned Interim Owner Letter Notification End Date: 8/21/2015

\*\*\*\*11-24-2015

Planned Dealer Notification Date (Repair): 11/11/2015

Planned Final Owner Letter Notification Begin Date: 11/17/2015

Planned Final Owner Letter Notification End Date: 11/20/2015

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : NR - NR

\* NR - Not Reported