OMB Control No.: 2127-0004

# Part 573 Safety Recall Report

15V-476

Manufacturer Name : Ford Motor Company Submission Date : AUG 21,2015 NHTSA Recall No. : 15V-476 Manufacturer Recall No. : 15C08

Manufacturer Name : Ford Motor Company

Suite 500 Dearborn MI 48126-2738



# **Population** :

Number of potentially involved : 265 Estimated percentage with defect : 0

# Vehicle Information :

**Manufacturer Information :** 

Address : 330 Town Center Drive

Company phone : 1-866-436-7332

Vehicle : 2015-2015 Lincoln MKT Town Car Vehicle Type : LIGHT VEHICLES Body Style : Power Train : NR Descriptive Information : Affected MKT Town Car vehicles ordered with the Livery package (MKT Livery) are missing the second row seat. A subset of the affected vehicle population is also missing the optional full-size spare tire.

These vehicles are not produced in VIN order. Information as to the applicability of this action to specific vehicles can best be obtained by either calling Ford's toll-free line (1-866-436-7332) or by contacting a local Ford or Lincoln dealer who can obtain specific information regarding the vehicles from the Ford On-line Automotive Service Information System (OASIS) database.

Production Dates : FEB 04, 2015 - JUN 23, 2015

### VIN (Vehicle Identification Number) Range

Begin : NR	End : NR	Not sequential VINs
Description of Noncomplia	ince :	
Description of the Noncom	pliance : Certain 2015 Lincoln MKT Livery veh	icles were delivered prior to
	installation of the required second row	w seat. The vehicles, as delivered,
	have two designated seating positions	s in the front row. Section 4.3(b) of
	FMVSS 110 requires the designated se	eating capacity to be listed on the
	placard. The placard installed on thes	se vehicles lists the designated
	seating capacity as five; two in front, t	hree in rear.

On vehicles where the second row seat is not installed, section 4.2(c) of

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report 15V-476 Page 2 FMVSS 225 requires a tether anchorage at the front passenger seating position. These vehicles were designed and intended to have a second row seat; therefore, the front passenger seating position is not equipped with a tether anchorage. Ford is not aware of any reports of accident or injury related to these conditions. FMVSS 1:110 - Tire selection and rims FMVSS 2:225 - Child restraint anchorage systems Description of the Safety Risk : As built, these vehicles may not comply with FMVSS 110 and FMVSS 225. The affected vehicles are at being held at dealers or fleet locations awaiting the required components or in-transit to their final destination. Description of the Cause : NR Identification of Any Warning that can Occur : NR

### **Supplier Identification :**

**Component Manufacturer** Name : NR Address : NR NR Country : NR

# Chronology :

On July 14, 2015, Ford's Critical Concern Review Group (CCRG) was informed that vehicles were shipped without the second row seat. The CCRG reviewed the possible compliance aspects of the missing second row seat and elevated the concern.

On July 21, 2015, Ford's Field Review Committee reviewed the concern and approved a field action.

The week of August 3, 2015, a Ford dealer notified Ford that vehicles had been received without the second row seat and that those vehicles were not included in 15C08.

Ford conducted an extensive review of all 2015 model year MKT Livery vehicle production records to assess if any other vehicles needed to be included in the original 15C08 program. This review identified that additional vehicles may have been shipped to dealers or fleets without the second row seat.

On August 17, 2015, Ford's Field Review Committee reviewed the concern and approved an expansion of the population for the previously approved field action (15C08).

# **Description of Remedy :**

Description of Remedy Program : The vehicles will be inspected for the presence of a rear seat and, if one has

The information contained in this report was submitted pursuant to 49 CFR §573

	Report	15V-476	Pag
	not been installed, servi	ce technicians will install the rear seat.	
	identified and are at dea	nd owner letters because all the vehicles h ler or fleet locations or in-transit. Ford w leet representatives by phone to notify the dy instructions.	rill
		ursement for costs because the original wa for a free repair for this concern.	arranty
<b>й</b> 1	Differs from Recalled Componer Condition was Corrected in Pro		
Identify How/When Recall Recall Schedule :	dule : Notification to dealers is e expect to send owner lette locations. Ford will proac notify them of the recall an		r fleet phone to up dealer
Identify How/When Recall Recall Schedule : Description of Recall Sched	dule : Notification to dealers is e expect to send owner lette locations. Ford will proac notify them of the recall an notification is expected to	expected to occur on July 28, 2015. Ford deers because all vehicles are at the dealer of tively contact the fleet representatives by nd provide remedy instructions. A follow-occur on August 24, 2015, advising of the	r fleet phone to up dealer

\* NR - Not Reported