

**Part 573 Safety Recall Report****15V-491**

**Manufacturer Name :** DRV Suites  
**Submission Date :** AUG 18,2015  
**NHTSA Recall No. :** 15V-491  
**Manufacturer Recall No. :** NR

**Manufacturer Information :**

Manufacturer Name : DRV Suites  
 Address : 1000 Interchange Drive  
 PO Box 235 Howe IN 46746  
 Company phone : 574-457-6472

**Population :**

Number of potentially involved : 7,465  
 Estimated percentage with defect : 100

**Vehicle Information :**

Vehicle : 2003-2016 DRV Mobile suites

Vehicle Type : TRAILERS

Body Style :

Power Train : NR

Descriptive Information : the range and product involved is not yet determined.

Production Dates : APR 22, 2003 - JUL 22, 2015

**VIN (Vehicle Identification Number) Range**

Begin : NR

End : NR

Not sequential VINs

Vehicle : 2014-2015 Traditions all

Vehicle Type : TRAILERS

Body Style :

Power Train : NR

Descriptive Information : Fifth Wheel

Production Dates : APR 01, 2013 - JUL 24, 2015

**VIN (Vehicle Identification Number) Range**

Begin : NR

End : NR

Not sequential VINs

Vehicle : 2013-2016 Estates All

Vehicle Type : TRAILERS

Body Style :

Power Train : NR

Descriptive Information : Fifth Wheel

Production Dates : APR 01, 2012 - JUL 24, 2015

**VIN (Vehicle Identification Number) Range**

Begin : NR

End : NR

 Not sequential VINs

Vehicle : 2006-2016 Elite Suites All

Vehicle Type : TRAILERS

Body Style :

Power Train : NR

Descriptive Information : Fifth Wheel

Production Dates : APR 01, 2005 - JUL 24, 2015

**VIN (Vehicle Identification Number) Range**

Begin : NR

End : NR

 Not sequential VINs

Vehicle : 2014-2016 Full House ALL

Vehicle Type : TRAILERS

Body Style :

Power Train : NR

Descriptive Information : Fifth Wheel

Production Dates : APR 01, 2013 - JUL 24, 2015

**VIN (Vehicle Identification Number) Range**

Begin : NR

End : NR

 Not sequential VINs**Description of Noncompliance :**

Description of the Noncompliance : The front side reflex reflector is located above the maximum height of 60" as required by FMVSS 108. The front side reflex reflector is located approximately 8" to 10" above the maximum height requirement of 60". The front side reflex reflector and front side marker light are contained in one light assembly used by DRV. The front side marker light location complies with the FMVSS 108 location requirement.

FMVSS 1 : 108 - Lamps, reflective devices, and assoc. Equipment

FMVSS 2 : NR

Description of the Safety Risk : The safety risk for this non-compliance is minimal. The reflector is present but located approximately 8" to 10" above the required maximum.

Description of the Cause : DRV only builds 5th wheel trailers, which have a forward raised portion that goes up and over the vehicle that is towing it. Over the course of time, the bed height of pickup trucks have risen resulting the forward portion floor to be raised to accommodate these tow vehicles. Accordingly, the combination front side marker light and reflex reflector was moved up with the new floor heights. While the light remained in compliance, the reflector was inadvertently moved above the maximum height.

Identification of Any Warning that can Occur : None

**Supplier Identification :**

**Component Manufacturer**

Name : NR

Address : NR

NR

Country : NR

**Chronology :**

The non-compliance was discovered during a Thor Industries compliance audit on July 22, 2015.

**Description of Remedy :**

Description of Remedy Program : NR

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

**Recall Schedule :**

Description of Recall Schedule : NR

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : NR - NR

\* NR - Not Reported