

Part 573 Safety Recall Report**15V-564****Manufacturer Name :** Daimler Trucks North America LLC**Submission Date :** SEP 03,2015**NHTSA Recall No. :** 15V-564**Manufacturer Recall No. :** FL-686**Manufacturer Information :**

Manufacturer Name : Daimler Trucks North America LLC

Address : 4747 N. Channel Avenue
Portland OR 97217-3849

Company phone : 800-745-8000

Population :

Number of potentially involved : 52

Estimated percentage with defect : 7

Vehicle Information :Vehicle : 2006-2015 Thomas Built Buses Saf-T-Liner HDX Non-School Bus, Saf-T-Liner EF Non-School Bus,
Saf-T-Liner EFX Non-School Bus, Minotour DRW Non-School Bus

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Thomas Built Buses equipped with certain Ricon S Series lifts built within the
suspect population date range. Please see DTNA's previous recall 14V-478.

Production Dates : JAN 03, 2006 - AUG 01, 2014

VIN (Vehicle Identification Number) Range

Begin : NR

End : NR

☐ Not sequential VINs**Description of Defect :**Description of the Defect : Please see Ricon Defect Information Report for 15E-068 supplied to DTNA by Ricon
on 8/20/2015 which states "The holes in the folding link arms (PN 30863) have
been manufactured oversized periodically."

FMVSS 1 :NR

FMVSS 2 :NR

Description of the Safety Risk : Please see Ricon Defect Information Report for 15E-068 supplied to DTNA by
Ricon on 8/20/2015 which states "With the holes in the link arms in an
oversized condition and left unchecked the bearings can move out of position.
This in turn allows a substantial amount of free play in a stowed platform. This
free play allows for an increased load being applied to the platform mounting
and can cause it to fail."

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

Supplier Identification :**Component Manufacturer**

Name : Ricon Corporation

Address : 1135 Aviation Place

San Fernando CALIFORNIA 91340

Country : United States

Chronology :

March 2015 First Student in Baltimore, MD reports three failures that occurred after previous recall. See DTNA recall # FL663. Ricon initiates an investigation with updates on progress to DTNA.

August 2015 Ricon informs DTNA of its 573 filing.

Description of Remedy :

Description of Remedy Program : Please see Ricon Defect Information Report for 15E-068 supplied to DTNA by Ricon on 8/20/2015 which states "The remedy program is to inspect for damaged or bearings moved out of position. If the condition exists, replacement link arms will be supplied at no cost."

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : NR

Planned Dealer Notification Date : NOV 02, 2015 - NOV 02, 2015

Planned Owner Notification Date : NOV 02, 2015 - NOV 02, 2015

* NR - Not Reported