

Part 573 Safety Recall Report**15V-566****Manufacturer Name :** Hyundai Motor America**Submission Date :** SEP 04,2015**NHTSA Recall No. :** 15V-566**Manufacturer Recall No. :** 131**Manufacturer Information :**

Manufacturer Name : Hyundai Motor America

Address : 10550 Talbert Avenue

Fountain Valley CA 92708

Company phone : 1-855-671-3059

Population :

Number of potentially involved : 99,500

Estimated percentage with defect : 5

Vehicle Information :

Vehicle : 2009-2011 Hyundai Accent

Vehicle Type : LIGHT VEHICLES

Body Style :

Power Train : GAS

Descriptive Information : Certain Model Year 2009 through 2011 Hyundai Accent vehicles produced beginning on March 01, 2009 through February 11, 2011.

Production Dates : MAR 01, 2009 - FEB 11, 2011

VIN (Vehicle Identification Number) Range

Begin : NR

End : NR

 Not sequential VINs**Description of Defect :**

Description of the Defect : The stop lamp switch on vehicles in the subject recall population may experience intermittent switch point contact when the brake pedal is depressed. This condition could potentially result in an inability to remove the vehicle's shifter from the Park position while the vehicle is stationary, limited ability to cancel the cruise control feature (if equipped) using the brake pedal, or intermittent operation of the stop lamps.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Intermittent operation of the stop lamps could affect the driver's ability to notify other drivers of braking intention, increasing the risk of a crash.

Description of the Cause : NR

Identification of Any Warning that can Occur : Inability to remove the vehicle's shifter from the Park position

Supplier Identification :**Component Manufacturer**

Name : INFAC CO., LTD.

Address : 613, Bon Ri, Daesowon Myun
Chungju Si, Chungbuk, FOREIGN STATES 380-871

Country : Korea, Republic of

Chronology :

In March 2013, Hyundai initiated a safety recall (13V-113) to replace the stop lamp switch with revised service parts in Hyundai "MC" platform Accent vehicles manufactured between December 01, 2006 and February 28, 2009. In that safety recall notice, Hyundai reported a product revision related to a revised switch contact material and surface finish which was applied in February, 2009. At that time of filing, there had been a corresponding reduction in field claims after the product revision date. In June 2015, NHTSA notified Hyundai of a small number of customer complaints it received on Hyundai Accent vehicles outside of the original recall population. Hyundai analyzed the warranty claims and other field information and found that although the number of stop lamp switch claims on vehicles produced after February 28, 2009 was lower than the vehicles involved in the original recall, there continued to be reports of stop lamp switch replacements. On September 2, 2015, this information was reviewed by HMA's Technical Committee, and it was decided to expand the original recall population to include the remaining "MC" Accent vehicles produced beginning on March 01, 2009 through February 11, 2011. There are no reports of accidents or injuries attributed to this condition.

Description of Remedy :

Description of Remedy Program : Hyundai Motor America will notify owners of affected vehicles to return their vehicles to their Hyundai dealers to replace the stop lamp switch assembly with a revised service part.

Hyundai will provide reimbursement to owners for repairs according to the plan submitted on November 2, 2014.

How Remedy Component Differs from Recalled Component : A relay was incorporated into the revised stop lamp switch circuit.

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : NR

Planned Dealer Notification Date : NOV 02, 2015 - NOV 02, 2015

Planned Owner Notification Date : NOV 02, 2015 - NOV 02, 2015

* NR - Not Reported