

Part 573 Safety Recall Report**15V-570****Manufacturer Name :** Triple E Recreational Vehicles**Submission Date :** SEP 10,2015**NHTSA Recall No. :** 15V-570**Manufacturer Recall No. :** CA#8132-1**Manufacturer Information :**

Manufacturer Name : Triple E Recreational Vehicles

Address : PO Box 1230 Winkler MB

Canada 00 R6W 4C4

Company phone : 204-325-4361

Population :

Number of potentially involved : 350

Estimated percentage with defect : 100

Vehicle Alterer Information :

Vehicle : 2015-2016 UNITY U24MB / U24CB / U24IB / U24TB

Descriptive Information : The battery compartment located under the entrance step is not sealed at the interior floor flange to prevent battery gasses from entering motorhome.

Production Dates : SEP 02, 2014 - SEP 09, 2015

Description of Noncompliance :

Description of the Noncompliance : The battery compartment is not sealed to the interior of the motorhome. The top angle iron used as a stop for the coach battery compartment there was no sealant put between the angle iron and the motorhome floor.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Gasses from the battery may enter the motorhome causing an eventual life threatening situation.

Description of the Cause : Missing a caulking seal

Identification of Any Warning that can Occur : NR

Supplier Identification :**Component Manufacturer**

Name : NR

Address : NR

NR

Country : NR

Chronology :

An in-house inspection of quality control was performed and the defect was found.

Description of Remedy :

Description of Remedy Program : The battery compartment will be sealed with a caulking bead to prevent gasses from entering the motorhome. The procedure will be to remove the top gasket for the battery compartment and seal the metal flange to the bottom of the floor by running a single bead of sealant along the entire length of the battery compartment. Reinstalling a new section of gasket to the flange flush with the bottom of the floor.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : A caulking bead is laid down on top of the frame prior to installing the floor to seal the battery box, this procedure commenced on Sept. 3/2015 in production.

Recall Schedule :

Description of Recall Schedule : NR

Planned Dealer Notification Date : SEP 14, 2015 - SEP 21, 2015

Planned Owner Notification Date : SEP 17, 2015 - SEP 22, 2015

Purchaser Information :

The following manufacturers purchased this defective/noncompliant equipment for possible use or installation in new motor vehicles or new items of motor vehicle equipment:

Name :

Address :

Country :

Company Phone :

* NR - Not Reported