

Part 573 Safety Recall Report**15V-600****Manufacturer Name :** Jaguar Land Rover North America, LLC**Submission Date :** SEP 24,2015**NHTSA Recall No. :** 15V-600**Manufacturer Recall No. :** P072**Manufacturer Information :**

Manufacturer Name : Jaguar Land Rover North America, LLC

Address : 555 MACARTHUR BOLULEVARD

MAHWAH NJ 07430

Company phone : 201-760-8534

Population :

Number of potentially involved : 856

Estimated percentage with defect : 100

Vehicle Information :

Vehicle : 2015-2015 Land Rover Range Rover

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : GAS

Descriptive Information : 2015 Land Rover Range Rover in selected VIN Range.

Production Dates : JUN 02, 2015 - JUN 11, 2015

VIN (Vehicle Identification Number) Range

Begin : SALGS2VF7FA239784

End : SALGS2VF3FA241015

 Not sequential VINs

Vehicle : 2015-2015 Land Rover Range Rover Sport

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : GAS

Descriptive Information : 2015 Land Rover Range Rover Sport in selected VIN Ranges.

Production Dates : JUN 02, 2015 - JUN 11, 2015

VIN (Vehicle Identification Number) Range

Begin : SALWR2VFXFA538466

End : SALWR2VF6FA539727

 Not sequential VINs

Begin : SALWR2VF5FA628110

End : SALWR2VF8FA628957

 Not sequential VINs**Description of Defect :**

Description of the Defect : Jaguar Land Rover has identified a concern with certain 2015 Model Year (MY) Range Rover and Range Rover Sport vehicles installed with the manual recline second row seat system where the second row seat backrest may not latch robustly in position.

FMVSS 1 :NR

FMVSS 2 :NR

Description of the Safety Risk : It is possible the visual indication of correct latch (the operating lever) condition is false and misleading and as such, especially in the center second row seated position, the seat belt may not correctly restrain the occupant during a crash which increases the risk of injury.

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

Supplier Identification :**Component Manufacturer**

Name : Brose Ltd

Address : Colliery Lane

Exhall, Coventry FOREIGN STATES CV7 9NW

Country : United Kingdom

Chronology :

On June 15, 2015 Jaguar Land Rover's Critical Concerns Review Group (CCRG) reviewed a stop shipment notification from the Solihull assembly plant regarding Second Row Seat Back Rest Recline Functions. A CCRG investigation was opened to review this concern on June 22, 2015.

Jaguar Land Rover Engineering and the component supplier investigation was conducted to understand the nature of the error state along with the scope of the issue. This investigation was reviewed at the CCRG during July 2015.

Further investigations identified the supplier had inadvertently initiated an early introduction of a new design level seat recliner mechanism for 2015MY Range Rover and Range Rover Sport vehicles. It was also identified the control of the introduction new level seat recliner build process was not robust.

Field inspection of vehicles was conducted during July and August 2015 to determine the scope of this issue. It concluded that the revised design condition part was introduced earlier than originally stated.

On August 25, 2015 Jaguar Land Rover's Critical Concerns Review Group (CCRG) reviewed this concern and concluded the issue be progressed to the Jaguar Land Rover Senior Review Panel (SRP).

The SRP reviewed all information on September 17, 2015 and concluded the concern represented an unreasonable risk to safety and that a voluntarily safety recall be conducted.

There have been no reported accidents, injuries or fires as a result of this concern.

Description of Remedy :

Description of Remedy Program : Owners will be notified and instructed to take their vehicle to a Land Rover dealer who will inspect the second row seat mechanism. If required, the

dealer will fit the correct specification components.

There will be no charge to owners for this repair.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : Dealer Notification Tuesday September 29
Customer letter November 13

Planned Dealer Notification Date : SEP 29, 2015 - SEP 29, 2015

Planned Owner Notification Date : NOV 13, 2015 - NOV 13, 2015

* NR - Not Reported