

**Part 573 Safety Recall Report****15V-862****Manufacturer Name :** Motor Coach Industries**Submission Date :** DEC 21, 2015**NHTSA Recall No. :** 15V-862**Manufacturer Recall No. :** SB 430**Manufacturer Information :**

Manufacturer Name : Motor Coach Industries

Address : 200 East Oakton Street

Des Plaines IL 60018

Company phone : 847-285-2085

**Population :**

Number of potentially involved : 9

Estimated percentage with defect : 100

**Vehicle Information :**

Vehicle : 2016-2016 MCI J4500

Vehicle Type : BUSES, MEDIUM &amp; HEAVY VEHICLES

Body Style : OTHER

Power Train : DIESEL

Descriptive Information : CERTAIN 2016 MCI J4500 MOTOR COACHES EQUIPPED WITH KIEL PASSENGER SEATS

Production Dates : AUG 26, 2015 - DEC 03, 2015

**VIN (Vehicle Identification Number) Range**

Begin : NR

End : NR

 Not sequential VINs**Description of Defect :**

Description of the Defect : The single pedestal seats are mounted to the vehicle seat mounting floor track using four (4) T-Bolts. One (1) of the T-bolts was installed in the incorrect position.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : In the event of a significant collision or a severe deceleration of the vehicle, the seat attachment to the vehicle may fail and cause potential injury to passengers.

Description of the Cause : Installation of a bolt in the incorrect position.

Identification of Any Warning that can Occur : None

**Supplier Identification :****Component Manufacturer**

Name : NR

Address : NR

NR

Country : NR

**Chronology :**

MCI discovered the incorrect bolt installation during an in-process inspection at MCI's factory on December 9, 2015. MCI corrected the vehicles in the plant as of December 9, 2015, and provided corrective instructions to assembly employees.

**Description of Remedy :**

Description of Remedy Program : MCI will provide the hardware and instructions necessary to correct the bolt installation in the affected vehicles, and reimburse labor costs.

How Remedy Component Differs from Recalled Component : The mounting hardware is installed in the correct location.

Identify How/When Recall Condition was Corrected in Production : MCI corrected the incorrect installation at the factory on December 9, 2015.

**Recall Schedule :**

Description of Recall Schedule : MCI will mail notifications within one week of NHTSA approval.

Planned Dealer Notification Date : DEC 30, 2015 - DEC 30, 2015

Planned Owner Notification Date : DEC 30, 2015 - DEC 30, 2015

\* NR - Not Reported