



NOTIFICATION OF NON-COMPLIANCE RECALL  
J049 [NHTSA# 15V-038]: PARKING LIGHT  
ILLUMINATION

SERVICE  
BULLETIN

29-JAN-15 | NO.: 7-094USA | SECTION: RECALL | MARKET: USA

***Jaguar Land Rover North America, LLC has informed the National Highway Traffic Safety Administration (NHTSA) of its intent to perform a Non-Compliance Recall on certain 2012-2015 model year Jaguar XK vehicles imported into the United States market. Information relating to the Recall will be posted on the National Highway Traffic Safety Administration website.***

***United States Federal regulations require that retailers must be advised of this Recall notification within three working days after government notification.***

***United States Federal law requires retailers to complete any outstanding safety Recall service before a new vehicle is delivered to the buyer or lessee. Violation of this requirement by a retailer could result in a civil penalty of up to \$7,000.00 per vehicle.***

***This Recall Service Bulletin serves as notification to all Jaguar retailers in the United States and Puerto Rico that any affected new vehicles may not be sold and delivered for customer use until the Recall repair is completed.***

#### AFFECTED VEHICLES

A total of 4,787 vehicles are affected.

The VIN range of affected vehicles is SAJWA4GB2CLB43352-SAJWA4GB1FLB56792 (select vehicles within this VIN range).

#### DESCRIPTION

A non-compliance issue has been identified on a limited number of 2012-2015 model year Jaguar XK (X150) vehicles where the front side lights, when used as parking lamps, will extinguish in error after approximately five (5) minutes.

Where the side lights are switched on with the ignition off, the front lights should remain illuminated (until the battery is exhausted). On these vehicles, the front side lights when operated in this manner will only remain on until the Central Junction Box (CJB) enters sleep mode. They will then turn off.

#### EFFECT ON VEHICLE OPERATION

Vehicles in this condition will not comply with the requirements of the Federal Motor Vehicle Safety Standard (FMVSS) 108 - Lamps, Reflective Devices, and Associated Equipment. Non-functioning parking lamps may increase the risk of a vehicle being involved in a crash.

#### SERVICE PROGRAM / REWORK ACTION

Owners will be notified by mail and instructed to take their vehicle to a Jaguar retailer who will update the vehicle's Central Junction Box (CJB) to the latest software.

There will be no charge to owners for this action.

#### OWNER NOTIFICATION

Owner notification is expected to occur on or before 13 March 2015.

#### ACTION TO BE TAKEN

Retailers are required to check DDW to ensure that the vehicle is affected by Program Code 'J049' and to **HOLD** only affected vehicles in the above VIN range that are in your control and withhold them from onward distribution pending completion of the rework action.

Sold vehicles will be subject to the standard Recall notification and Recall bulletin process detailing the action required for vehicles in the hands of owners.

**Retailers are advised that the use of vehicles within the affected model year / VIN range as Sales Demonstrator or Service Loaner vehicles may be considered a violation of Federal legislation. Jaguar Land Rover North America, LLC recommends against using affected vehicles for demonstrator or loaner purposes. Please consult your own legal counsel if you have questions in this regard.**

Thank you for your cooperation in this matter. Jaguar Land Rover North America apologizes for any inconvenience this may cause.

