

GM CUSTOMER CARE AND AFTERSALES
DCS3783
URGENT - DISTRIBUTE IMMEDIATELY

Date: September 23, 2015

Subject: Upcoming Safety Recall – 15700
Driver Door Switch Short Circuit

Models: 2006–2007 Buick Rainier
2006–2007 Chevrolet Trailblazer
2006 Chevrolet Trailblazer EXT
2006–2007 GMC Envoy
2006 GMC Envoy XL

To: All Buick, Chevrolet and GMC Dealers

Attention: General Manager, Service Advisor, Service Manager, Parts and
Service Director, Parts Manager, and Used Vehicle Manager

General Motors has notified the National Highway Traffic Safety Administration (NHTSA) about an upcoming safety recall that involves certain 2006 model year Chevrolet Trailblazer EXT and GMC Envoy XL vehicles and 2006-2007 model year Buick Rainier, Chevrolet Trailblazer, and GMC Envoy vehicles. The GM recall number is 15700.

These vehicles were mistakenly excluded from safety recall 14309 and may continue to have a condition in which the printed circuit board inside the driver's door module may be susceptible to corrosion from certain external corrosive fluids (e.g., melted snow containing road salt), which could cause a short in the module's circuit board. A short in the circuit board of the driver door module may cause the power door locks and power window switches to function intermittently or stop working. A short may also cause the windows to raise or lower themselves without user input. In addition, a short may cause overheating, which could melt components of the door module, producing odor, smoke, or a fire. These conditions may occur even with the vehicle parked and the key removed. Customers should park the vehicle outdoors until this condition has been remedied.

To correct this condition, dealers are to inspect the part number of the driver's door switch module and, if necessary, install a new module.

This is a courtesy notification to dealers. Dealers will be advised when the recall bulletin is scheduled for release. Dealers should not attempt to perform any repairs until the bulletin is released.

The Investigate Vehicle History screen in the Global Warranty Management system will be updated in the near future for this upcoming safety recall.

END OF MESSAGE
GM CUSTOMER CARE AND AFTERSALES