



1115P

Supplier

Peterbilt

Description

65MPH Speed Rated Michelin MN295/60 R22.5 XZA-2 and XDA-2+Energy Tires

Release Date

1/8/2016

Introduction

Peterbilt has decided that a defect, which relates to motor vehicle safety, exists in certain model year 2009 through 2016 Peterbilt vehicles manufactured from January 19, 2008 through October 12, 2015 and built with Michelin XZA2 295/60/R22.5 front tires in auto hauler applications. Trucks with these front tires and a GAWR rated greater than 14,300lbs may have had the vehicle speed programmed greater than 65mph (104kph). Also, trucks with these front tires and a GAWR rated less than 14,300lbs may have had the vehicle speed programmed greater than 75mph (120kph). Due to the tendency for trucks in the auto hauler application to maximize the front axle load, both of these conditions could cause the tires to become overloaded in certain operating conditions, which can lead to premature tire failure.

An overloaded and/or over sped tire may fail prematurely if not properly maintained which may increase the possibility of a crash.

Resolution

A Peterbilt dealer will reprogram the engine's vehicle speed parameters to limit the maximum vehicle speed to the tire speed rating

It is a violation of Federal law for a dealer to sell or lease new vehicles covered by this recall until the defect or noncompliance has been corrected.

Warranty

The SIR system will indicate chassis involved in this field repair with the designator for "**1115P**". If the vehicle is affected and is shown to have an open campaign, please complete the work and file a quick claim "**1115P**". File a long form claim for extraordinary circumstances, a quick claim must be filed first.

For Field...	Enter...
Failure Location	045-021-800
Failure Type	705

Claim Type	C
Responsibility	05
Campaign Number	1115P
SRT 045-986	0.35 hours Labor

Parts

There are no parts for this recall.

Labor

Peterbilt will reimburse the dealer 0.35 hours labor to reprogram the engine vehicle speed to the maximum tire rating.

Procedure

Peterbilt dealers will reflash the ECM to the correct parameters for vehicle speed based upon the tire speed rating.

Please Note: The chassis list attached below has been updated with repair and programming information based upon *original factory installed equipment*.

Revisions

01/14/2016 – Updated Chassis list with programming information and added OEM note

Attachments

[1115P Chassis List](#)

[1115P Customer Letter](#)

Access to PACCAR's Enterprise Portal is provided as a benefit of doing business with PACCAR. All applications and content accessed through this system are confidential and proprietary and the property of PACCAR Inc and its suppliers, and must be kept strictly confidential pursuant to the contract licensing such access. Disclosure, publication, release or distribution of any material found on PACCAR systems to any person other than employees with a need to know such information is strictly prohibited. All activity on this system is monitored. If PACCAR suspects or discovers any unauthorized activity, access may be immediately terminated without prior notification. Violators may be subject to legal action.

© Copyright 2016 PACCAR Inc. All rights reserved. We welcome your [feedback](#) on this page. For technical questions or concerns about this page, please contact the [DealerNet Webmaster](#).