



Division of Independent Protection Co., Inc.
67819 State Road 15
New Paris, Indiana 46553 USA



Dallastown, PA 17313
480 East Locust Street
P.O. Box 70

717-246-2627
800-673-2446
FAX: 717-244-7088

IMPORTANT SAFETY RECALL

THIS NOTICE APPLIES TO YOUR VEHICLE:

August 19, 2015



VIN: 1GBJG31[REDACTED] Turtle Top Body No: 103625

RE: Turtle Top Vehicle Recall 15V-396
Trans/Air Manufacturing Equipment Recall 15V-213
Trans/Air's Recall Number is 15-001

Dear Turtle Top Vehicle Owner and Trans/Air Equipment Customer:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act. Turtle Top has decided that a defect which relates to motor vehicle safety exists in your Trans/Air Manufacturing air conditioning system installed in your vehicle.

! IMPORTANT !#

- Your air conditioning compressor mount kit's cable connection installation is being recalled
- Contact Trans/Air Manufacturing immediately

REASON FOR THIS RECALL: Trans/Air Manufacturing (Trans/Air) is recalling certain air conditioning compressor mount kit's with part numbers: 4012506-01 & 02, 4013126-01 & 02, 4013235-01 & 02, 4012909, 4013125, 4013222, and 717173 installed by Trans/Air personnel onto General Motors G3500-4500 cutaway chassis with 6.6L engines. Turtle Top has decided that a defect which relates to motor vehicle safety exists in certain model year 2006 through 2014 transit buses and MPV specialty vehicles, equipped with Trans/Air Manufacturing Corporation's air conditioning systems. Records indicate that you have operating one or more vehicles equipped with a compressor mount kit which may be affected.

An OEM cable from a power distribution terminal strip, that had to be removed for installation of the mount kit, could be improperly re-connected during add-on compressor installation. This cable may not properly re-connected on the terminal strip stud, located at the front of the engine compartment and could cause a poor connection, or a loose connection, causing heat or arcing, and lead to a possible ignition source which could result in a fire.

WHAT WILL BE DONE: Trans/Air is instituting a safety corrective action program and will inspect the cable-to-stud connection. If the cable is angled over the edge of the terminal strip, the self-locking nut will be loosened, the cable slightly rotated to a proper vertical position, and the nut securely re-tightened.

WHAT YOU SHOULD DO: Affected vehicle owners need to contact Trans/Air Manufacturing Corporation Warranty and Service Center at 1-800-673-2446 to inquire as to where the closest authorized Trans/Air Service Center is located to have this corrective action completed on your vehicle. You may also visit Trans/Air's website: www.transairmfg.com and click on the tab "Authorized Service Centers" to locate the closest service center to service your vehicle. The repair will be provided at no cost to you; the inspection and repair time is 10 minutes. If your vehicle has already had the remedy performed prior to this recall, Trans/Air will reimburse owners for pre-notification remedies.

Phone: 574 831-4340
Fax: 574 831-4349
E-mail: ttsp@turtletop.com
Website: www.turtletop.com



*Division of Independent Protection Co., Inc.
67819 State Road 15
New Paris, Indiana 46553 USA*

Federal regulations require that any vehicle lessor receiving this recall notice must forward a copy of this notice to the lessee within ten days.

If Trans/Air fails to repair or is unable to remedy this condition without charge or within reasonable time, you may submit a written complaint to the Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Avenue, SE.,

Washington, DC 20590, or call the toll-free Vehicle Hotline at 1-888-327-4236 (TTY: 1-800-424-9153); or go to <http://www.safercar.gov>.

The National Highway Traffic Safety Administration (NHTSA) has been informed of this recall notice and has assigned NHTSA campaign ID number 15V-396 to this campaign for Turtle Top and campaign number 15V-213 for Trans/Air. Trans/Air's recall campaign number is 15-001.

We regret any inconvenience which this action may cause you; however, Turtle Top and Trans/Air are concerned about you and your passengers' safety. Thank you for your attention to this important matter.

Sincerely,

Janet L. Kercher-Dudley
Turtle Top Standards Engineer

Phone: 574 831-4340
Fax: 574 831-4349
E-mail: ttsp@turtletop.com
Website: www.turtletop.com