



RECALL CAMPAIGN BULLETIN

Reference:

NTB15-003

Date:

January 15, 2015

VOLUNTARY SAFETY RECALL CAMPAIGN 2014 – 2015 ROGUE AND PATHFINDER FRONT HUB AND TORQUE MEMBER BOLT TORQUE

CAMPAIGN ID #: PC339

APPLIED VEHICLES: 2014 – 2015 Rogue (T32)
2014 – 2015 Pathfinder (R52)

Check Service COMM to confirm campaign eligibility.

INTRODUCTION

Nissan is conducting a Voluntary Safety Recall Campaign on certain specific Model Year 2014 – 2015 Rogue and Pathfinder vehicles to re-torque the front hub bolts, torque member bolts, and steering stopper bolts. This service will be performed at no charge for parts or labor.

IDENTIFICATION NUMBER

Nissan has assigned identification number PC339 to this campaign. This number must appear on all communications and documentation of any nature dealing with this campaign.

DEALER RESPONSIBILITY

It is the dealer's responsibility to check Service Comm for the campaign status on each vehicle falling within the range of this voluntary safety recall which for any reason enters the service department. This includes vehicles purchased from private parties or presented by transient (tourist) owners and vehicles in a dealer's inventory. **Federal law requires that new vehicles in dealer inventory which are the subject of a safety recall must be corrected prior to sale. Failure to do so can result in civil penalties by the National Highway Traffic Safety Administration.** While federal law applies only to new vehicles, Nissan strongly encourages dealers to correct any used vehicles in their inventory before they are retailed.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

1. Lift the vehicle.
2. Locate and torque the 4 hub bolts and 2 torque member bolts on each front wheel hub assembly (see Figure 1).

Hub bolts: Torque to 88.3 N·m (9.0 kg-m, **65 ft-lb**).

Torque member bolts:

Pathfinder - torque to 123 N·m (13.0 kg-m, **91 ft-lb**).

Rogue - torque to 165 N·m (17.0 kg-m, **122 ft-lb**).

NOTE: Make sure to perform the above torque procedure on BOTH (driver and passenger side) front hub assemblies.

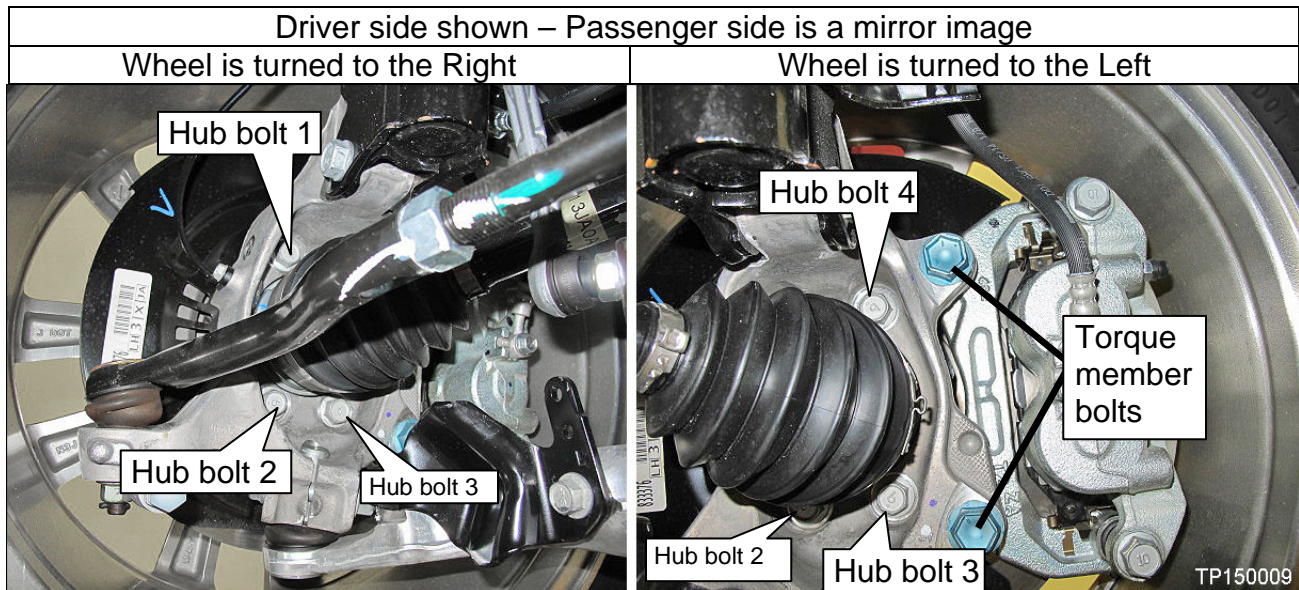


Figure 1

3. **For Pathfinder only:**

Torque the steering stopper bolts (both sides) to 63 N·m (6.4 kg-m, **46 ft-lb**).

NOTE:

- A 19 mm deep socket will fit over the stopper bolt cap.
- Make sure to perform the above torque procedure on BOTH (driver and passenger side).

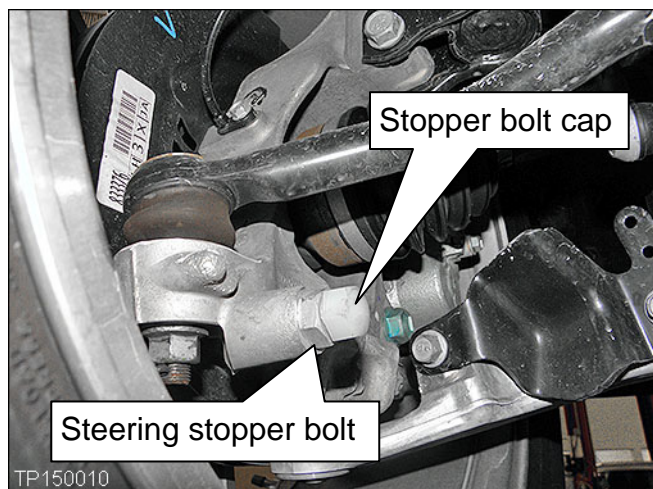


Figure 2

CLAIMS INFORMATION

Submit a Campaign (CM) line claim using the following claims coding:

CAMPAIGN (CM) ID #	DESCRIPTION	OP CODE	FRT
PC339	Torque Left and right front hub, torque member, and stopper bolt if equipped, replace bolt if missing	PC3390	0.4 hrs.

