IMPORTANT INFORMATION

Please inform and provide a copy of this document to every person in your dealership with campaign-related responsibilities, including Service, Parts and Accounting personnel. By law, dealers must correct, prior to delivery for sale or lease, any vehicle that fails to comply with an applicable Federal Motor Vehicle Safety Standard or that contains a defect relating to motor vehicle safety. If you have questions regarding this or any other campaign, please contact Warranty.



Safety Recall

REVISION

Code: 24AP

Subject: Certain 2011-2013 Audi S4, S5, A6, A7 and Q7 with 3.0L TFSI Engine

Fuel Injection System Leak January 30, 2015

Revision Summary

- Required parts section added
- Coolant part number clarified for ordering

Problem Description

Due to a combination of production tolerance issues and vehicle vibration during dynamic driving, it is possible that, in rare cases, a fuel leak may occur in the vehicle's fuel injection system. Leaking fuel, in the presence of an ignition source, may result in a fire.

Additionally, some vehicles may benefit from having the thermostat and/or the crankcase pressure valve updated. Repairs to these other components are not related to the safety recall, but can be easily performed at the same time as recall repair.

Corrective Action

To correct the safety defect, dealers will replace both fuel rails and the fuel injector seals.

Additionally, some vehicles may also have the thermostat and/or the crankcase pressure valve updated. This work is not related to the safety recall, but can easily be performed at the same time as the recall repair.

Affected Vehicles

U.S.A.:

2011-2012 Audi S4, S5, Q7 with 3.0L TFSI Engine 2012 Audi A6 with 3.0L TFSI Engine 2012-2013 Audi A7 with 3.0L TFSI Engine

Canada.:

U.S.A.:

2011-2012 Audi S4, S5, Q7 with 3.0L TFSI Engine 2012 Audi A6, A7 with 3.0L TFSI Engine

Verify the open Campaigns/Actions screen in Elsa to determine if the VIN# applies to this Campaign/Action

NOTE:

- Elsa is the only valid campaign inquiry/verification source. Check
 Elsa on the day the campaign work will be performed to verify
 vehicle eligibility for the repair in order to receive claim payment
 consideration. Campaign status must show "open".
- If this repair appears to have already been performed on the vehicle but the code still shows open in Elsa, contact Warranty

- before proceeding further, e.g. a dealer may have recently performed this repair but not yet entered a claim for it in the system.
- Elsa may also show additional open action(s); if so, inform your customer - this work can be done while the vehicle is in for this campaign.
- Contact Warranty if you have any questions.

VIN Lookup Status- USA Only

As a reminder, federal regulations require information on upcoming/pending recalls to be displayed in the <u>audiusa.com</u> and NHTSA VIN search tools. Because parts are not yet available to begin recall repairs, vehicles affected by safety recall code **24AP** will show in these VIN search tools and in Elsa as "Repair Not Yet Available."

Inventory Vehicle Open Campaign/Action Report (AIM)

In March 2015 (anticipated), affected vehicles will be listed on the Inventory Vehicle Open Campaign Action report under My Dealership Reports (found on www.accessaudi.com & AIM). A list will not be posted for dealers who do not have any affected vehicles.

Parts Information and Allocation

- On or about January 26, 2015, a small quantity of parts was allocated to certain dealers. <u>These</u> <u>parts are only to be used for critical cases</u> (such as car-down situations). We have a very limited parts supply on hand currently; dealers are asked to manage the parts usage according to customer needs.
- For critical cases where parts are required but your allocation has already been depleted, please email Special Services with the VIN to order at vwoaspecialservices@vw.com.
- If you have questions regarding parts, please contact the Parts Helpline at 800-767-6552.
- A regular supply of campaign parts will become available prior to the customer notification mailing, anticipated for March 2015.

Owner Notification Mailing

We anticipate the customer notification will take place in March 2015. A sample copy of the proposed owner letter is enclosed.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Audi dealer. ©2015 Audi of America, Inc. and Audi Canada. All Rights Reserved.

January 2015 24AP/H6 Page 1 of 56

Requirements for Emissions Campaigns Having Customer Notification (CALIFORNIA ONLY)

The California Air Resources Board and the Department of Motor Vehicles (DMV) require emissions-related campaigns to be completed prior to vehicle registration renewal. When campaign work is done you must provide the owner with a signed "Vehicle Emission Recall – Proof of Correction" certificate (RC EMISCAVWAU). Certificates can be ordered at no cost online via the Compliance Label Ordering portal at www.accessaudi.com.

Important Reminder on Vehicles Affected by Safety and Compliance Recalls

By law, dealers must correct, prior to delivery for sale or lease, any vehicle that fails to comply with an applicable Federal/Canadian Motor Vehicle Safety Standard or that contains a defect relating to motor vehicle safety.

The information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Audi dealer. ©2013 Audi Group of America, Inc. and Audi Canada. All Rights Reserved.

January 2015 24AP/H6 Page 2 of 56

Claim Entry Procedure

Immediately upon completion of the repair work, enter the Applicable Criteria ID and Repair Operation from the following chart. **The Applicable Criteria ID is shown in Elsa**. Claims will only be paid for vehicles that show this campaign open in Elsa on the day of the repair. To help ensure prompt and proper payment, attach the screen print to the repair order.

Saga Claim Entry Procedure

Check Elsa to determine if this campaign is open.

Service No.: 24AP Damage Code: 0099

Parts Manufacturer

Removed part: Use vendor code 002

Sold vehicle = 7 10 Unsold vehicle = 7 90

Accounting Instructions

Criteria I.D. 01

Replace fuel rail

Repair operation: 2441 56 99 320 T.U. S4 and S5

2441 55 99 290 T.U. A6, A7 and Q7

<u>Quantity</u>	Part Number	Part Description
6.00	06E998907E	Repair kit
6.00	06D133036K	Injector support
1.00	06E198201*	Fuel rail kit
1.00	06E103213	Vent Tube
6.00	079129717D	Gasket
6.00	079129717B	Gasket
2.00	06E127065G	Adapter
1.00	06E121119C	Seal
2.00	06E121119E	Seal
1.00	06E145417A	Seal
4.00	06E121119D	Seal
15.00	G 013A8JS0	Coolant concentrate

*Causal Indicator: Select "Fuel Rail Kit" as causal part

-AND/OR-

Continue to next page

January 2015 24AP/H6 Page 3 of 56

Criteria I.D. 02

Replace thermostat

Repair operation: 1955 19 91 270 T.U. S4, S5

1955 19 91 250 T.U. A6 and A7

1955 19 89 170 T.U. Q7

<u>Quantity</u>	Part Number	Part Description
1.00	06E121111AL	Thermostat

-AND/OR-

Criteria I.D. 03

Replace pressure control valve and perform software update

Repair operation: 1050 42 99 110 T.U. S4, S5, Q7

1050 37 99 80 T.U. A6 and A7

AND

2470 23 99 Time stated on diagnostic protocol (max 40 T.U.)

<u>Quantity</u>	Part Number	Part Description
1.00	N 90316801	O-ring
1.00	N 10203601	Retaining clip (12.3mm)
1.00	06E103547H	Pressure regulating valve
72.00	G 052 167 S0	Engine Oil (Castrol Dealers and Canada)
OR	OR	OR
7.2 and \$35.00	ZVP000540**	Engine Oil (Non-Castrol Dealers)
		**Entered in Outside Material

There is NO reimbursement for Vehicle Wash or Loaner

If customer refused repairs

U.S. dealers: Submit the request through Audi Warranty Online under the Campaigns/Update option.

<u>Canadian dealers</u>: Fax the Repair Order to Warranty at (905) 428-4811 and provide VIN, applicable Service Number, Customer Information, Dealer Number and Date.

January 2015 24AP/H6 Page 4 of 56

Customer Letter Example (USA – EXCEPT CALIFORNIA)

This notice applies to your vehicle: <VIN>

Subject:Safety Recall 24AP – Fuel Injection System Leak
Certain 2011-2013 Model Year Audi S4, S5, A6, A7 and Q7 with 3.0L TFSI Engine

Dear Audi Owner,

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act. Audi has decided that a defect, which relates to motor vehicle safety, exists in certain 2011-2013 model year Audi vehicles equipped with a 3.0L TFSI engine. Our records show that you are the owner of a vehicle affected by this action.

What is the issue?

Due to a combination of production tolerance issues and vehicle vibration during dynamic driving, it is possible that, in rare cases, a fuel leak may occur in the vehicle's fuel injection system. Leaking fuel, in the presence of an ignition source, may result in a fire.

Additionally, some vehicles may benefit from having the thermostat and/or the crankcase pressure valve updated. Repairs to these other components are not related to the safety recall, but can be easily performed at the same time as recall repair.

What will we do?

To help correct the safety defect, your authorized Audi dealer will replace both fuel rails and the fuel injector seals.

The thermostat and/or the crankcase pressure valve will also be updated on certain vehicles. These repairs are not related to the safety recall, but can easily be performed at the same time as the recall repair.

This work will take about eight hours to complete and will be performed for you free of charge.

What should you do?

Please contact your authorized Audi dealer without delay to schedule this recall repair. Please keep in mind that your dealer may need additional time for the preparation of the repair, as well as to accommodate their daily workshop schedule.

Precautions you should

Affected vehicles can continue to be driven as usual, but if you can smell fuel in the vehicle proceed immediately to the nearest authorized dealer or qualified workshop if you believe that it is safe to do so in order to have the fuel system on the vehicle inspected.

Lease vehicles and address changes

If you are the lessor and registered owner of the vehicle identified in this action, the law requires you to forward this letter immediately via first-class mail to the lessee within ten (10) days of receipt. If you have changed your address or sold the vehicle, please fill out the enclosed prepaid Owner Reply card and mail it to us so we can update our records.

Reimbursement of Expenses If you have previously paid for repairs relating to the condition described in this letter, the enclosed form explains how to request reimbursement. We would be pleased to review your reimbursement request.

Can we assist you further?

If your authorized Audi dealer fails or is unable to complete this work free of charge within a reasonable time, please call or write to:

Audi of America, Inc.,

Attn: Customer Experience (24AP) 3800 Hamlin Road, Auburn Hills, MI 48326

1-800-253-2834 www.audiusa.com

Checking your vehicle for open Recalls and Service Campaigns

To check your vehicle's eligibility for repair under this or any other recall/service campaign, please visit the *Recall/Service Campaign Lookup* tool at www.audiusa.com and enter your Vehicle Identification Number (VIN). As always, if you have any questions or if you need additional assistance, please contact Customer Experience or your authorized Audi dealer.

If you still cannot obtain satisfaction, you may file a complaint with: The Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Avenue, SE., Washington, DC 20590; or call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-800-424-9153); or go to http://www.safercar.gov.

We apologize for any inconvenience this matter may cause; however we are taking this action to help ensure your safety and continued satisfaction with your vehicle. Thank you for your continued loyalty!

Sincerely,

Audi Customer Protection

Customer Letter Example (USA -CALIFORNIA)

This notice applies to your vehicle: <VIN>

Subject: Safety Recall 24AP - Fuel Injection System Leak

Certain 2011-2013 Model Year Audi S4, S5, A6, A7 and Q7 with 3.0L TFSI Engine

Dear Audi Owner.

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act. Audi has decided that a defect, which relates to motor vehicle safety, exists in certain 2011-2013 model year Audi vehicles equipped with a 3.0L TFSI engine. Our records show that you are the owner of a vehicle affected by this action.

What is the issue?

Due to a combination of production tolerance issues and vehicle vibration during dynamic driving, it is possible that, in rare cases, a fuel leak may occur in the vehicle's fuel injection system. Leaking fuel, in the presence of an ignition source, may result in a fire.

Additionally, some vehicles may benefit from having the thermostat and/or the crankcase pressure valve updated. Repairs to these other components are not related to the safety recall, but can be easily performed at the same time as recall repair.

What will we do?

To help correct the safety defect, your authorized Audi dealer will replace both fuel rails and the fuel injector seals.

The thermostat and/or the crankcase pressure valve will also be updated on certain vehicles. These repairs are not related to the safety recall, but can easily be performed at the same time as the recall repair.

This work will take about eight hours to complete and will be performed for you free of charge.

What should you do?

Please contact your authorized Audi dealer without delay to schedule this recall repair. Please keep in mind that your dealer may need additional time for the preparation of the repair, as well as to accommodate their daily workshop schedule.

Precautions you should take

Affected vehicles can continue to be driven as usual, but if you can smell fuel in the vehicle proceed immediately to the nearest authorized dealer or qualified workshop if you believe that it is safe to do so in order to have the fuel system on the vehicle inspected.

Lease vehicles and address changes

If you are the lessor and registered owner of the vehicle identified in this action, the law requires you to forward this letter immediately via first-class mail to the lessee within ten (10) days of receipt. If you have changed your address or sold the vehicle, please fill out the enclosed prepaid Owner Reply card and mail it to us so we can update our records.

Important information for California Vehicle Owners – California Regulations

California regulations require that this campaign be completed prior to the time you renew your vehicle registration. Therefore, please make sure that this campaign is completed prior to the renewal of your vehicle registration, and that you furnish proof of completion to the Department of Motor Vehicles (DMV) in the form of a copy of the dealer's repair order, including a signed "Proof of Correction" certificate. You obtain this from your dealer after the campaign has been completed. Please retain the signed "Proof of Correction Certificate" with your vehicle records. DO NOT MAIL THIS FORM to the DMV, unless requested.

Reimbursement of Expenses If you have previously paid for repairs relating to the condition described in this letter, the enclosed form explains how to request reimbursement. We would be pleased to review your reimbursement request.

Can we assist you further?

If your authorized Audi dealer fails or is unable to complete this work free of charge within a reasonable time, please call or write to:

Audi of America, Inc., Attn: Customer Experience (24AP) 3800 Hamlin Road, Auburn Hills, MI 48326 1-800-253-2834

www.audiusa.com

Checking your vehicle for open Recalls and Service Campaigns

To check your vehicle's eligibility for repair under this or any other recall/service campaign, please visit the *Recall/Service Campaign Lookup* tool at www.audiusa.com and enter your Vehicle Identification Number (VIN). As always, if you have any questions or if you need additional assistance, please contact Customer Experience or your authorized Audi dealer.

If you still cannot obtain satisfaction, you may file a complaint with: The Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Avenue, SE., Washington, DC 20590; or call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-800-424-9153); or go to http://www.safercar.gov.

We apologize for any inconvenience this matter may cause; however we are taking this action to help ensure your safety and continued satisfaction with your vehicle. Thank you for your continued loyalty!

Sincerely,

Audi Customer Protection

Customer Letter Example (CANADA)

This notice applies to your vehicle: <VIN>

Subject: Safety Recall 24AP - Fuel Injection System Leak

Certain 2011-2012 Model Year Audi S4, S5, A6, A7 and Q7 with 3.0L TFSI Engine

Dear Audi Owner.

This notice is sent to you in accordance with the requirements of the Motor Vehicle Safety Act. Audi has decided that a defect, which relates to motor vehicle safety, exists in certain 2011-2012 model year Audi vehicles equipped with a 3.0L TFSI engine. Our records show that you are the owner of a vehicle affected by this action.

What is the issue?

Due to a combination of production tolerance issues and vehicle vibration during dynamic driving, it is possible that, in rare cases, a fuel leak may occur in the vehicle's fuel injection system. Leaking fuel, in the presence of an ignition source, may result in a fire.

Additionally, some vehicles may benefit from having the thermostat and/or the crankcase pressure valve updated. Repairs to these other components are not related to the safety recall, but can be easily performed at the same time as recall repair.

What will we do?

To help correct the safety defect, your authorized Audi dealer will replace both fuel rails and the fuel injector seals.

The thermostat and/or the crankcase pressure valve will also be updated on certain vehicles. These repairs are not related to the safety recall, but can easily be performed at the same time as the recall repair.

This work will take about eight hours to complete and will be performed for you free of charge.

What should you do?

Please contact your authorized Audi dealer without delay to schedule this recall repair. Please keep in mind that your dealer may need additional time for the preparation of the repair, as well as to accommodate their daily workshop schedule.

take

Precautions you should Affected vehicles can continue to be driven as usual, but if you can smell fuel in the vehicle proceed immediately to the nearest authorized dealer or qualified workshop if you believe that it is safe to do so in order to have the fuel system on the vehicle inspected.

Lease vehicles and address changes

If you are the lessor and registered owner of the vehicle identified in this action, the law requires you to forward this letter immediately via first-class mail to the lessee within ten (10) days of receipt. If you have changed your address or sold the vehicle, please fill out the enclosed prepaid Owner Reply card and mail it to us so we can update our records.

Reimbursement of **Expenses**

If you have previously paid for repairs relating to the condition described in this letter, the enclosed form explains how to request reimbursement. We would be pleased to review your reimbursement request.

Can we assist you further?

If your authorized Audi dealer fails or is unable to complete this work free of charge within a reasonable time, please call or write to:

Audi Canada Attn: Customer Relations (24AP) PO Box 842, Stn. A Windsor, ON N9A 6P2 1-800-822-2834 www.audi.ca

We apologize for any inconvenience this matter may cause; however we are taking this action to help ensure your safety and continued satisfaction with your vehicle. Thank you for your continued loyalty!

Sincerely.

Audi Customer Protection

Required Parts:

Criteria 01

Quantity	Part Number	Part Description
6.00	06E998907E	Repair kit
6.00	06D133036K	Injector support
1.00	06E198201	Fuel rail kit
1.00	06E103213	Vent Tube
6.00	079129717D	Gasket
6.00	079129717B	Gasket
2.00	06E127065G	Adapter
1.00	06E121119C	Seal
2.00	06E121119E	Seal
1.00	06E145417A	Seal
4.00	06E121119D	Seal
1.5L	G 013A8J1G	Coolant concentrate

Criteria 02

<u>Quantity</u>	Part Number	Part Description
1.00	06E121111AL	Thermostat

Criteria 03

Quantity	Part Number	Part Description
1.00	N 90316801	O-ring
1.00	N 10203601	Retaining clip (12.3mm)
1.00	06E103547H	Pressure regulating valve
7.2L	N/A	Engine Oil

Required Tools:



3094 Hose Clamps Up to 25mm
 Diameter (or equivalent)



 \leftarrow Spanner Wrench 3212



VAS 6362 Hose Clip Pliers (or equivalent)




T10133 – Fuel injector seal tool (or equivalent)





VAS 6213 – Hand Vacuum Pump (or equivalent)

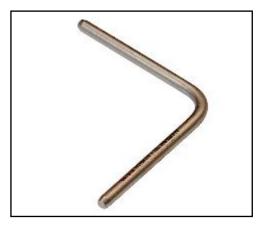

← T10060A Locking Pin (or equivalent)



January 2015 24AP/H6 Page 10 of 56







VAS 6208 Drip Tray for VAS 6100 (or equivalent)







VAS 6122 Engine Bung Set (or equivalent)




← 80-200 – Pry Lever (or equivalent)

January 2015 24AP/H6 Page 12 of 56

Repair Overview:

All affected VINs will have Criteria 01 open. Some of these vehicles may have Criteria 02 and/or 03 open also. To ensure all applicable repairs are performed, check Elsa for open criteria and follow the steps in this work instruction carefully.

Work Procedure

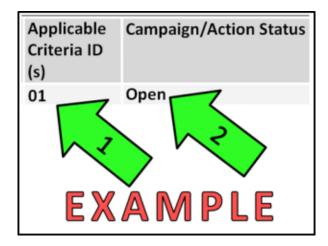


Section A - Check for Previous Repair

• Enter the VIN in Elsa and proceed to the "Campaign/Action" screen



Tip: On the date of repair, print this screen and keep a copy with the repair order

- Ensure that the Status is "Open" <arrow 2>
- Note the Applicable Criteria ID <arrow 1> for use in determining the correct work to be done and corresponding parts associated
- · Proceed to Section B.

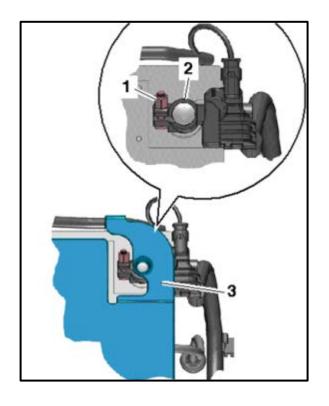

Section B - Disconnect the Vehicle Battery



Note: On vehicles with air suspension, activate the lift mode prior to disconnecting the battery (see Appendix A


A6 and A7 models:


- Switch the ignition OFF.
- Lift the luggage compartment floor covering by the handle and fold it forward.
- Open the cover <3> over the negative battery terminal.
- Disconnect and isolate the negative battery terminal <2>.


S4 and S5 models:

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Audi dealer. ©2015 Audi of America, Inc. and Audi Canada. All Rights Reserved.

January 2015 24AP/H6 Page 13 of 56

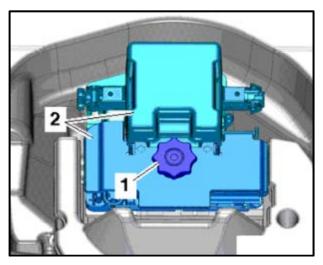

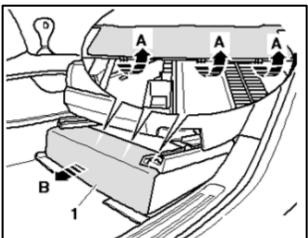

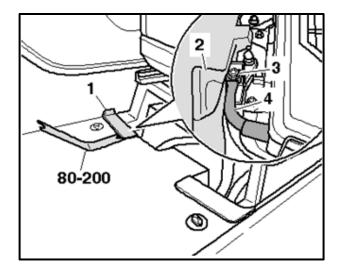

- Switch the ignition OFF.
- Lift the luggage compartment floor covering.
- If necessary, remove the spare tire.
- Remove the nut <1> and the cover <2> to access the vehicle battery.
- Lift the cover to access the negative battery terminal.
- Disconnect and isolate the negative battery terminal.

Q7 models:

- Position the driver seat in the full rearward position.
- Release the mounting clips on the battery cover <1>, lift the front of the cover <direction of arrow A>, then remove the cover <direction of arrow B>.

- Pry cover <1> with Pry Lever 80-200 from the floor covering.
- Lift the floor covering <2> to access battery ground connection.
- Remove and isolate the battery cable.

Proceed to Section C

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Audi dealer. ©2015 Audi of America, Inc. and Audi Canada. All Rights Reserved.

January 2015 24AP/H6 Page 14 of 56




Section C - Drain the Cooling System




WARNING: Risk of scalding due to hot steam and hot coolant

- The coolant system is under pressure when the engine is warm
- Cover the coolant reservoir cap with a clean cloth and then open it slowly to release the pressure in the system
- Open the hood.
- Carefully open the coolant reservoir cap <arrow>.

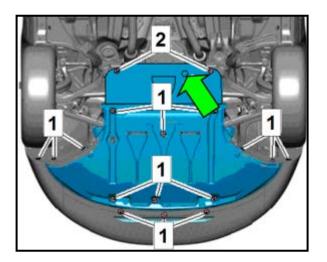

- Raise the vehicle on an appropriate hoist.
- Remove the underbody shield fasteners <1,</p> 2, arrow>.
- Remove the underbody shield.
- Place the VAS 6208 drip tray, or equivalent, under the vehicle.

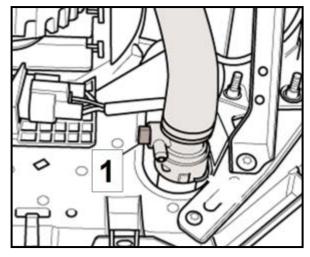


← If equipped, open the drain plug <1> and drain the coolant.



Tip: The drain plug may be closed once the coolant is drained.


January 2015 24AP/H6 Page 15 of 56

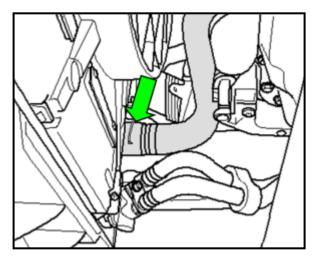

← If the drain plug is not present, disconnect the right lower radiator hose and allow the coolant to drain.



Tip: The hose may be reattached once the coolant is drained.

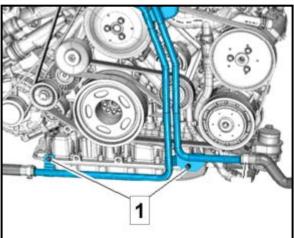


S4 and S5 models:

coolant lines.



Tip: Removing screws for the hard coolant line bracket will provide more working room at the front of the engine.

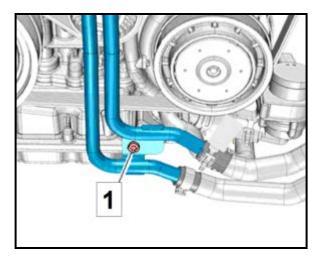

All other models:

Remove the coolant hose mounting screw <1>.



Tip: Removing the screw for the hard coolant line bracket will provide more working room in front of the engine.


Proceed to Section D.

24AP/H6 Page 16 of 56 January 2015



Section D - Remove the Supercharger


- Lower vehicle to a comfortable working level.
- If necessary, open the hood.
- Remove the engine covers <arrows>.

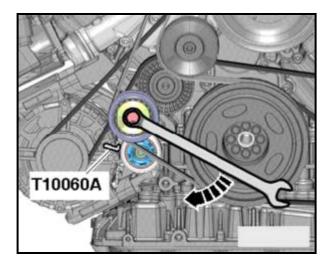



Note: Before removing the ribbed belt, mark the turning direction on it with chalk or felt tip pen. A reversed turning direction can cause damage to the belt under operating conditions.

- Pivot the belt tensioner clockwise <direction of arrow> to release the tension on the ribbed belt for the supercharger.
- Remove the ribbed belt and secure the belt tensioner with locking pin T10060A <as shown>.

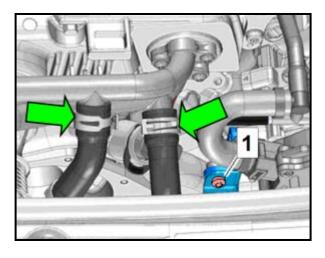




Tip: Place a shop towel beneath the coolant hoses to catch any residual coolant.

- Release the clamps <arrows> using hose clip pliers VAS 6362 (or equivalent) and disconnect the coolant hoses from the coolant pipes on the supercharger.
- Remove upper screw <1> for the bracket to the hard coolant lines.




Tip: Removing screw for the hard coolant line bracket will provide more working room in front of the engine.


January 2015 24AP/H6 Page 17 of 56

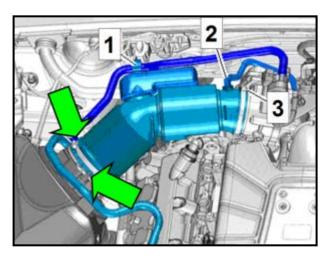

- Free up hose connection <1> from the EVAP canister on the air filter housing guide tube.
- Remove the vacuum hose <2> from the air guide hose connection.
- Remove the air guide pipe by loosening the hose clamp <3> and opening the clips <arrows>.

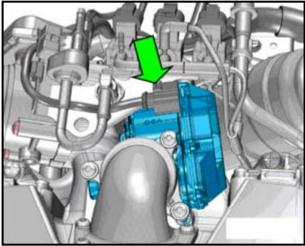


Disconnect the control module (J808) <arrow>.

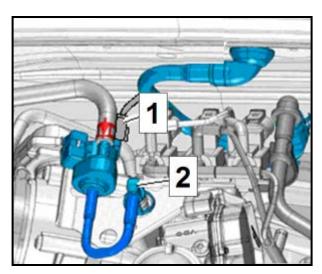


- Unplug the electrical connector <1> on EVAP canister purge valve N80.
- □ Disconnect the vacuum hose <2>.
- Remove the N80 valve from the bracket and lay it aside with the hose connected.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Audi dealer. ©2015 Audi of America, Inc. and Audi Canada. All Rights Reserved.

January 2015 24AP/H6 Page 18 of 56

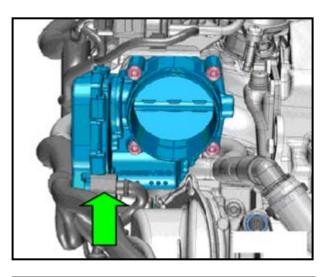

Disconnect the throttle valve control module J338 <arrow>.

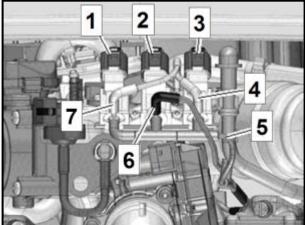

- Disconnect the vacuum solenoids <1, 2 and 3>.
- Free up the connector harness from bracket by disconnecting retainer clip (not shown).




Tip: Mark the vacuum hoses for reinstallation later.

- □ Disconnect the vacuum hoses <4 through 7>.

C Disconnect the intake air temperature sensor G42/manifold absolute pressure sensor G71 <1>.

January 2015 24AP/H6 Page 19 of 56

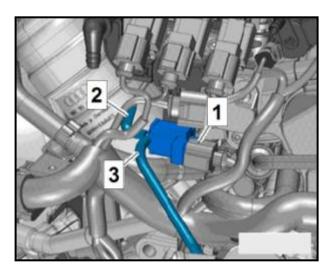


S4 and S5 models:

Unplug the connector <1> and the vacuum hoses <2> and <3>.




All models:

On the left side of the engine, disconnect the Charge Air Pressure Sensor G447 <arrow>.

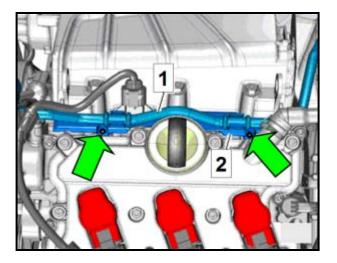


- \leftarrow Free up the vacuum hose <1>.
- Remove the left and right retaining screws <arrows> and the cover <2>.


January 2015 24AP/H6 Page 20 of 56

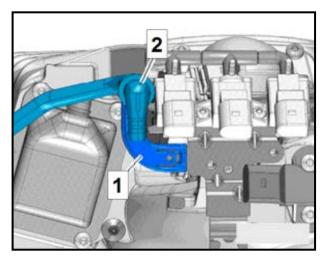

Free up the brake booster vacuum hose <2> on the bracket <1>.

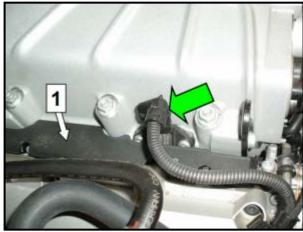

- On right side of engine, disconnect the Charge Air Pressure Sensor G31<arrow>.
- Remove cover <1> by first removing the two screws.

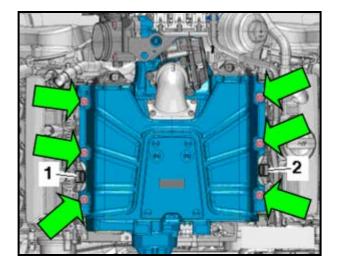


- Remove the nuts <arrows> and lift upward to remove the compressor with the charge air coolers.
- Seal off the openings on the compressor and on the charge air pipe using engine bung set VAS 6122 (or equivalent).

Proceed to Section E.


January 2015 24AP/H6 Page 21 of 56

Section E – Remove the Fuel Rails


- Remove the front secondary air hose <arrow> from the mounting bracket.
- Disconnect the front secondary air hose <arrow> by pressing the release buttons.

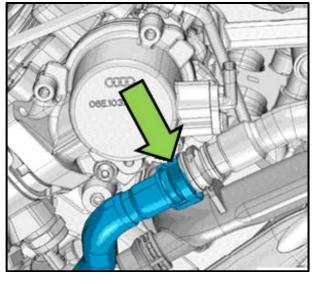

Remove the mounting screws <arrows> from the right Intake Manifold Runner Position Sensor –G336- <1> and position it to the side.

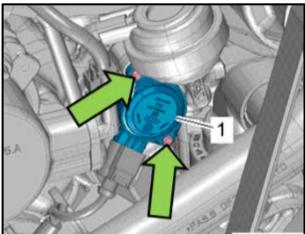

Remove the mounting screws <arrows> and the protective plate <1>.

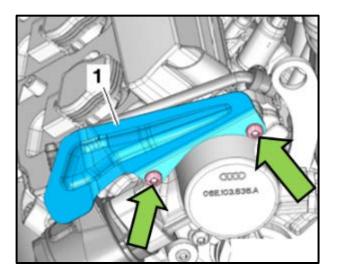

January 2015 24AP/H6 Page 22 of 56



Wrap a clean cloth around the fuel line threaded connection <arrow> and open it slowly, allowing residual fuel pressure to escape. Once the fuel pressure is relieved, fully remove the threaded connection.



Note: While removing the threaded connection, hold the brass union nut stationary using an open end wrench.





Note: the removal of the driver side intake manifold/fuel rail assembly is depicted here. The procedure for the passenger side is nearly identical.

- Loosen and remove the threaded fuel line connection <arrow 1>.
- Disconnect the fuel pressure sensor <arrow 2> (driver side only).
- Loosen the brass union nut, and the fuel rail pressure sensor <circles> from the fuel rail.

January 2015 24AP/H6 Page 23 of 56



Remove the mounting fasteners <circles> from the intake manifold/fuel rail assembly.




- Lift gently upward on the lower intake manifold/fuel rail assembly to unseat the fuel rail from the fuel injectors.
- During removal of the intake manifold/fuel rail assembly, disconnect the intake manifold runner position sensor and vacuum line <arrows>.
- Repeat the previous steps to remove the intake manifold/fuel rail assembly from the opposite side of the engine.



Note: Some of the fuel injectors may come out with the fuel rail. Any injectors that are removed from the cylinder head MUST have replacement seals installed on them prior to reassembly (see Appendix B).

Proceed to Section F.

January 2015 24AP/H6 Page 24 of 56

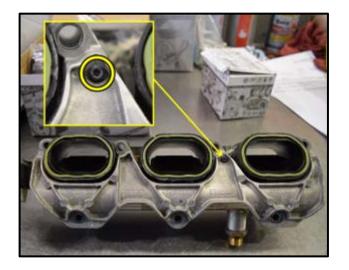


Section F - Replace Fuel Rails

Note: The replacement procedure depicted here shows the passenger side fuel rail. Replacement of the driver side fuel rail is nearly identical.

Remove the set screw <circle>.




- Disassemble the mounting bracket, fuel rail, and intake manifold <as shown>.
- Remove the brass union nut and the fuel rail pressure sensor (driver side only) from the fuel rail.
- Install the fuel rail pressure sensor (driver side only) into the new fuel rail and fingertighten.
- Install the replacement brass union nut, P/N 06E127065G.

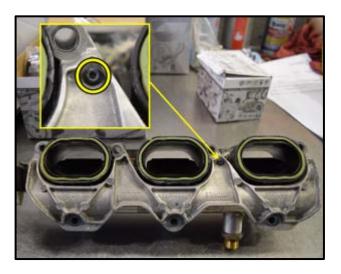



- Reassemble the mounting bracket, fuel rail, and intake manifold <as shown>.
- ← Install and gently tighten the set screw <circle>.
- Repeat these steps on the opposite intake manifold/fuel rail assembly.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Audi dealer. ©2015 Audi of America, Inc. and Audi Canada. All Rights Reserved.

January 2015 24AP/H6 Page 25 of 56

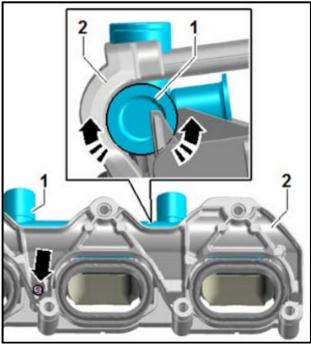

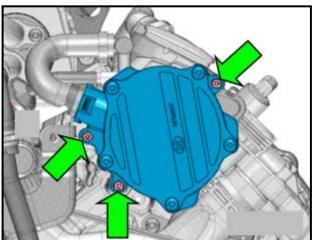

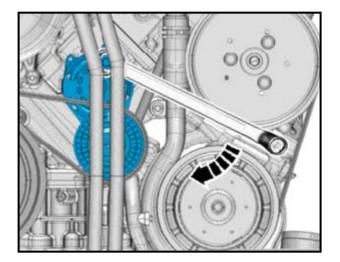

- After reassembly, test the fuel rail <1> free play inside the retaining bracket <2> as shown <direction of arrows>.
- The fuel rail MUST pivot slightly. If the rail does not move, slightly loosen the set screw <lower arrow> and retest.



Note: If Criteria 02 and/or 03 are also open, DO NOT re-install the intake manifold/fuel rail assemblies at this time.

If ONLY Criteria 01 is open, **Proceed to Section I.**If Criteria 02 is open, **Proceed to Section G.**If Criteria 02 is NOT open, but Criteria 03 is open, **Proceed to Section H.**

Section G - Thermostat Replacement

Remove the screws <arrows> for brake vacuum pump, then lay pump to side.




Note: Before removing the ribbed belt, mark the turning direction on it with chalk or felt tip pen. A reversed turning direction can cause damage to the belt under operating conditions.


- Pivot the belt tensioner clockwise <arrow> to release the tension on the ribbed belt.
- Remove the ribbed belt and release the tension on the tensioning element.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Audi dealer. ©2015 Audi of America, Inc. and Audi Canada. All Rights Reserved.


January 2015 24AP/H6 Page 26 of 56

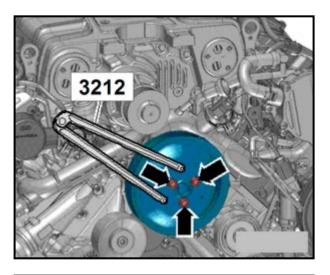

- Remove the screws <arrows> for the coolant pump pulley, using spanner wrench 3212 to counter-hold.
- · Remove the ribbed belt pulley.

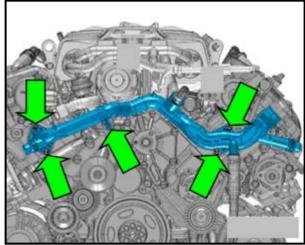


- Remove the five screws <arrows> for the upper coolant pipe.
- Loosen the coolant pipe from its mounting location to allow access to the thermostat.

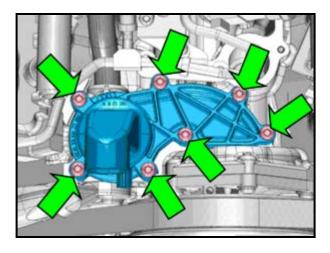


- Remove the seven screws <arrows> then remove the thermostat from vehicle.
- Remove the old gasket and clean the surface to prepare for new thermostat installation.

January 2015 24AP/H6 Page 27 of 56

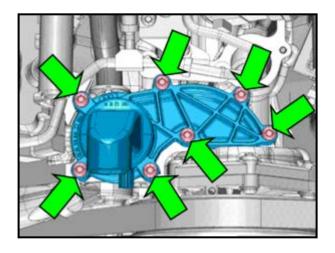


Tip: Coat the new O-rings and gaskets for the coolant system with clean coolant prior to installation.

Install the new thermostat, P/N 06E121111AL, and gasket that comes with it, and evenly tighten the seven screws <arrows> to 9 Nm.

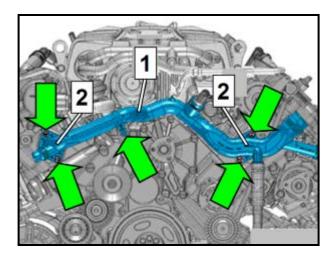


- Remove the center seal ring <1> and install the new O-ring, P/N 06E121119C.
- Remove the two seal rings <2> and install new O-rings, part number, P/N 06E121119E.
- Reinstall the coolant pipe into its mounting location.
- Reinstall the five screws <arrows> for the upper coolant pipe and torque to 9Nm.

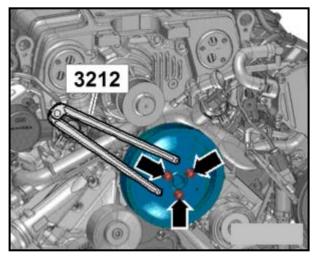

- Reinstall the pulley onto the coolant pump.
- Reinstall the three screws <arrows> and torque to 20Nm using spanner wrench 3212 to counter-hold.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Audi dealer. ©2015 Audi of America, Inc. and Audi Canada. All Rights Reserved.


January 2015 24AP/H6 Page 28 of 56

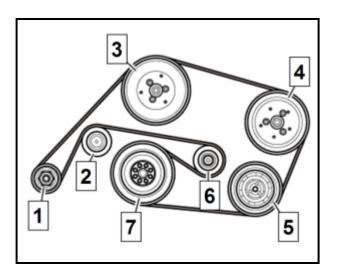




Note: Before removing the ribbed belt, mark the turning direction on it with chalk or felt tip pen. A reversed turning direction can cause damage to the belt under operating conditions.

- Reposition the ribbed belt properly and in the correct running position as illustrated:
- 1 = Generator
- 2 = Idler roller
- 3 = Coolant pump
- 4 = Power steering pump
- 5 = A/C Compressor
- 6 = Belt tensioner for ribbed belt
- 7 = Vibration damper

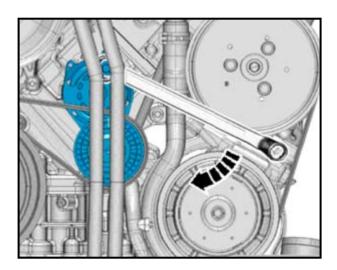

- Release the tension on the belt tensioner by pivoting the tensioner clockwise <arrow>
- Reinstall the ribbed belt correctly onto all pulleys then release the tensioner against the belt.

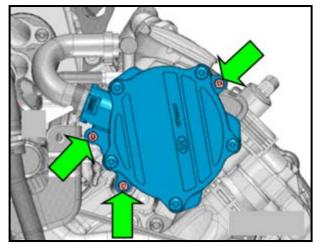


- Reinstall brake vacuum pump using new gasket part number (06E 145 417 A).
- Reinstall three screws <arrows> for brake vacuum pump and torque to 9Nm.

If Criteria 03 is also open, Proceed to Section H.

If Criteria 03 is NOT open, Proceed to Section I.

 
January 2015 24AP/H6 Page 29 of 56



Disconnect and reposition the plastic lines <arrows> as necessary to access the crankcase breather.




Remove the mounting screws <circles> and mounting bracket from the top of the crankcase breather.

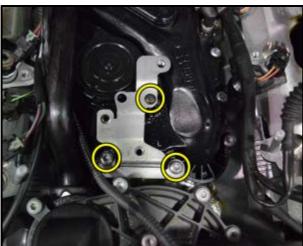

- The fuel line connections <1, 2, and 3> have been previously disconnected.
- Remove the fuel line mounting screws <arrows> and remove the steel fuel line.


January 2015 24AP/H6 Page 30 of 56

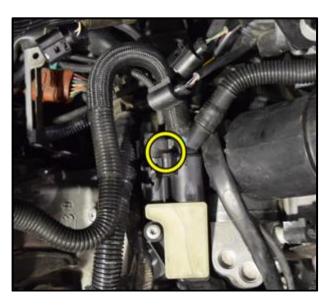

Remove the mounting screw <circle> from the crankcase breather hose.



- Disconnect the breather hose <circle> from the rear of each valve cover.
- Remove the breather hose from the vehicle.

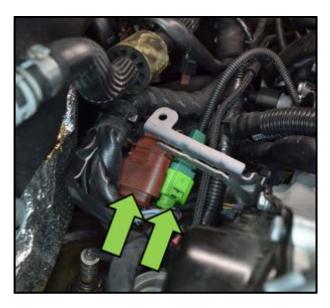


At the rear of the passenger side cylinder head, disengage the electrical connectors <arrows> from the mounting bracket.


January 2015 24AP/H6 Page 31 of 56



Remove the mounting screws <arrow> from the mounting bracket.

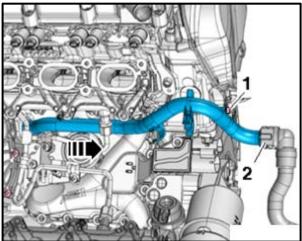


- □ Disconnect the heater hose connection <2>.
- ← Remove the mounting screw <1>.
- Move the coolant pipe toward the rear of the engine <direction of arrow> and remove it from the engine.

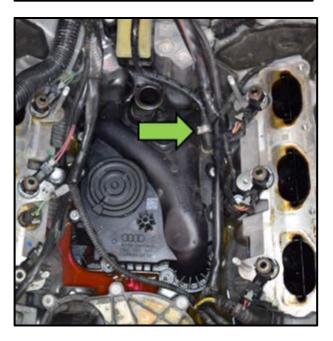

Release the clamp <arrow>, and remove the hose connection from the crankcase breather.

January 2015 24AP/H6 Page 32 of 56

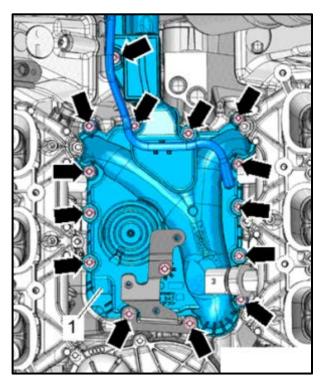

Remove the mounting screws <arrows> from the crankcase breather.



Note: The lower two screws in this illustration were removed during previous steps in this work instruction.




- Lift the crankcase breather straight up and off of the engine.
- ← Clean all residual coolant from the low areas around the outside of the crankcase breather mounting flange <arrows>.
- Clean the surface of the crankcase breather mounting flange to prepare for new breather installation.



Note: Coolant spilling into the crankcase cannot be avoided during this step. It will be necessary to change the engine oil and filter prior to starting the engine.

January 2015 24AP/H6 Page 33 of 56

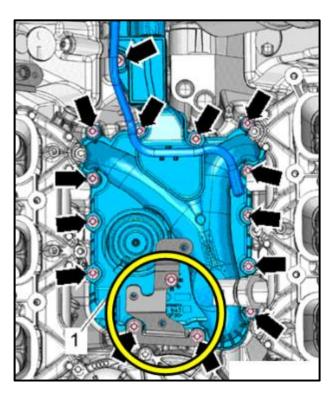


- Install the replacement crankcase breather <1>, P/N: 06E103547S.
- ← Reinstall the mounting bracket <circle>.
- Install the mounting screws <arrows> and torque to 9Nm.



Reinstall the hose and an appropriate claim <arrow> onto the crankcase breather.


January 2015 24AP/H6 Page 34 of 56

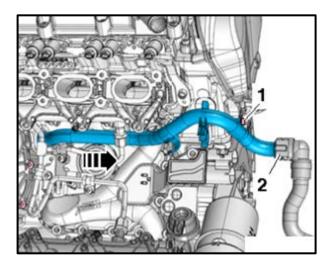

- Use clean coolant to lubricate the O-ring seal on each end of the coolant pipe.
- Install the front of the coolant pipe into the thermostat housing.
- ← Reinstall the mounting screw <1>.
- ← Reinstall the hose connection <2>.




Reinstall the mounting bracket and screws <arrow>.

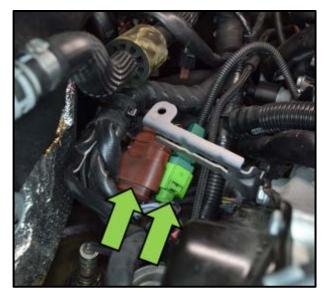

Reinstall the electrical connectors <arrows> into the mounting bracket.


January 2015 24AP/H6 Page 35 of 56

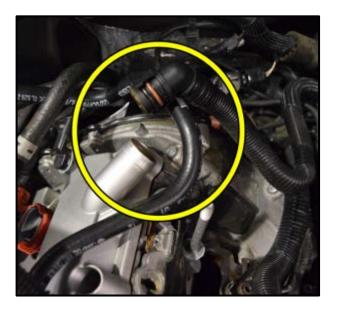

- Reinstall the crankcase breather hose into position.
- Reconnect the crankcase breather hose to both valve cover connections <circle>.



Reinstall the crankcase breather hose onto the back of the crankcase breather and reinstall the mounting screw <circle>.

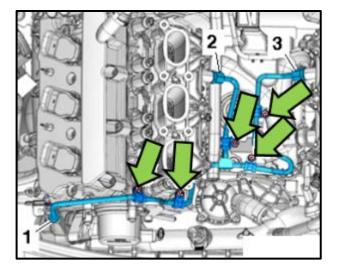

- Reinstall the steel fuel line and fasten the mounting screws <arrows>.
- Install the threaded nut <1> onto the high pressure pump and finger-tighten.

January 2015 24AP/H6 Page 36 of 56




Torque the threaded connection to 27Nm.



Note: While torqueing the threaded connection, use an open end wrench to counter-hold the brass union nut. The brass union nut MUST NOT turn inside the high pressure fuel pump during this step.

Proceed to Section I

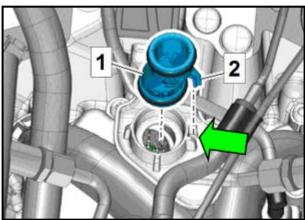


Section I - Vehicle Reassembly

Install new crankcase vent tube <1> P/N (06E 103 213) into the oil separator cover.



Tip: The tab <2> must engage into the guide <arrow>.

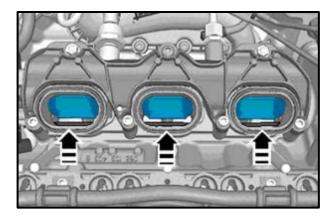


- Reinstall the intake manifold/fuel rail assemblies.
- Attach the hand vacuum pump VAS6213 (or equivalent) to the intake manifold runner vacuum actuator.
- Apply a vacuum using the pump and allow the flaps to fully open <direction of arrows>.




Note: Installing the intake manifold without opening the flaps could result in intake manifold damage.


January 2015 24AP/H6 Page 37 of 56

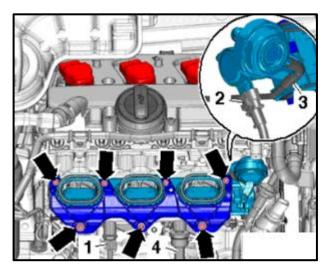

- Install the retaining fasteners <arrows> and gently tighten by hand.
- Remove the hand vacuum pump from the IMRC vacuum actuator.
- Reconnect the vacuum line and electrical connector to the IMRC.
- Torque the mounting fasteners <arrows> in a diagonal sequence to 9Nm.

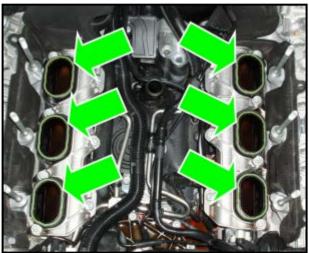


- Remove the engine bung set VAS 6122 (or equivalent) from the openings on the compressor and on the charge air pipe.
- Remove old gaskets <arrows> and install new gaskets P/N 079 129 717 D.

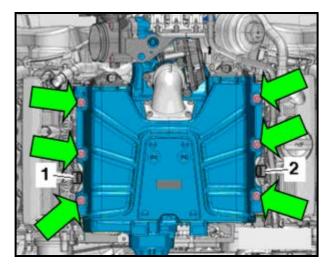


Reinstall the supercharger and torque the nuts <arrows> to 20Nm.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Audi dealer. ©2015 Audi of America, Inc. and Audi Canada. All Rights Reserved.

January 2015 24AP/H6 Page 38 of 56

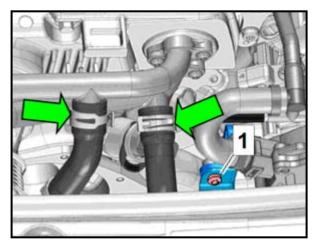


- Reinstall upper screw <1> for bracket to hard coolant lines and torque to 9Nm.
- Reconnect the coolant hoses onto the coolant pipes on the supercharger, then secure the clamps <arrows> properly using tool 3094.

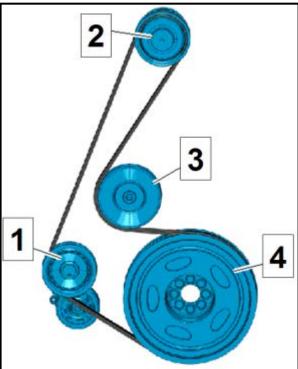

①


Note: Before removing the ribbed belt, mark the turning direction on it with chalk or felt tip pen. A reversed turning direction can cause damage to the belt under operating conditions.

- Reposition the ribbed belt properly and in the correct running position as illustrated:
- 1 = Belt tensioner
- 2 = Compressor (Supercharger)
- 3 = Idler roller
- 4 = Vibration damper

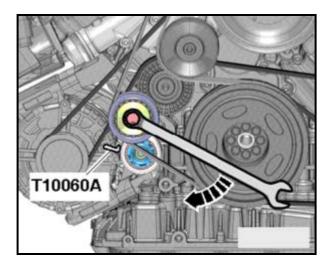


- Release the tension on the belt tensioner and remove tool T10060A by pivoting the tensioner clockwise <arrow>.
- Reinstall the ribbed belt correctly onto all pulleys then release the tensioner against the belt.


January 2015 24AP/H6 Page 39 of 56

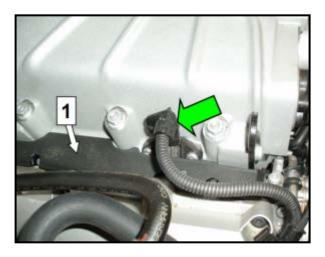

- Reinstall cover <1> and secure with the two screws.
- On right side of engine, reconnect electrical connector <arrow> for Charge Air Pressure Sensor G31.

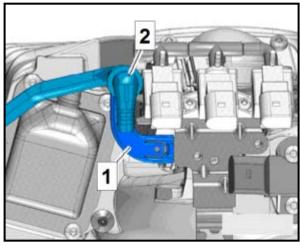


Reinstall brake booster vacuum hose <2> onto the bracket <1>.

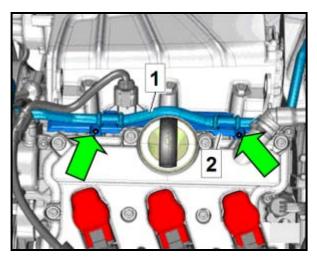


- ← Reinstall the vacuum hose <1>.
- Reinstall the cover <2> and the left and right screws <arrows>.

January 2015 24AP/H6 Page 40 of 56

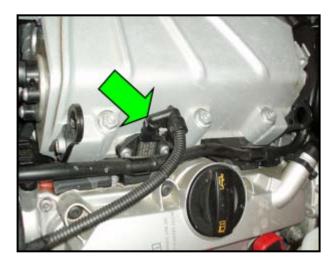


On left side of engine, reconnect electrical connector <arrow> for Charge Air Pressure Sensor 2 G447.

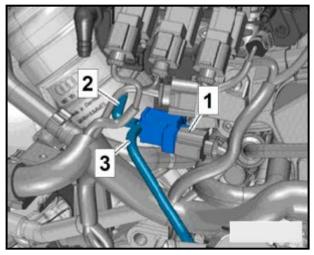

S4 & S5 models:


Reconnect connector <1> and vacuum hoses <2> and <3>.

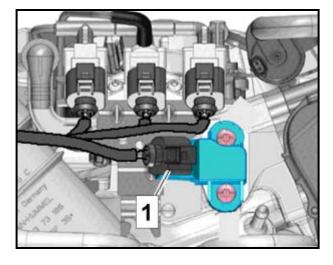


All models:

Reconnect the connector on the intake air temperature sensor G42/manifold absolute pressure sensor G71 <1>.


January 2015 24AP/H6 Page 41 of 56

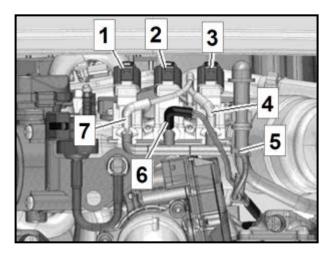

- Reconnect connector harness to bracket by reconnecting retainer clip (not shown).
- ← Reconnect connectors <1, 2 and 3>.
- Reconnect the vacuum hoses <4 through 7>.

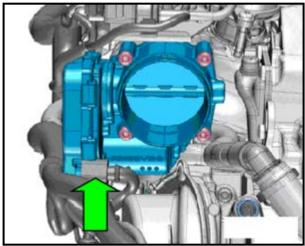


Reconnect the connector <arrow> on the throttle valve control module J338.

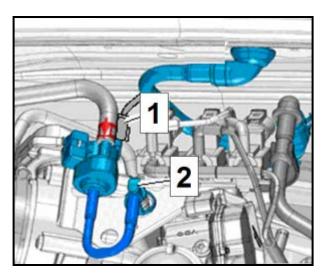


- Reinstall the EVAP canister purge regulator valve onto the bracket.
- Reconnect the electrical connector <1> onto EVAP canister purge regulator valve N80 and reconnect the vacuum hose <2>.


January 2015 24AP/H6 Page 42 of 56

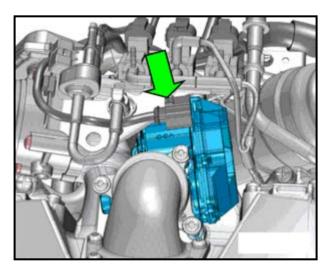

Reconnect the connector <arrow> on the control module J808.

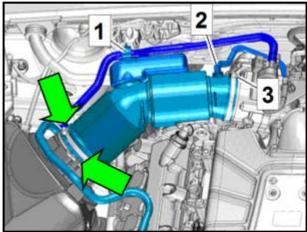


- Reinstall the air guide pipe and secure the hose clamp <3> and the clips <arrows>.
- Reinstall hose connection <1> into bracket on the air filter housing guide tube.
- Reinstall the vacuum hose <2> into the air guide hose connection.

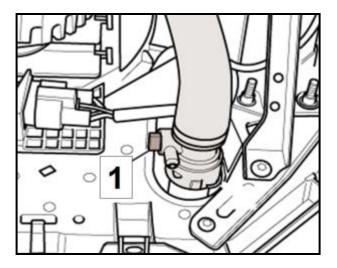


- · Raise vehicle on hoist.
- If not already done and drain plug is present, close the drain plug <1>.

January 2015 24AP/H6 Page 43 of 56

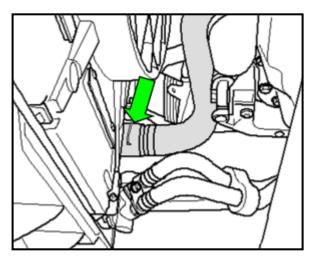


If drain plug is not present and if not already done, reinstall the right lower coolant hose <arrow> onto the radiator, then close the clamp.

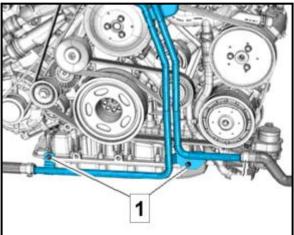

S4 & S5 models:

Reinstall two screws <1> for hard coolant lines and torque to 9Nm.

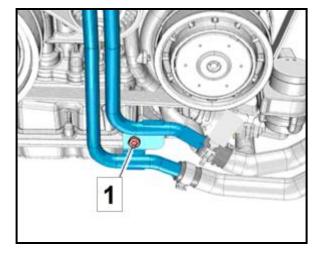


All other models:

Reinstall screw <1> for lower bracket to hard coolant lines and torque to 9Nm.

January 2015 24AP/H6 Page 44 of 56



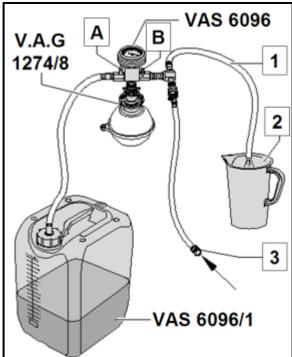

If the crankcase breather was replaced, Change the engine oil.



Note: It is not necessary to change the oil filter <arrow> during the procedure. Replacement of the oil filter will not be covered under this action.

Lower the hoist.

Proceed to Section J

Section J - Coolant Filling


- Fill coolant reservoir per the provided tool instructions on the VAS 6096 with coolant removed during the drain process and if necessary, top off with premixed coolant part number (G 012 A8G 1G) with the proper mixture ratio:
- Coolant additive (40%) and water (60%) for freeze protection down to -25°C (-13°F)
- Coolant additive (50%) and water (50%) for freeze protection down to -35°C (-31°F)
- Coolant additive (60% and water (40%) for freeze protection down to -40°C (-40°F)
- Attach the VAG 1274/8 to coolant reservoir
- Install the VAS 6096 on adapter
- Place air outlet <1> in a small container <2>



Note: A small amount of coolant which should be collected is drawn off with the discharged air

Follow provided VAS 6096 tool instructions

January 2015 24AP/H6 Page 45 of 56

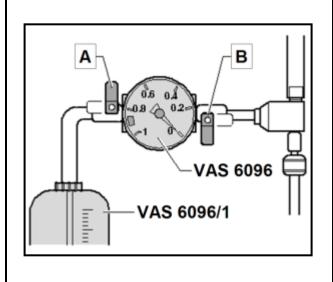

- a right angle to direction of flow.
- ← Connect hose <3> to compressed air regulated between 6 to 10 bar pressure.
- ← Open valve by turning lever in direction of flow.



Tip: The suction jet pump generates pressure in the coolant system; indicator on display instrument must move into green area.

- Briefly open valve <A> by turning lever in direction of flow so that hose on VAS 6096 coolant reservoir fills with coolant.
- ← Close valve <A> again.
- ← Leave valve open another 2 minutes.



Tip: More pressure is generated in the coolant system by the suction jet pump; indicator on display instrument must stay in green area.



Tip: Needle in the display instrument must remain in the green region, then the sufficient vacuum in the cooling system is obtained for the upcoming filling.



Note: If needle stands below the green area, repeat procedure. If pressure falls, check coolant system for leaks.


- Remove pressurized air hose.
- Open valve <A>.



Tip: Coolant is extracted from the VAS 6096 coolant reservoir by pressure in the coolant system and the system is filled.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Audi dealer. ©2015 Audi of America, Inc. and Audi Canada. All Rights Reserved.


January 2015 24AP/H6 Page 46 of 56

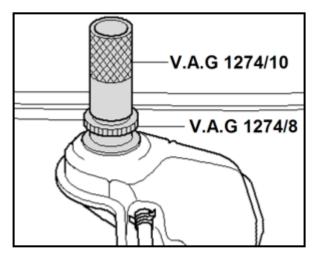


- Remove the VAS 6096 from the VAG 1274/8 on coolant reservoir.
- Mount the VAG 1274/10 on the adapter.
- Fill with coolant until the coolant system tester tube is full.



Tip: Fill again during the bleeding procedure if necessary.

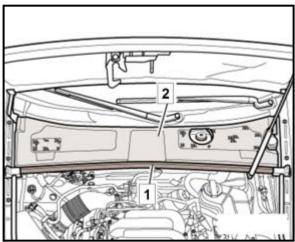

plenum chamber cover <2>

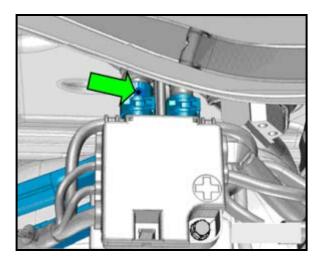


S4 & S5 models:

- Disconnect the heat exchanger coolant hose and pull it back until coolant starts to drain out of the bleed hole <arrow> in the coolant hose.
- Slide coolant hose back into position and secure the spring clamp properly.


The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Audi dealer. ©2015 Audi of America, Inc. and Audi Canada. All Rights Reserved.

January 2015 24AP/H6 Page 47 of 56

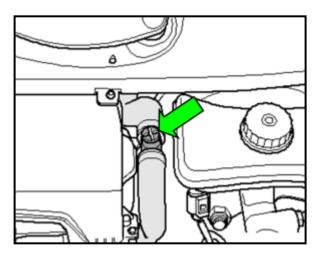


All other models:

- Open the bleeder screw <arrow> until coolant starts to come out.
- Close the bleeder screw.

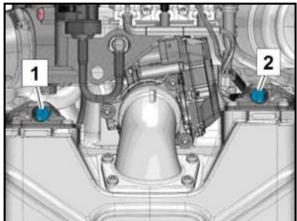

- Open the bleeder screws <1> and <2> one after the other until coolant starts to come out.
- Close the bleeder screw.

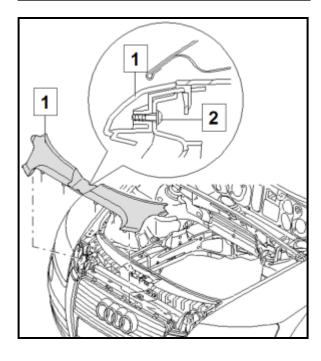




Tip: S4 & S5 models do not require the removal of the lock carrier cover.


- Remove the lock carrier cover <1> by unclipping the cover on the front and then pull forward.

January 2015 24AP/H6 Page 48 of 56

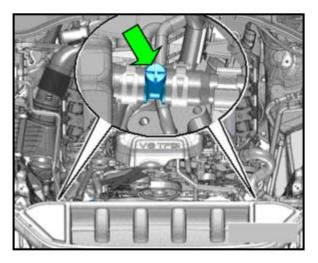

Q7 models:

- Open the bleeder screws <arrow> on the left and right cooler for the charge air cooling circuit until coolant starts to come out.
- Close the bleeder screws.

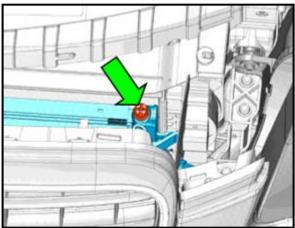

Other models except S4 & S5:

- Open the bleeder screw <arrow> until coolant starts to come out.
- Close the bleeder screw.



- Remove the tools from the coolant reservoir and close coolant reservoir cap <arrow>.
- Reconnect the vehicle battery and reassemble trim/battery coverings as necessary.
- Start the engine.
- Adjust the temperature for all zones to "HI".
- Switch the A/C compressor off by pressing the "ECON" or "AC" button, depending on the version.




Tip:

- If the "ECON" button is present, the LED must illuminate.
- If "AC" button is present, the LED must not come on.
- Run the engine at 2000 RPM for 3 minutes.
- Run the engine at idle until both large coolant hoses on the radiator are warm.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Audi dealer. ©2015 Audi of America, Inc. and Audi Canada. All Rights Reserved.


January 2015 24AP/H6 Page 49 of 56

- Run the engine at 2000 RPM for 2 minutes.
- Turn off engine and allow it to cool off.
- · Check coolant level.

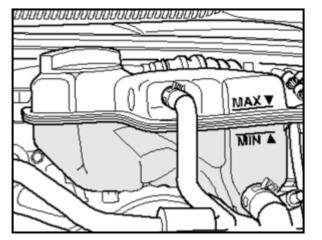




- Coolant level must be at "MAX" marking with engine cold.
- Coolant level may be above "MAX" marking with engine at operating temperature.

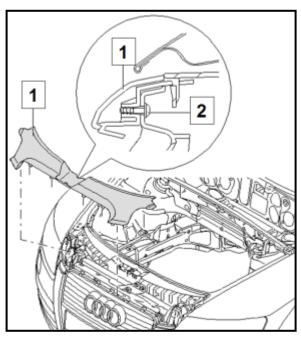

- ← Reinstall the lock carrier cover <1>.
- ← Reinstall screw <2> for lock carrier cover.



- Reinstall engine covers <arrows>.
- Close hood.

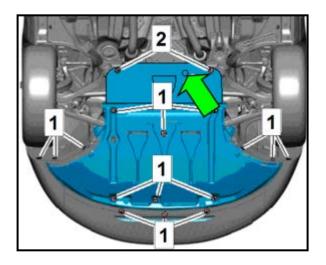

Raise vehicle on hoist and reinstall the noise insulation and the mounting parts <1, 2, arrow>.

If Criteria 03 is open, Proceed to Section K.

If Criteria 03 is NOT open, Proceed to section L.

Section K – ECM Software Update and Oil Change

SVM Update Instructions

- 1. Follow all instructions in TSB 2011732: 00 Software Version Management (SVM), operating instructions.
- 2. Using Audi Flashing, update the ECM, using the SVM action code **01A092**.

Proceed to Section L

Section L - Campaign Stamp

- Once the campaign has been completed, the technician should stamp the repair order.
- Stamps are available for ordering through the Compliance Label Ordering Portal (item# AUD4927ENG).

I certify that this campaign has been performed in strict accordance with the applicable Audi repair procedure.

SAGA Code:.

Technician:

Date:

Item#: AUD4927ENG

OR

Je certifie que cette campagne de rappel a été exécutée suivant les strictes directives de réparation d'Audi

Code de SAGA:..

Technicien

Date:

Item # AUD4927FRE

Proceed to Section M

January 2015 24AP/H6 Page 51 of 56

Section M - Parts Return/Disposal

Properly destroy or dispose of removed parts in accordance with all state and local requirements, unless otherwise indicated and/or requested through the Warranty Parts Shipping Portal (WPSP) for U.S. and SAGA for Canada.

California Only - Continue to section N

Section N - CALIFORNIA ONLY Requirements for Emissions Campaigns Having **Customer Notification**

The California Air Resources Board and the Department of Motor Vehicles (DMV) require emissions-related campaigns to be completed prior to vehicle registration renewal. When campaign work is done you must provide the owner with a signed "Vehicle Emission Recall – Proof of Correction" certificate (RC EMIS_CAL VW). Certificates can be ordered at no cost can be ordered at no cost online via the Compliance Label Ordering portal at www.accessaudi.com.



Tip: Ensure owners are aware of the importance of retaining the completed certificate for their records. It should be mailed to the California DMV only upon request.

ALL WORK IS COMPLETE

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Audi dealer. ©2015 Audi of America, Inc. and Audi Canada. All Rights Reserved.

January 2015 24AP/H6 Page 52 of 56

Appendix A – Activating/Deactivating Vehicle Lift Mode



Tip: Before raising vehicle with vehicle jack or hoist, vehicle lift mode must be activated so that the air suspension automatic control procedures do not create difficulties when raising with vehicle jack or hoist.



Note: Vehicle lift mode is automatically switched off at a speed above 10 km/h.

Switching On:

- Switch on ignition.
- Press "CAR" function button to view "adaptive air suspension" main menu.
- Press "SETUP" function button to view "adaptive air suspension" menu.
- Rotate control knob to desired mode and select "ON".
- Switch the ignition off.


Switching OFF:

- Switch on ignition.
- Press "CAR" function button to view "adaptive air suspension" main menu.
- Press "SETUP" function button to view "adaptive air suspension" menu.
- Rotate control knob to "Vehicle lift mode" and select "OFF".
- Switch the ignition off.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Audi dealer. ©2015 Audi of America, Inc. and Audi Canada. All Rights Reserved.

January 2015 24AP/H6 Page 53 of 56


Appendix B - Replacing the Fuel Injector **Seals**

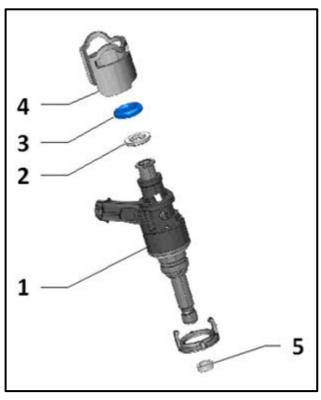




Note: Follow this procedure ONLY on injectors that came out of the cylinder head during removal of the fuel rail.

- <3>, and the spacer ring <2> from the fuel injector.
- Carefully cut and remove the combustion chamber sealing ring <5>.
- Use a clean cloth to remove any excess combustion residue from the sealing ring groove on the fuel injector.

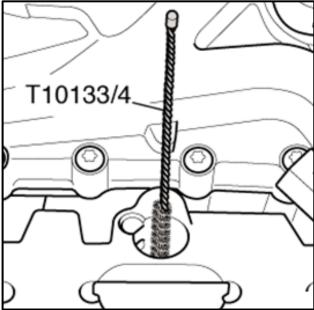


← Clean the fuel injector hole inside the cylinder head with the nylon cylinder brush T10133/4 <as shown>.


January 2015 24AP/H6 Page 54 of 56

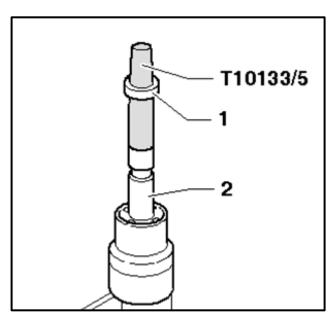

Place the assembly cone T10133/5 with the new combustion chamber seal <1> onto the fuel injector <2>.

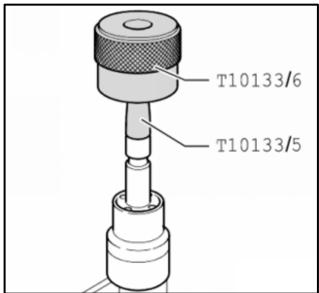

- Slide the combustion chamber seal with the assembly sleeve T10133/6 onto the assembly cone T10133/5 as far as possible.
- Turn the assembly sleeve T10133/6 and the combustion chamber seal until they slide into the seal groove.

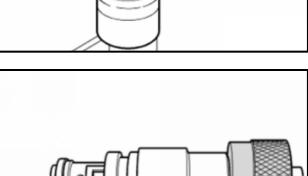


T10133/7


- Note: When pushing the combustion chamber seal onto the fuel injector the seal spreads open. After pushing it on, it must be tightened again in two steps, as illustrated in the following steps.
- Press the calibration sleeve T10133/7 with a gentle turning movement (approximately 180°) all the way onto the fuel injector.
- Remove the calibration sleeve T10133/7 by gently turning it in the opposite direction.
- Repeat these steps using calibration sleeve T10133/8.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Audi dealer. ©2015 Audi of America, Inc. and Audi Canada. All Rights Reserved.

January 2015 24AP/H6 Page 55 of 56

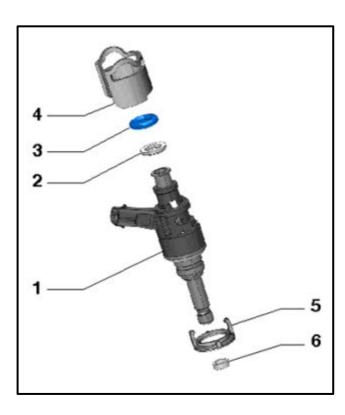

- Install the components from the repair kit onto the fuel injector <1>.
- ∠ 2 Spacer Ring
- \leftarrow 3 O-Ring
- ← 4 Support Ring (not supplied in kit)
- 5 Sealing washer (this seal is reused for this procedure).
- Coat the new O-ring <3> with clean engine oil before installing it.
- Note: The combustion chamber seal <6> must NOT be oiled.
 - Install the fuel injector into the cylinder head by hand until it stops. Make sure the electrical connection is positioned correctly.
- Note: The injector must NOT be difficult to install. If necessary, wait and allow the combustion chamber seal to further contract, then retry installation.

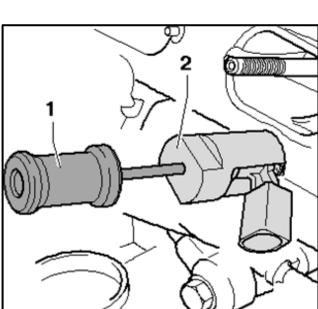

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Audi dealer. ©2015 Audi of America, Inc. and Audi Canada. All Rights Reserved.

January 2015 24AP/H6 Page 56 of 56