

TECHNICAL BULLETIN

J049NAS1

13 MAR 2015



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 417-01

Non-Compliance Recall: Parking Light Illumination

AFFECTED VEHICLE RANGE:

XK Range (X150)

Model Year: 2012-2015

VIN: B44940-B56794

MARKETS:

NAS

CONDITION SUMMARY:

Situation: A non-compliance issue has been identified on a limited number of 2012-2015 model year Jaguar XK (X150) vehicles where the front side lights, when used as parking lamps, will extinguish in error after approximately five (5) minutes.

Vehicles in this condition will not comply with the requirements of the Canada Motor Vehicle Safety Standard (CMVSS) 108 - Lighting System and Retro Reflective Devices [Canada] and the Federal Motor Vehicle Safety Standard (FMVSS) 108 - Lamps, Reflective Devices, and Associated Equipment [USA].

Action: Retailers are required to **HOLD** only affected new vehicles that are within your control and refrain from releasing the vehicles for new vehicle sale pending completion of the rework action detailed in this Technical Bulletin. Unsold vehicles should have this performed as part of the Pre-Delivery Inspection (PDI) process but **must** have it completed prior to vehicle handover to the customer.

Affected vehicles already in the hands of customers should be updated at the next available opportunity.

PARTS:

No parts required

SPECIAL TOOLS:



NOTE: this document is an 'Active Bulletin' that will display a functional programming shortcut if accessed within a diagnostic session using SDD.

SDD with latest SDD-DVD and Calibration File

Jaguar Land Rover-approved Midtronics Battery Power Supply

WARRANTY:



NOTE: check DDW to ensure that a vehicle is affected by this program prior to undertaking any rework action.