

1/09/2016

ATTENTION:
DEALER PRINCIPAL
SERVICE MANAGER
SERVICE TECHNICIAN

SUBJECT: TECH-TIPS R06 RECALL / OCCUPANT RESTRAINT CONTROL MODULE REPLACEMENT

As per the note below, please advise service technicians when performing service Recall R06 that they will be required to electronically configure the ACM if the vehicle is not equipped with the optional side curtain airbags.

NOTE: ALL SERVICE REPLACEMENT AIRBAG CONTROL MODULES (ACM) ARE SHIPPED CONFIGURED FOR THE OPTIONAL SIDE CURTAIN AIRBAG FEATURE. IF A SERVICE REPLACEMENT ACM IS INSTALLED IN A VEHICLE THAT IS NOT EQUIPPED WITH THE OPTIONAL SIDE CURTAIN AIRBAGS, THE AIRBAG INDICATOR WILL ILLUMINATE AND “NO RIGHT SIACM” AND “NO LEFT SIACM” DTCS WILL BE REGISTERED.

THE ACM MUST BE CONFIGURED TO ELECTRONICALLY DISABLE THE SIDE CURTAIN AIRBAG FEATURE USING A DRBIII® SCAN TOOL OR WITH WITECH USING THE DRBIII EMULATOR.

The Recall is being revised to include this note and below is the procedure to follow in order to disable the side curtain airbag feature.

CONFIGURE ORC MODULE – with active DTC’s “No Right SIACM and No Left SIACM”

- A. From the “SELECT FUNCTION” Screen on the DRBIII select 9. “Miscellaneous button.
- B. Then select 1. “Configure for Side Airbag”
- C. Screen Prompt, “Do you want to continue?” Select “Enter”
- D. Verify Current Status is set to: “ACM with Side Airbags”
- E. Select 2. “ACM without Side Airbags” then “Enter”
- F. Verify Current Status a second time, should now read: “ACM without Side Airbags”
- G. Select BACK PAGE to exit
- H. Select 2. Read DTC’s
- I. Select 1. Active
- J.** Verify No DTCs Detected