



This Service Information bulletin supersedes SI B16 03 15 **dated June 2015**.

**NEW** designates changes to this revision

#### SUBJECT

**NEW** Recall Campaign 15V-189: Replace Low-pressure Electric In-tank Fuel Pump

#### MODEL

F22 (2 Series Coupe)

F30 (3 Series Sedan)

F30 H (ActiveHybrid 3)

F31 (3 Series Sports Wagon)

F32 (4 Series Coupe)

F33 (4 Series Convertible)

F34 (3 Series Gran Turismo)

F36 (4 Series Gran Coupe)

#### NEW SITUATION

BMW AG is conducting a voluntary Safety Recall involving the low-pressure electric in-tank fuel pump on certain Model Year 2014 and 2015 2 Series, 3 Series and 4 Series vehicles.

Affected vehicles may be equipped with a low-pressure electric in-tank fuel pump which can become inoperative due to improper plating of certain subcomponents within the fuel pump.

#### NEW AFFECTED VEHICLES

This Recall Campaign involves F22, F30, F31, F32, F33, F34, and F36 vehicles produced from August 2013 to April 2014.

Vehicles which require this Recall Campaign to be completed will show it as "Open" when checked either in the "Service Menu" of DCSnet (Dealer Communication System) or with the Key Reader.

On July 6, 2015, a final letter will be mailed to customers informing them to visit a center and have the repair performed.

#### NEW PROCEDURE

Replace the low-pressure electric in-tank fuel pump as Repair Instruction 16 14 010, "Removing and installing or replacing fuel pump." Refer to the parts information section for the applicable fuel pump part number.

If necessary, drain the fuel from the vehicle prior to performing repairs. Refer to Repair Instruction 16 00 005, "Draining and filling fuel tank."

#### NEW PARTS INFORMATION

Vehicles with N20, N26 and N55 engines only

Part Number	Description	Quantity

16 11 7 243 975	Delivery module (vehicles with N20, N26 and N55 engines only)	1
16 11 7 188 567	O-ring	1
16 11 7 428 463	O-ring	1

Vehicles with the N55H engine only.

Part Number	Description	Quantity
16 14 7 264 433	Delivery module (vehicles with N55H engine only)	1
16 11 7 188 567	O-ring	1
16 11 7 428 463	O-ring	1

#### **NEW** WARRANTY INFORMATION

Reimbursement for this Recall will be via normal claim entry utilizing the following information:

<b>Defect Code:</b>	<b>00 16 97 01 00</b>
---------------------	-----------------------

#### **Completion before vehicle delivery to the customer or the vehicle is already in the workshop**

Labor Operation:	Labor Allowance:	Description:
00 63 550	F22: 8 FRU; F30, F31, F32, F33, F34, F36: 7 FRU	Replace the low-pressure electric in-tank fuel pump (delivery module) (Plus work - includes extracting/refilling fuel)

Or:

#### **Completion after vehicle delivery to the customer**

Labor Operation:	Labor Allowance:	Description:
00 63 018	F22: 10 FRU; F30, F31, F32, F33, F34, F36: 9 FRU	Replace the low-pressure electric in-tank fuel pump (delivery module) (Main work - includes extracting/refilling fuel)

#### **ADDITIONAL INFORMATION**

Perform the procedure outlined in this Service Information on all affected vehicles **BEFORE** customer delivery or the next time they are in the shop for maintenance or repairs.

#### **ATTACHMENTS**

View PDF attachment [B160315 Final Letter](#).

View PDF attachment [B160315 Q&A](#).

View PDF attachment [B160315 Recall Notice](#).