# 65 77 ... Replacing OC3 sensor mat with padding for front passenger seat.

STOP	<ul> <li>A replacement of the OC3 sensor mat can only be performed in conjunction with the padding without the seat cover. Only use the part number in the SI.</li> </ul>
	<ul> <li>Incorrect handling can activate airbag and cause injury. Review and note airbag safety regulations!</li> </ul>
	The new part comes with transport rods, both rods must be removed and discard. See below

#### **Prerequisites**

- Ignition off; disconnect battery.
- REP 52 13 000 "Removing and installing driver's or front passenger seat (normal / manual)".
- REP 52 13 041 "Removing and installing inner panel on driver's and front passenger seats (manual)".
- REP 52 13 043 "Removing and installing outer panel on driver's and front passenger seats (manual)".
- REP 72 11 041 "Removing and installing front left or right buckle anchorage (belt tensioner)".

### Important repair hint for the main work





2

	<ul> <li>Release front bracket (1) of trim panel.</li> <li>Remove upholstered cover.</li> </ul> Installation note: Before installing the upholstered trim panel, make sure that the upholstery cloth is firmly seated in seat frame.
D D D D D D D D D D D D D D D D D D D	<ul> <li>Carefully cut all the hog rings in the side area as shown (1).</li> <li>Depending on the version, if required, carefully fold back seat cover and release hog rings from the cross-wires.</li> <li>Remove seat cover from upholstery.</li> </ul> Important! Remover all remnants of the hog ring from seat cover.
<b>R</b> B52 00818	<ul> <li>Note:</li> <li>Padding (1) is delivered with fitted OC3 seat mat (2).</li> <li>Before installing the cover, transportation retainers (3) <u>must be removed and discarded</u>.</li> </ul>



## Concluding work

#### Notes:

Four Powerlok screws must be replaced and not reused; tightening torque: 45 Nm.

The tightening torque for the screw for seat mounting is: 45 Nm + Torque angle: 90°

The floor carpet must not project between the seat rail and floor board in the area of the screw-down points (grinding noises).

4

Reassemble the new OC3 seat mat with the seat cover. Reinstall the seat in the vehicle and connect the cable to the vehicle. Reconnect the vehicle battery.

### Enable the new seat mat with ISTA/P:

Connect the vehicle to ISTA/P and code the airbag control unit. Recheck operation.