



SI B52 09 15
Seats

October 2015
Technical Service

This Service Information bulletin supersedes SI 52 09 15 **dated October 2015.**

Please perform the procedure outlined in this Service Information on all affected vehicles before customer delivery. In the event the customer has already taken delivery of the vehicle, please perform the procedure the next time the vehicle is in the shop.

NEW designates changes to this revision

SUBJECT

NEW Recall 15V-XXX: ISOFIX Bracket

MODEL

F10 (5 Series Sedan)

Produced from July 20, 2015 to September 14, 2015

NEW SITUATION

BMW AG is conducting a Voluntary Non-Compliance Recall involving the ISOFIX bracket in the rear seat. The bracket may be bent, which will not allow for the child seat strap to be properly attached.

NEW AFFECTED VEHICLES

This Recall involves 5 Series Sedans produced from July 20, 2015 to September 14, 2015.

Affected vehicles can be identified with a “Vehicle Comment” in DCS Warranty Vehicle Inquiry or ISPA Light with the description:

“A Delivery Stop has been issued for this vehicle. Dealers must ensure that all Campaigns are completed before retail delivery to the customer. See Service Information Bulletin B52 09 15.”

CAUSE


NEW Inboard bracket (anchor) in the left rear seating position may be deformed.

CORRECTION

NEW Inboard bracket (anchor) in the left rear seating position must be adjusted into correct position.

PROCEDURE

	<ol style="list-style-type: none"> 1. Check the gap on the right side bracket of the left side rear seat. <p>The bracket to be checked is shown.</p>
--	---

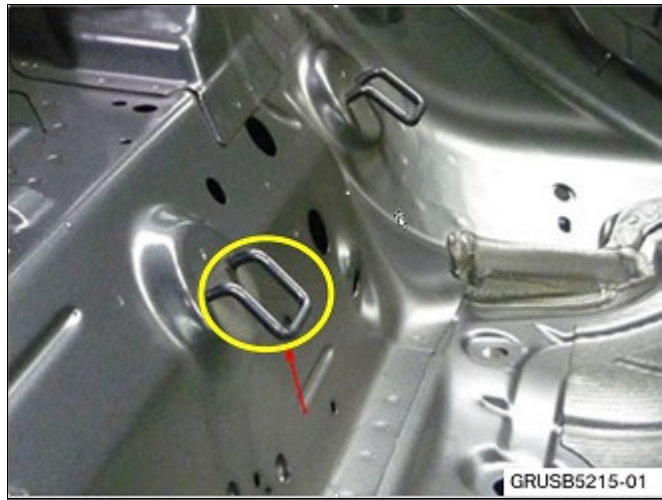

2. Check the gap between the seat bottom and ISO bracket using an appropriate measuring tool.

Note: The seat bottom to bracket gap must be 4 mm to 6 mm.



3. If the gap is not correct, adjust the bracket by bending the uprights.
4. After the rework, recheck the gap measurement.

PARTS INFORMATION

No parts are needed.

WARRANTY INFORMATION

Important note: The labor operations listed below will be available in the system on Monday November 2, 2015.

NEW Please delay your claim submission until then, we apologize for any inconvenience this situation may cause.

NEW Reimbursement for this Recall will be via normal claim entry utilizing the following information:

Defect Code:	00 41 71 01 00	
---------------------	-----------------------	--

Completion “before” vehicle delivery to the customer or the vehicle is already in the workshop

Labor Operation:	Labor Allowance:	Description:
00 63 824	3 FRU	Check the gaps between the seat bottom and ISO bracket (No repair is necessary) (Plus work)
Or:		
00 63 825	5 FRU	Check the gaps between the seat bottom and ISO bracket, remove and install rear seat and correct the gap(s) (Plus work)

Or:

Completion “after” vehicle delivery to the customer

Labor Operation:	Labor Allowance:	Description:
00 63 160	5 FRU	Check the gaps between the seat bottom and ISO bracket (No repair is necessary) (Main work)
Or:		
00 63 161	6 FRU	

		Check the gaps between the seat bottom and ISO bracket, remove and install rear seat and correct the gap(s) (Main work)
--	--	---

ATTACHMENTS

View PDF attachment [B520915 Q&A.](#)

View PDF attachment [B520915 Recall Notice.](#)

[Copyright ©2015 BMW of North America, Inc.]