



SI M65 12 15
Audio, Navigation, Monitors, Alarms, SRS

December 2015
Technical Service

This Service Information bulletin supersedes SI M65 12 15 **dated November**.

Please perform the procedure outlined in this Service Information on all affected vehicles before customer delivery. In the event the customer has already taken delivery of the vehicle, please perform the procedure the next time the vehicle is in the shop.

NEW designates changes to this revision

SUBJECT

NEW **Recall 15V-739: Front Passenger Seat Cushion with Capacitive Interior Sensing (CIS) Mat – Prior Parts Replacement**

MODEL

F56 (Hardtop 2-door)

F55 (Hardtop 4-door)

NEW Vehicles produced from February 25, 2014 to June 11, 2015

NEW SITUATION

BMW AG is conducting a Voluntary Safety Recall involving the Front Passenger Seat Cushion including CIS Mat Sensor – prior parts replacement:

As a result of a prior repair by a MINI dealer to replace the front passenger's seat cushion, some vehicles may have received an "incorrectly" programmed seat mat sensor.

For your reference, a Q&A has been attached.

NEW AFFECTED VEHICLES

This Recall Campaign involves F55 and F56 vehicles produced from February 25, 2014 to June 11, 2015.


Vehicles which require this Recall Campaign to be completed will show it as "Open" when checked either in AIR, the "Service Menu" of DCSnet (Dealer Communication System) or with the Key Reader.

NEW CORRECTION

Inspect CIS Mat Sensor label for a "green dot" and replace it when it is not present.

NEW PROCEDURE

	<ul style="list-style-type: none"> Remove the 4 mounting bolts for the seat as per repair instructions "52 13 002 Removing and
--	---

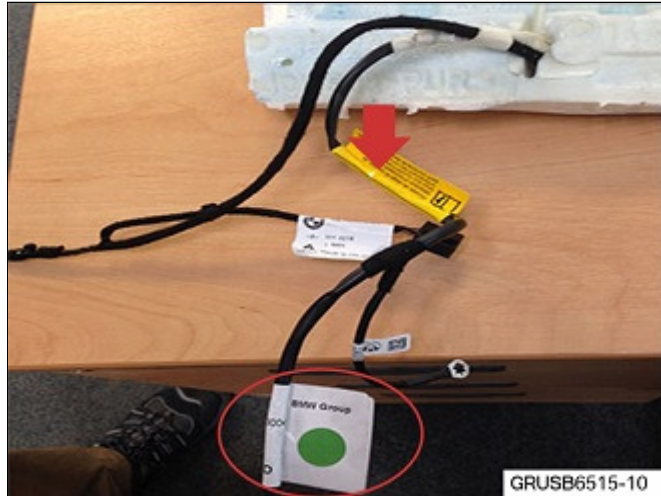

installing front seat, passenger's side" and fold back the seat.

- Inspect the label on the seat-occupancy mat harness for a green dot.
- If the label has a green dot (as shown in the picture), no further action is required.
- If the label does not have a green dot, replace the seat cushion including the front passenger seat's seat-occupancy mat per repair instruction "65 77 610 Replacing seat occupancy mat (CIS) for front passenger seat SBE". Order 1 of the listed parts numbers and the appropriate number of clips listed below in the parts information.
- **Note: After the CIS mat is installed, connect the vehicle to ISTA and enable the new mat by performing the test plan linked to the CIS fault stored. Do not perform programming as recommended by the repair manual.**

NEW PARTS INFORMATION

With only 38 vehicles involved we will use VIN specific ordering. Please email your request to SpecialPartsRequest@bmwna.com. Please include your Dealer code with the ship to address, VIN, part number and your contact information.

Part Number	Description	Quantity
52 10 7 389 109	Basic seat, imitation leather (K9)	1
52 10 7 389 110	Sports seat, cloth option 481 (BZ)	1
52 10 7 391 921	Sports seat, imitation leather option 481 (KD)	1
52 10 7 391 923	Sports seat, imitation leather option 481 (K9)	1
52 10 7 391 924	Sports seat, leather option 481 (NE)	1
52 10 1 945 543	Clips	As needed

NEW WARRANTY INFORMATION

Reimbursement for this Recall will be via normal claim entry utilizing the following information:

Defect Code:	00 52 75 01 00	
Labor Operation:	Labor Allowance:	Description:
00 63 175	5 FRU	Check the mat sensor for a label with green dot (No rework repair is necessary) (Main work)
Or:		
00 63 176	25 FRU	Re-replace the seat cushion together with the front passenger seat's seat-occupancy mat (includes connecting an approved battery charger/power supply and performing a vehicle test) (Main work)

ATTACHMENTS

View PDF attachment [M651215 Q&A](#).

View PDF attachment [M651215 Recall Notice](#).

[Copyright ©2015 BMW of North America, Inc.]