



Upcoming Product Safety Recall 15168

INSPECTION PROCEDURE

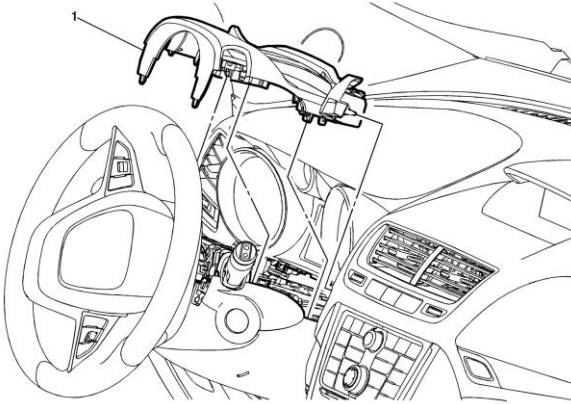


2784015

1. Unclip the steering column upper trim cover (1) from the steering column lower trim cover.
2. Disengage the steering column upper trim cover flexible part from instrument cluster.
3. Carefully pull plastic part rearward from instrument cluster.

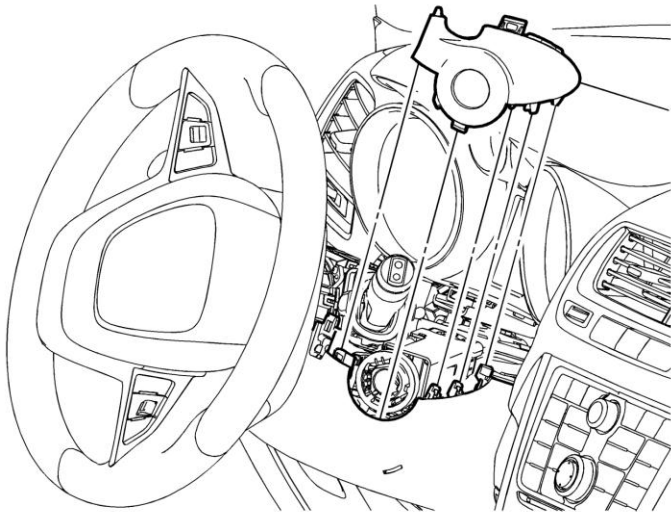


2780180

4. Unclip the ignition lock cylinder opening cover (1) from the steering column lower trim cover.
5. Remove the ignition lock cylinder opening cover.

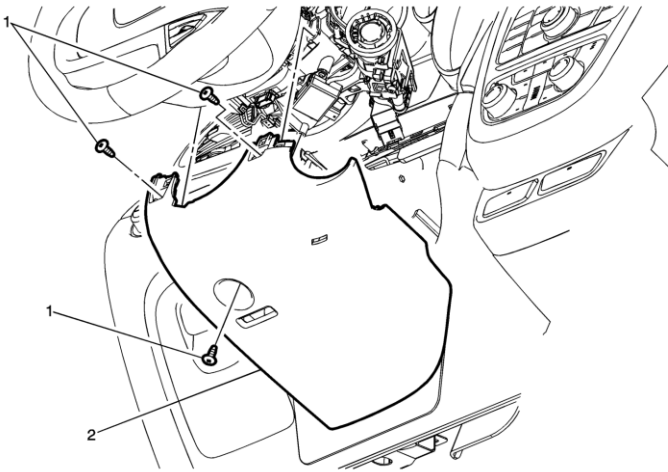

2784018


- 6. Remove the fasteners (1) from the steering column lower trim cover (2).
- 7. Remove the steering column lower trim cover for column inspection.

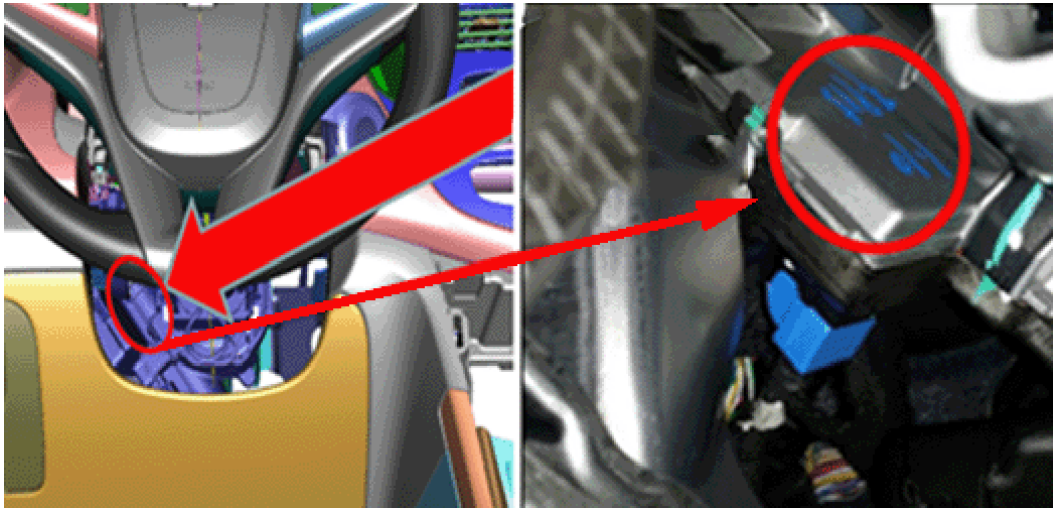

4109043

Location of steering column lot number

- 8. Check the housing LOT number.

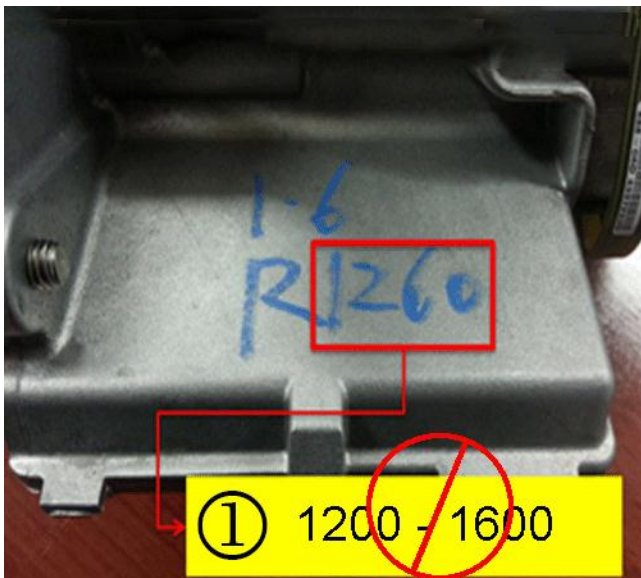

4109045

NOTE: If the LOT number is illegible, or not readable, the vehicle must be held for steering column replacement.

- 9. A part with a LOT number (1) above 1200 **(including 1200, and up to and including 1600) is *not* OK. The vehicle must be held for steering column replacement.**
- 10. If the LOT number is less than 1199, then the part is OK and the vehicle has passed inspection. Re-assemble parts in reverse order.
- 11. **If the steering column has failed inspection, the vehicle must be held for steering column replacement.**

WARRANTY TRANSACTION INFORMATION

Submit a transaction using the table below. All transactions should be submitted as a ZFAT transaction type, unless noted otherwise.

Please submit warranty claim transactions for the inspection procedure beginning March 14, 2015.

Labor Code	Description	Labor Time
9101359	Inspect Steering Column LOT number – No Further Action Required	0.2