

FCA US LLC Chronology
Takata PSDI-4 Driver Airbag Inflators
Original Submission May 26, 2015
Updated June 10, 2015

- On June 11, 2014, Takata Holdings Inc. ("Takata") sent a letter to the National Highway Traffic Safety Administration ("NHTSA") supporting a regional field action to address potential driver and passenger airbag inflator issues. The root cause had not been identified.
- Takata defined a suspect "Beta" population of driver airbag inflators as being built between January 1, 2004 and June 30, 2007.
- Takata's letter identified four areas (Florida, Hawaii, Puerto Rico and U.S. Virgin Islands) where exposure to exceptionally high levels of absolute humidity, in conjunction with potential processing issues during certain manufacturing time periods, may influence the aging stability of the airbag inflators.
- On June 24, 2014, the FCA US LLC ("FCA US") Vehicle Regulations Committee ("VRC") authorized a Regional Field Action (P40) on certain 2003 – 2007 Ram 1500 ("DR"), 2500 ("DH"), 3500 ("D1"), and 3500 Cab Chassis ("DC") as well as Dodge Durango ("HB"), Aspen ("HG"), Charger ("LX"), and Dakota ("ND") vehicles produced in the same period, to replace the driver and/or passenger airbag inflators supplied by Takata, in vehicles sold to or currently registered in Florida, Hawaii, Puerto Rico and U.S. Virgin Islands. No defect determination was made.
- In a November 26, 2014 Recall Request Letter, NHTSA demanded Takata determine a defect for all affected driver side airbag inflators nationwide.
- In response to the Recall Request Letter from NHTSA, on December 2, 2014 Takata refused to determine a nationwide safety defect in all vehicles equipped with the subject driver side airbag inflators.
- As of December 18, 2014, Takata had not submitted a 573 Defect Information Report for the driver airbag inflator families.
- Certain FCA US vehicles were built with the Beta population Takata PSDI-4 driver airbag inflators. Among this population, there have been four Takata PSDI-4 driver airbag inflator ruptures in the field. The locations of the four failures were Florida (two), California (one), and North Carolina (one).
- One of the four field failures occurred in September of 2013, in a 2006 FCA US vehicle where a PSDI-4 driver airbag inflator ruptured and caused non-life threatening injuries. The remaining three PSDI-4 field incidents Takata has shared with FCA US occurred in other OEM vehicles.
- On December 17, 2014, FCA US decided to expand the Regional Field Action conducted on Takata PSDI-4 driver airbag inflators nationwide.
- On December 18, 2014, the VRC authorized the execution of a voluntary global safety recall (R81) to replace the front driver airbag inflator in the 2004-2007 affected vehicle families.
- On May 18, 2015, Takata submitted a 573 Safety Defect Information Report to NHTSA (15E-040), "Takata has determined that a defect related to motor vehicle safety may arise in some of the subject inflators."
- As of Takata's May 15, 2015 Beta Ballistics Report, Takata has tested 551 PSDI-4 front passenger airbag inflators removed from FCA US vehicles predominantly in Florida (420 from the 4-state region, 83 from the 7-state "plus" region, 48 from all other states). FCA US is aware of one (Florida) airbag inflator failure during such testing.
- As of May 21, 2015, FCA US is aware of one confirmed customer complaint involving one injury, 0 accidents, and 0 fatalities involving a PSDI-4 driver airbag inflator rupture in any FCA US vehicle.
- On May 21, 2015, FCA US authorized the execution of a voluntary safety recall to replace the Takata PSDI-4 front driver airbag inflator in the 2004-2011 affected vehicle families. This new recall will replace the previous Takata PSDI-4 front driver airbag recalls P40 and P81. Vehicles previously repaired with Takata PSDI-4 replacement front driver airbags inflators under the P40 and P81 recalls will be included in this new recall.

- On June 9, 2015, Daimler Trucks North America LLC (“Daimler”) submitted a 573 Safety Defect Information Report to NHTSA, in response to the May 18, 2015 Takata submitted 573 Safety Defect Information Report to NHTSA where "Takata has determined that a defect related to motor vehicle safety may arise in some of the subject inflators."
- On June 10, 2015, FCA US has removed any reference to the 2008-2009 Dodge Ram (DA) 4500/5500 Cab Chassis vehicles from 15V313, in response to the June 9, 2015 573 submission by Daimler.
- Additionally, FCA US has not revised the number of potentially involved vehicles (4,066,732) that were reported at the time of the original submission of 15V313, because at the time the 2008-2009 Dodge Ram (DA) 4500/5500 Cab Chassis vehicle volumes from Daimler were unknown.