

# Part 573 Safety Recall Report

# 16V-007

**Manufacturer Name :** Gulf Stream Coach, Inc.

**Submission Date :** MAY 05, 2017

**NHTSA Recall No. :** 16V-007

**Manufacturer Recall No. :** CS070116



## Manufacturer Information :

**Manufacturer Name :** Gulf Stream Coach, Inc.

**Address :** P. O. Box 1005  
503 S. Oakland Avenue Nappanee IN  
46550

**Company phone :** 999-999-9999

## Population :

**Number of potentially involved :** 793

**Estimated percentage with defect :** 100 %

## Vehicle Information :

**Vehicle 1 :** 2008-2010 To be determined To be determined

**Vehicle Type :** BUSES, MEDIUM & HEAVY VEHICLES

**Body Style :** ALL

**Power Train :** GAS

**Descriptive Information :** Gulf Stream Coach Motorized Class A and Class C motor homes to be determined.

**Production Dates :** AUG 01, 2007 - SEP 30, 2010

**VIN Range 1 : Begin :** NR **End :** NR

Not sequential

## Description of Defect :

**Description of the Defect :** Lippert Components, Inc. has identified a defect which relates to motor vehicle safety which exists in vehicles equipped with certain LCI Coachstep electric double steps or triple entrance steps for installation and use on motorized recreational vehicles. Lippert Components NHTSA Safety Recall number 15E-078 has been assigned.

**FMVSS 1 :** NR

**FMVSS 2 :** NR

**Description of the Safety Risk :** There is the potential of a structural fracture of the center bolt of the fan gear assembly which may cause the fan gear assembly to disengage from the steps creating an unstable platform which could cause a person to fall and result in injury.

**Description of the Cause :** Mrchcanical fastener failure

**Identification of Any Warning that can Occur :** Unknown at this time

**Supplier Identification :****Component Manufacturer**

Name : Lippert Components, Inc.  
Address : 2703 College Ave.  
Goshen INDIANA 465285040  
Country : United States

**Chronology :**

Gulf Stream Coach, Inc. (Gulfstream) received notification via e-mail from Lippert Components Inc. (LCI) representative on December 15, 2015, that (LCI) had determined a defect existed in the Coachstep electric double and triple entry step supplied by LCI and that no parts were available at that time. On February 5, 2016, an e-mail notification was received from (LCI) representative their formal updated Customer Notification with repair instructions with notice of parts availability were now ready.

**Description of Remedy :**

Description of Remedy Program : Lippert Components, Inc. (LCI) has identified a repair kit (Kit Part #389761) for the double step and (Kit Part # 389152) for the Coachstep triple step, with work instructions which will be supplied at no charge, to be installed on the steps. The parts kit for remedy are currently NOT AVAILABLE and LCI will separately notify customers and dealers when they are available to order.

How Remedy Component Differs from Recalled Component : Addition of new retainer bracket and mechanical fasteners (Recall Parts Kit #389761) to be added to the existing Coachstep double step, and retainer bracket with additional ball joint and mechanical fasteners (Recall Parts Kit #389152) to be installed on the Coachstep Triple step.

Identify How/When Recall Condition was Corrected in Production : Unknown at this time

**Recall Schedule :**

Description of Recall Schedule : Gulf Stream Coach, Inc. is deceminating the make, model, and owner information to provide LCI Warranty Department with a complete listing of potential units affected.  
Planned Dealer Notification Date : FEB 29, 2016 - MAR 11, 2016  
Planned Owner Notification Date : FEB 29, 2016 - MAR 11, 2016

\* NR - Not Reported