

**Part 573 Safety Recall Report****16V-047****Manufacturer Name :** Chrysler (FCA US LLC)**Submission Date :** JAN 26, 2016**NHTSA Recall No. :** 16V-047**Manufacturer Recall No. :** S07**Manufacturer Information :**

Manufacturer Name : Chrysler (FCA US LLC)

Address : 800 Chrysler Drive

CIMS 482-00-91 Auburn Hills MI 48326-2757

Company phone : 1-800-853-1403

**Population :**

Number of potentially involved : 112,001

Estimated percentage with defect : 1

**Vehicle Information :**

Vehicle : 2009-2009 Dodge Journey

Vehicle Type :

Body Style : ALL

Power Train : NR

Descriptive Information : Certain 2009 MY Dodge Journey

Production Dates : DEC 31, 2007 - AUG 31, 2008

**VIN (Vehicle Identification Number) Range**

Begin : NR

End : NR

 Not sequential VINs

Vehicle : 2008-2009 Dodge Grand Caravan

Vehicle Type :

Body Style : ALL

Power Train : NR

Descriptive Information : Certain 2008 &amp; 2009 MY Dodge Grand Caravan

Production Dates : JUN 18, 2007 - AUG 31, 2008

**VIN (Vehicle Identification Number) Range**

Begin : NR

End : NR

 Not sequential VINs

Vehicle : 2008-2009 Chrysler Town and Country

Vehicle Type :

Body Style : ALL

Power Train : NR

Descriptive Information : Certain 2008 &amp; 2009 MY Chrysler Town and Country

Production Dates : JUN 18, 2007 - AUG 31, 2008

**VIN (Vehicle Identification Number) Range**

Begin : NR

End : NR

 Not sequential VINs

Vehicle : 2009-2009 Volkswagen Routan

Vehicle Type :

Body Style : ALL

Power Train : NR

Descriptive Information : Certain 2009 MY Volkswagen Routan

Production Dates : AUG 11, 2008 - AUG 31, 2008

**VIN (Vehicle Identification Number) Range**

Begin : NR

End : NR

 Not sequential VINs**Description of Defect :**

Description of the Defect : Some Chrysler Town & Country, Dodge Grand Caravan, Dodge Journey and Volkswagen Routan vehicles may experience an occupant restraint controller ("ORC") malfunction resulting in an illuminated airbag warning lamp with the possibility all restraint systems, including airbags, may not deploy in the event of a crash, or an inadvertent air bag deployment without prior illumination of the airbag warning lamp.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : If the airbag warning lamp is ignored, and the ORC is not replaced, all restraint systems, including the airbags may not deploy in a crash, which could increase the risk of serious injury or death. In the event of an ORC malfunction resulting in inadvertent deployment of the airbags, the risk of a crash and/or injuries could be increased.

Description of the Cause : NR

Identification of Any Warning that can Occur : The airbag warning lamp will immediately illuminate if the ORC detects a malfunction.

**Supplier Identification :****Component Manufacturer**

Name : Continental Automotive Systems Inc.

Address : One Continental Drive

Auburn Hills MICHIGAN 48326

Country : United States

**Chronology :**

Please see the attached supplemental information titled "FCA US LLC Chronology RT RM JC ORC Corrosion 012016.pdf".

**Description of Remedy :**

Description of Remedy Program : Conduct a voluntary Safety Recall on all affected vehicles to replace the ORC. FCA US has a longstanding policy and practice of reimbursing owners who have incurred the cost of repairing a problem that subsequently becomes the subject of a field action. To ensure consistency, FCA US, as part of the owner letter, will request that customers send the original receipt and/or other adequate proof of payment to the company for confirmation of the expense.

How Remedy Component Differs from Recalled Component : NR  
Identify How/When Recall Condition was Corrected in Production : NR

**Recall Schedule :**

Description of Recall Schedule : FCA US will provide a dealer notification and owner notification schedule once established.

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : NR - NR

\* NR - Not Reported